

14 February 2006

Mr. Devender Narala Regional Water Quality Control Board San Francisco Bay Region 1515 Clay Street, Suite 1400 Oakland, California 94612

Subject: Final Corrective Action Plan, Building 1349 Study Area, dated February 2006

Dear Mr. Narala:

Enclosed please find one copy of the *Final Corrective Action Plan, Building 1349 Study Area, Presidio of San Francisco, California* (Final CAP) dated February 2006. This Final CAP dated February 2006 incorporates all edits made to the document in response to comments received on both the Draft CAP (March 2005) and Final CAP (January 2006 version).

We look forward to your approval of the enclosed Final CAP and working with the Regional Water Quality Control Board on the implementation of this Final CAP later this year. Please feel free to call me at 415-561-4259 if you have any questions and/or comments.

Sincerely,


Craig Cooper

Remediation Program Manager

Enclosure

cc with enclosure: Bob Boggs, DTSC

Brian Ullensvang, NPS Doug Kern, RAB Mark Youngkin, RAB

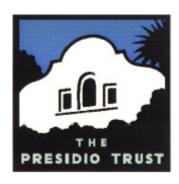

# Final Corrective Action Plan Building 1349 Study Area Presidio of San Francisco, California

Presidio Trust San Francisco, California February 2006



# Table of Contents

List of Acronyms and Abbreviationsv								
Section	1.	Introduction						
		1.1	Presidio Background	1_1				
		1.2	Study Area Background					
		Regulatory Framework						
		1.3 1.4	Public Participation					
Section	2.	2. Study Area Background						
		2.1	Study Area Geology and Hydrogeology	2-1				
			2.1.1 Geologic Setting					
			2.1.1.1 Regional Geology					
			2.1.1.2 Study Area Geology	2-2				
			2.1.2 Hydrogeology	2-3				
			2.1.2.1 Groundwater Monitoring Well Network Description					
			2.1.2.2 Groundwater Occurrence and Flow					
			2.1.2.3 Summary of Hydrogeologic Conditions					
		2.2	Source Areas	2-6				
		2.3	Special Study Area Feature (Telecommunications Conduit)					
		2.4	Previous Investigations and Corrective Actions					
			2.4.1 1995-1996 Site Investigation					
			2.4.2 Building 1349 AST Removal					
			2.4.3 FDS Removals					
			2.4.4 Additional Investigation of FDS					
			2.4.5 2002-2003 Site Investigation					
		2.5	Nature and Extent of Contamination					
		2.5	2.5.1 Nature and Extent of Contamination in Soil					
			2.5.2 Nature and Extent of Contamination in Groundwater					
Section	3.	Sun	3-1					
		3.1	Remedial Action Objectives (RAOs)	3-1				
		3.2	Development of Cleanup Levels and Identification of COCs	3-1				
			3.2.1 Soil Cleanup Levels	3-1				
			3.2.2 Groundwater Cleanup Levels					
			3.2.3 Soil COCs					
			3.2.4 Groundwater COCs					
		3.3	Identification of Remedial Units					
			3.3.1 Shallow Soil					
			3.3.2 Deep Soil					
			3.3.3 Telecommunications Corridor Soil					
			3.3.4 Groundwater	3-6				
Section	1	Fva	lustion of Corrective Actions	<i>A</i> _1				

			4.1		cation of Evaluation Criteria			
				4.1.1	Technical Effectiveness			
				4.1.2	Implementability			
			4.0	4.1.3	Cost-Effectiveness			
			4.2		cation of Potential Soil Remedial Technologies for Corrective Action			
				4.2.1	No Action			
				4.2.2	Excavation and Off-site Disposal			
				4.2.3	Capping			
				4.2.4	Land Use Controls			
			4.0	4.2.5	In Situ Treatment	4-3		
			4.3		cation of Potential Groundwater Remedial Technologies for Corrective Action			
				4.3.1	No Action			
				4.3.2	Groundwater Monitoring			
				4.3.3	Land Use Controls			
				4.3.4	In Situ Treatment			
				4.3.5 Extraction and Treatment				
			4.4		ing of Remedial Technologies			
				4.4.1	Shallow Soil RU			
				4.4.2	Deep Soil RU	4-6		
				4.4.3	Telecommunications Corridor RU			
				4.4.4	Groundwater RU			
			4.5	Develo 4.5.1	pment and Evaluation of Proposed Corrective Action Alternatives			
				4.5.2	Deep Soil RU			
				4.5.3	Telecommunications Corridor RU			
				4.5.4	Groundwater RU			
			4.6		mended Corrective Actions			
			1.0	4.6.1	Shallow Soil RU			
				4.6.2	Deep Soil RU			
				4.6.3	Telecommunications Corridor Soil RU			
				4.6.4	Groundwater RU			
Section	on	5.	lmpl	ementa	tion of the Preferred Alternatives	.5-1		
00011	•	٠.	-					
			5.1		ly Implementation			
			5.2		onfirmation Sampling Program			
			5.3		dwater Monitoring Program			
			5.4		lse Controls			
			5.5		Soil Tracking and Management			
			5.6		e of FDS			
			5.7		able State and Federal Laws and Regulatory Requirements			
			5.8	Implem	nentation Schedule	5-10		
Section	on	6.	Refe	rences		. 6-1		
Tabla	_							
Table	S							
2-1					ater Elevations			
2-2	Summary of Previous Site Investigation and Corrective Actions							
3-1					nup Levels			
3-2					ater Cleanup Levels			
3-3				Units and Contaminants of Concern				
4-1				otential	Remedial Technologies – Shallow Soil, Deep Soil, Telecommunications Soil at	nd		
	Gro	und	water					

- 4-2 Screening of Soil Remediation Technologies Shallow Soil Remedial Unit (0 to 10 feet bgs)
- 4-3 Screening of Soil Remediation Technologies Deep Soil Remedial Unit (greater than 10 feet bgs)
- 4-4 Screening of Soil Remediation Technologies Telecommunications Corridor Soil Remedial Unit
- 4-5 Screening of Groundwater Remediation Technologies Groundwater Remedial Unit
- 4-6 Evaluation of Alternatives Summary
- 5-1 Proposed Soil Confirmation Sampling and Analysis Summary
- 5-2 Proposed Groundwater Sampling Program
- B-1 Summary of TPH Results in Soil
- B-2 Summary of PAH Results in Soil
- B-3 Summary of TPH and BTEX Results at Telecommunications Conduit
- B-4 Summary of PAH Results at Telecommunications Conduit
- B-5 Results of General Chemistry Analyses in Groundwater
- B-6 Results of TPH Analyses in Groundwater
- B-7 Results of VOC Analyses in Groundwater
- B-8 Results of OCP and PCB Analyses in Groundwater
- B-9 Results of PAH Analyses in Groundwater
- B-10 Results of Chlorinated Herbicide Analyses in Groundwater
- B-11 Results of Dissolved Metals Analyses in Groundwater
- F-1 Summary of Estimated Costs for Corrective Action
- F-2a Soil Remedial Units Estimated Costs Associated with No Action
- F-2b Shallow Soil Remedial Unit Estimated Costs Associated with Soil Excavation and Offsite Disposal
- F-2c Shallow Soil Remedial Unit Estimated Costs Associated with Capping
- F-2d Shallow Soil and Telecommunications Corridor Remedial Units Estimated Costs Associated with Land Use Controls
- F-3a Deep Soil Remedial Unit Estimated Costs Associated with Soil Excavation and Offsite Disposal
- F-3b Deep Soil Remedial Unit Estimated Costs Associated with Subsurface Capping
- F-4a Telecommunications Corridor Remedial Unit Estimated Costs Associated with Capping
- F-4b Telecommunications Corridor Remedial Unit Estimated Costs Associated with Soil Excavation and Offsite Disposal
- F-5a Groundwater Remedial Unit Estimated Costs Associated with No Action
- F-5b Groundwater Remedial Unit Estimated Costs Associated with Groundwater Monitoring
- F-5c Groundwater Remedial Unit Estimated Costs Associated with Land Use Controls
- F-6 Derivation of Unit Rates
- F-7 All Soil Remedial Units Estimated Costs Associated with Implementation of Preferred Alternatives

## **Figures**

- 1-1 Site Location and Site Study Area
- 1-2 Building 1349 Soil and Groundwater and Sample Locations
- 2-1 Building 1349 Area 3-D Map
- 2-2 Conceptual Stratigraphic Cross-Section A-A'
- 2-3 Groundwater Elevation Contour Map
- 2-3A Stiff Diagrams Showing Major Cation/Anion Concentration March 2004 Data
- 2-4 COCs Detected in Site Shallow Soil Above Cleanup Levels (0-10 feet bgs)
- 2-4A COCs Detected in Site Shallow Soil at FDS Investigation/Excavation Areas Above Cleanup Level (0-10 feet BGS)
- 2-5 COCs Detected in Site Deep Soil Above Cleanup Levels (>10 feet bgs)
- 2-6 COCs Detected in Site Soil Beneath Telecommunications Conduit
- 2-7 COCs Detected in Site Groundwater Above Cleanup Levels
- 2-8 Dissolved Metals Detected in Site Groundwater Above Cleanup Levels
- 3-1 Soil Remedial Units
- 5-1 Proposed Soil Excavation Areas

## 5-2 Proposed Groundwater Monitoring Well Network

## **Appendices**

- A Response to Comments Summary
- B Previous Investigation Data Summary Tables (From Treadwell & Rollo)
- C Previous Investigation and Corrective Action Data Summary Tables (From Others)
- D Evaluation of OCP Properties and Occurrence
- E Evaluation of Dissolved Metals Occurrence
- F Cost Estimates and Assumptions for Corrective Action Alternatives
- G Hydrogeochemistry Data
- H Groundwater Elevation Maps from Semiannual Groundwater Monitoring Report, Third and Fourth Quarters 2004 (Treadwell & Rollo, 2005)

# List of Acronyms and Abbreviations

AHPA Archeological and Historic Preservation Act

Army U.S. Army

AST aboveground storage tank bgs below ground surface

BAAQMD Bay Area Air Quality Management District

BBL Blasland, Bouck & Lee

BTEX benzene, toluene, ethylbenzene, xylenes

CAP Corrective Action Plan for the Building 1349 Study Area

CCR California Code of Regulations CESA California Endangered Species Act

Cl Chloride

Cleanup Levels

Document Development of Presidio-Wide Cleanup Levels for Soil, Sediment, Groundwater, and Surface

Water

COC contaminants of concern

Cr Chromium

DEH Directorate of Engineering and Housing

DTSC California Department of Toxic Substances Control

EKI Erler & Kalinowski, Inc.

ESLs Environmental Screening Levels

ESA Endangered Species Acts FDS fuel distribution system

FPALDR Fuel Product Action Level Development Report

GGNRA Golden Gate National Recreational Area

GIS geographical information system

GMPA General Management Plan Amendment

gpm gallons per minute

GSA Federal General Services Agency

HCO<sub>3</sub> Bicarbonate

IT International Technology Corporation

K Potassium

K<sub>H</sub> Henry's Law Constant K<sub>OC</sub> soil partition coefficient

LTTD low temperature thermal desorption

LUCs land-use controls

LUCMRR Land Use Control Master Reference Report

MBTA Migratory Bird Treaty Act
MCL Maximum Contaminant Level
meg/l milliequivalents per liter

Mg Magnesium

mg/kg milligrams per kilogram mg/L milligrams per liter micrograms per liter

MOA Memorandum of Agreement

Na Sodium

NAGPRA Native American Graves Protection and Repatriation Act

NEPA National Environmental Policy Act NHPA National Historic Preservation Act

Ni Nickel

NPS National Park Service
O&M operation and maintenance
OCPs organochlorine pesticides

PAHs polycyclic aromatic hydrocarbons

PCBs polychlorinated biphenyls PG&E Pacific Gas and Electric Co.

PLLW Presidio Lower Low Water Datum of 1907

Presidio Presidio of San Francisco

PTMP Presidio Trust Management Plan QAPP Quality Assurance Project Plan QA/QC quality assurance/quality control RAB Restoration Advisory Board RAOs remedial action objectives

RCRA Resource Conservation and Recovery Act

RPD relative percent difference

RL reporting limit RUs remedial units

RWQCB California Regional Water Quality Control Board

SCRs Site Cleanup Requirements

sf square feet SI Site Investigation

Site Study Area as defined on Figure 1-1 and Figure 1-2

SO<sub>4</sub> Sulfate

Study Area Study Area as defined on Figure 1-1 and Figure 1-2

S<sub>w</sub> water solubility

SWRCB California State Water Resources Control Board

SVE soil vapor extraction

SVOC semivolatile organic compound

TDS total dissolved solids

Title 27 Title 27 of the California Code of Regulations

TPH total petroleum hydrocarbons

TPHg total petroleum hydrocarbons as gasoline TPHd total petroleum hydrocarbons as diesel fuel

TPHd-unk "unknown" fuel hydrocarbons

TPHd-e total petroleum hydrocarbons-extractable total petroleum hydrocarbons as fuel oil

Treadwell

& Rollo Treadwell & Rollo, Inc.

Trust Presidio Trust

Trust Act Section 103 of Omnibus Parks and Public Lands Management Act of 1996, Public Law 104-333,

110 State 4097

USACE United States Army Corp of Engineers

USEPA United States Environmental Protection Agency

UST underground storage tank VOCs volatile organic compounds VMP Presidio Trust Vegetation Management Plan

## 1. Introduction

On behalf of the Presidio Trust (Trust), Blasland, Bouck & Lee (BBL) has prepared this *Final Corrective Action Plan (CAP) for the Building 1349 Study Area* at the Presidio of San Francisco (Presidio), San Francisco, California (the Study Area or Site, Figure 1-1). A Site Investigation (SI) was previously conducted to characterize the nature and extent of potential soil and groundwater impacts at the Study Area. The SI was performed in accordance with the *Draft Site Investigation Work Plan for the Building 1349 Area, Presidio of San Francisco, California* (Treadwell & Rollo, Inc. [Treadwell & Rollo], 2002). Results of the SI were presented in the *Draft Site Investigation Report for the Study Area, Presidio of San Francisco, California* (Treadwell & Rollo, 2003a). Additional SI activities and corrective actions were previously performed at the Study Area and are discussed further in Section 2 (Montgomery Watson, 1995a, 1996 and 1999; International Technology Corporation – [IT], 1996 and 1999).

As documented in the SI Report, the Study Area historically contained a petroleum hydrocarbon aboveground storage tank (AST). The Trust and the United States Army Corps of Engineers (USACE) investigated the Study Area in accordance with the California Regional Water Quality Control Board (RWQCB) orders and the California Department of Toxic Substances Control (DTSC) requirements to assess impacts to soil and groundwater associated with the storage, use, and release of petroleum-related chemicals related to the Building 1349 AST.

Using the information obtained during the various SI and corrective action activities, this CAP was prepared to evaluate potential remedial alternatives to address adverse risks due to the release of petroleum-related chemicals and select corrective actions for implementation at the Study Area. The corrective actions selected under this CAP are intended to protect human health, safety, and the environment and protect current and potential beneficial uses of water, to the extent possible.

#### 1.1 Presidio Background

The Presidio is located in the City of San Francisco, at the northern tip of the San Francisco peninsula (Figure 1-1). The Presidio occupies approximately 1,480 acres and is bounded by San Francisco Bay on the north and the Pacific Ocean on the west. Densely populated residential areas of San Francisco border the Presidio to the south and east.

The Presidio was a U.S. Army (Army) installation from 1848 through 1994, serving as a mobilization and embarkation point during several overseas conflicts, medical debarkation center, and coastal defense for the San Francisco bay area. Industrial operations formerly performed at the Presidio are associated with maintenance and repair of vehicles, aircraft, and base facilities. The Presidio also contains several landfills used by the Army to dispose of municipal waste and construction debris.

In December 1988, the Secretary of Defense's Commission on Base Realignment and Closure recommended closure of the Presidio. Under Public Law 92-589, the presidio was transferred to the National Park Service (NPS) on October 1, 1994 and became part of the Golden Gate National Recreational Area (GGNRA). As required by the Base Realignment and Closure Act, the Army initiated environmental studies in conjunction with the transfer of the property.

Section 103 of the Omnibus Parks and Public Lands Management Act of 1996, Public Law 104-333, 110 State 4097 (Trust Act) created the Trust. The Trust is a federal government corporation established to manage the

leasing, maintenance, rehabilitation, and improvement of the non-coastal portions of the Presidio (known as Area B). The Trust manages Area B in accordance with the general objectives of the General Management Plan Amendment (GMPA) (NPS, 1994), Section 1 of the GGNRA Act (Public law 92-589, 86 Stat. 1299, 16 USC 460bb), and the Presidio Trust Management Plan (PTMP) (Trust, 2002). The NPS retains responsibility for Area A (the coastal portions of the Presidio) in accordance with the GMPA. The Trust assumed responsibility for remediation of both Areas A and B of the Presidio on May 24, 1999 by signing the Presidio Memorandum of Agreement (MOA) and the Area A MOA. In addition, the Trust also entered into a Consent Agreement with DTSC and NPS on August 30, 1999 (DTSC, Trust, and NPS, 1999).

## 1.2 Study Area Background

The Study Area is located in the western portion of the Presidio, approximately 300 to 320 feet above the Presidio lower low water datum of 1907 (PLLW), and sits on a topographic high point on the boundary between the Marina Groundwater Basin and the Coastal Bluffs Groundwater Basin. The Study Area is delineated by Former Fill Site 5 and the western edge of Washington Boulevard to the west, Kobbe Avenue to the north, and Harrison Boulevard to the east (Figure 1-2). Former Fill Site 5 is located to the west of the Study Area and Former Landfill 4 is located to the east-southeast. The Study Area is located in the Presidio Forest planning area on the border of the Coastal Bluffs planning area in Area B of the Presidio and is subject to land uses identified in the PTMP (Trust, 2002). Current and planned land use at the Building 1349 Area is recreational, with special-status ecological species potentially present (Erler and Kalinowski, Inc - EKI, 2002).

The Building 1349 location was originally occupied by an AST that was built in 1906 in conjunction with the Presidio-Wide Fuel Distribution System (FDS). The AST was used to store fuel-heating oil that was distributed throughout the Presidio using the former FDS. The AST was approximately 100,000 gallons. The AST was replaced by Building 1349 in the early 1950s. Figure 1-2 identifies the location of the former AST and associated FDS piping. The FDS was decommissioned in sections beginning in the 1940s and ending in the early 1960s.

Building 1349 was a 100,000-gallon steel AST built in the 1950s (identified as Former Building 1349 Tank on Figure 1-2). The AST (Building 1349) was used to store fuel oil and then diesel fuel which was off-loaded to tanker trucks for transportation to various locations in the Presidio.

The USACE retained IT to perform the closure of Building 1349 in 1995. Closure activities occurred in October and November 1995 and included removing Building 1349 and its associated piping and excavating fuel-contaminated soil associated with former fueling operations at the Study Area. IT also conducted an FDS pipeline removal and abandonment project beginning in 1996 and removed the FDS pipelines within the Study Area (IT, 1999).

## 1.3 Regulatory Framework

As detailed in the RWQCB Order No. R2-2003-0080, Building 1349 is a known petroleum site requiring preparation and implementation of a CAP (RWQCB, 2003a). The RWQCB Order presents Site Cleanup Requirements (SCRs) for the protection of human health, ecological receptors, and water quality which were used to develop the CAP cleanup levels.

This CAP was prepared in accordance with Task 6 of the RWQCB Order. The CAP also fulfills the California requirements of Title 23, California Code of Regulations (CCR), Division 3, Chapter 16, Article 11. Cleanup

levels for the Study Area are specified in this CAP. Petroleum contaminant cleanup levels are based on the SCRs listed in the RWQCB Order. Cleanup levels for non-petroleum contaminants are based on the planned land use and site lithology(ies), and are selected in accordance with the *Development of Presidio-Wide Cleanup Levels for Soil, Sediment, Groundwater, and Surface Water* (EKI, 2002) (Cleanup Levels Document). Applicable state and federal laws pertaining to this CAP are identified and presented in Section 5.7.

## 1.4 Public Participation

A Draft CAP was prepared for public review and comment. On 2 March 2005, the Draft CAP was distributed to stakeholders, including the Presidio Restoration Advisory Board (RAB), NPS, and regulatory agencies. The Draft CAP was also available for public review at the Presidio Library. The Trust presented the Draft CAP to the RAB at a RAB meeting on 8 March 2005 and comments were invited through 30 April 2005. Comments were received from the RWQCB. This Final CAP includes revisions that were made to address RWQCB comments. The RWQCB comments and the Trust's response to comments are presented in Appendix A. Copies of this Final CAP are available for review at the Presidio Library, 34 Graham Street, Presidio of San Francisco, weekdays between the hours of 8 am and 5 pm.

## 2. Study Area Background

This section discusses the geology and hydrogeology, and previous investigations and corrective actions completed at the Study Area. This section also describes the source, nature, and extent of petroleum-related impacts encountered in previous investigations as well as recent quarterly groundwater monitoring results up to and including the second quarter 2004.

## 2.1 Study Area Geology and Hydrogeology

The following sections discuss the regional and site-specific geologic and hydrogeologic conditions in the vicinity of the Study Area.

## 2.1.1 Geologic Setting

The Study Area is located on a prominent hill that slopes gently to the east-northeast and steeply to the west-southwest towards Baker Beach and the Pacific Ocean (Figure 2-1). Ground surface elevations in the immediate area range from approximately 320 to 300 feet PLLW.

## 2.1.1.1 Regional Geology

The Presidio is located in the California Coastal Range Physiographic Provenance. The local geology consists of Franciscan Formation bedrock units, which are overlaid by various overburden deposits. The Franciscan Formation consists of a complex assemblage of sedimentary, volcanic, and metamorphic rocks ranging in age from the Late Jurassic to the Late Cretaceous. The assemblage is a result of accretionary forces as the Pacific Tectonic Plate was subducted under the North American Tectonic Plate. These accretionary forces ultimately led to the intense folding, faulting, and shearing of the resultant Franciscan Formation. In the San Francisco area, the Franciscan Formation consists primarily of sandstone, shale, siltstone, radiolarian chert, and mafic igneous rocks such as serpentinite (Schlocker, 1974). The Study Area lies in an active seismic zone located between two major north-west trending fault systems, the Hayward/Rogers Creek system and the San Andreas system.

At the Presidio, five bedrock units are recognized within the Franciscan Formation (EKI, 2002). These five units are:

- Serpentinite Serpentinite is an ultramafic rock composed mostly of magnesium and iron minerals.
   Serpentinite intrusives and coherent blocks of hard rock in a matrix of intensely sheared shale and serpentinite comprise most of the outcrops or exposed bedrock observed in the Presidio (Schlocker, 1974).
   Serpentinite is a distinctive greenish-gray to bluish-gray rock that contains typically high concentrations of chromium, nickel, and cobalt (EKI, 2002).
- Sheared Rock The Sheared Rock Unit is a mixed bedrock unit that consists of a soft, highly sheared clayey unit of serpentinite, shale/siltstone, or both, in which occur coherent blocks of Jurassic/Cretaceous Sedimentary Rock and serpentinite.

- Jurassic/Cretaceous Sedimentary Rocks Jurassic/Cretaceous Sedimentary Rock is a bedrock unit that is made up of interbedded sandstones, shales, and occasional conglomerates.
- Greenstone Greenstone is a bedrock unit made up of dark green meta-basalt that occurs interbedded with the Jurassic/Cretaceous Sedimentary Rocks and the Chert/Shale.
- Chert/Shale Chert/Shale is a bedrock unit made up of alternating beds of hard, red-brown chert and softer, red-brown shale. It occurs interbedded with greenstone and Jurassic/Cretaceous Sedimentary Rocks. At the Presidio, both Greenstone and Chert/Shale are exposed in minor outcrops only along the Coastal Bluffs.

Three main soil types are recognized at the Presidio. These include serpentinite soil, Colma Formation, and beach dune sand (EKI, 2002). The Colma Formation and beach dune sand are both unconsolidated sediments deposited on top of bedrock. Serpentinite soils are derived from serpentinite bedrock. As described above, serpentinite is a distinctive greenish-gray to bluish-gray rock that tends to weather to poorly formed soils in a wide range of grain sizes. The Colma Formation is Pleistocene in age and consists of fine- to medium-grained sand with moderate amounts of silt and clay that was deposited in esturine and coastal environments. Beach dune sand is characterized at the Presidio as highly permeable, clean, well-sorted sand that is yellowish brown to light gray in color.

Several secondary soil types are also recognized at the Presidio, including Quaternery slope debris and ravine fill. Slope debris and ravine fill is described as highly variable combinations and percentages of silts, clays, sands, and gravels. The slope debris and ravine fill is generally associated with landslide deposits and soil derived from any of the three main soil types recognized in the Presidio (Colma Formation, beach dune sand, and serpentinite) (EKI, 2002).

## 2.1.1.2 Study Area Geology

Figure 2-2 presents a conceptual stratigraphic cross-section across the Study Area. Soil borings at the Study Area indicate that unconsolidated overburden deposits range from approximately 10 to 40 feet thick. These unconsolidated overburden deposits overlie Franciscan Formation bedrock.

#### Overburden

Soil beneath the Study Area generally consists of Quaternary slope debris and ravine fill. While quaternary beach dune sand deposits have been mapped as occurring at the eastern edge of the Study Area (EKI, 2002 and Schlocker, 1974), it is noted that the mapped contacts have not been field verified (EKI, 2002). A review of boring logs from previous SIs (Montgomery Watson, 1995a and 1996 and Treadwell & Rollo, 2003a) indicates that beach dune sand is not present in the Study Area. These boring logs indicate that overburden soils throughout the Study Area consist of relatively low permeability silty sand and silty clay. The description of these deposits is consistent with slope debris and ravine fill, not the highly permeable, clean, and well sorted beach dune sand. The overburden deposits in the Study Area also have frequently been noted to contain weathered fragments of local bedrock. The local bedrock is described below.

As noted above, beach dune sand is not found in the Study Area and the Colma Formation is not mapped in the vicinity of the Study Area and not expected to occur in highland regions of the Presidio such as the Study Area. The slope debris and ravine fill found at the Study Area appear to be derived from serpentinite soils and the underlying Franciscan Formation. The slope debris and ravine fill deposits at the Study Area are expected to

contain materials with geochemical characteristics of the serpentinite soil types as well as the shales, siltstones, sandstones, and serpentinite.

#### Bedrock

The slope debris and ravine fill unit overlie Franciscan Formation bedrock (Figure 2-2). The Franciscan Formation has been observed in the Study Area and is interpreted to be approximately 10 to 40 feet below ground surface (bgs). Based on drilling conditions and boring logs, it appears that the upper 45 feet of the Franciscan Formation is highly weathered, fractured bedrock with interbedded zones consisting of weathered clay and silt. The Franciscan Formation in the Study Area consists primarily of serpentinite, Sheared Rock, and Jurassic/Cretaceous Sedimentary Rock units described in Section 2.1.1.1.

In June 1994, Resolution Resources, Inc. conducted a high-resolution seismic reflection survey at the Study Area to further assess the depth to the bedrock surface and determine whether seismic faults are present. The results of the survey indicated that many fault and fracture zones bisect the Study Area (Montgomery Watson, 1996).

Based on a review of boring logs in the vicinity of the Study Area, up to three apparent faults were identified (Figure 2-2). The faults appear to displace two distinct blocks of the Franciscan Formation consisting mainly of serpentinite relatively upward from two blocks of Franciscan Formation consisting of mainly siltstone and shale. The southeastern-most interpreted fault is believed to trend approximately northeast to southwest. It is likely that other interpreted faults may parallel this fault trend orientation.

## 2.1.2 Hydrogeology

## 2.1.2.1 Groundwater Monitoring Well Network Description

The Study Area is located on a topographic high point and local groundwater recharge zone at the boundary of the Marina Groundwater Basin and the Coastal Bluffs Groundwater Basin. A total of nine monitoring wells are associated with the Study Area. Five additional monitoring wells are located to the west-southwest of the Building 1349 Study area in adjacent Former Fill Site 5. The fourteen monitoring wells are used to evaluate hydraulic conditions at the Study Area. It should be noted that former monitoring well 1349MW03 was located in Former Fill Site 5, but was abandoned in 2002 to accommodate remedial excavation activities in that area. Current well, 1349MW03R, was installed near the former well 1349MW03 location to serve as a replacement.

The Study Area monitoring wells are constructed with their well screen intervals within the Franciscan Formation. Well screens are between 10 and 17 feet long with the top of screen elevations ranging between approximately 272 to 285 feet PLLW. The top of the well screens are located between 5 and 28 feet below the top of bedrock. The screened intervals for Study Area monitoring wells generally intersect the apparent static water level at each location.

#### 2.1.2.2 Groundwater Occurrence and Flow

Apparent static groundwater elevations (groundwater elevations) occur at approximately 280 to 272 feet PLLW at Study Area monitoring wells. Groundwater elevations decrease to the southwest of the Study Area to approximately 220 feet PLLW in the adjacent Former Fill Site 5 area (Table 2-1 and Figure 2-3). Average depth to groundwater ranges between 26 feet bgs at well 1349MW102 and 39 feet bgs at well 1349MW103. Seasonal

groundwater seeps are reported to occur more than 500 feet to the south-southwest of the Study Area, at the western edge of Former Fill Site 5.

Groundwater at the Study Area occurs primarily within the Franciscan Formation. As noted previously, the Franciscan Formation is highly deformed and fractured. Groundwater flow occurs within secondary porosity created by the fracture networks and the relative permeability is expected to be variable, but generally low based on the amount of secondary mineralization in individual fractures. It has been noted in individual boring logs that some apparent fractures were remineralized or in-filled with clays. Groundwater monitoring well purge records were evaluated to estimate the hydraulic conductivity of the water bearing zone in the Study Area. Hydraulic conductivities were found to vary, ranging between  $1 \times 10^{-4}$  to  $1.6 \times 10^{-3}$  cm/sec. The specific yields of Study Area monitoring wells also vary. Purge records indicate that sustained pumping at rates as low as 0.2 gallons per minute (gpm) cannot be sustained without dewatering wells in a relatively short period of time (less than one hour). As such, the influence of anisotropy should be considered when evaluating hydraulic conditions at the Study Area. The combination of low permeability, relatively low hydraulic gradients, and anisotropy combine to make interpretation of local groundwater flow direction proximate to the Marina and Coastal Bluffs groundwater basin divide challenging.

Figure 2-3 depicts the groundwater elevations at the Study Area and the adjacent Former Fill Site 5 area. Analysis of the potentiometric data indicates that a relatively steep hydraulic gradient exists to the southwest of the Study Area near Former Fill Site 5. Based on potentiometric data in that area, the apparent groundwater flow direction is to the southwest from monitoring well 1349MW102 towards well LF5GW100. However, the potentiometric surface beneath most of the Study Area is indicative of a recharge area and is relatively flat with a general radial flow pattern. Within this area, groundwater elevation data indicate two localized potentiometric highs both to the southwest and northeast of Washington Boulevard and separated by a slight potentiometric low in the vicinity of well 1349MW100. The highest potentiometric elevation is found at well 1349MW102. The relative potentiometric highs and lows observed on Figure 2-3 are consistent with historic groundwater elevation data seen in Table 2-1. Furthermore, the high groundwater elevation at well 1349MW102 is noted to be in close proximity to the groundwater basin boundary depicted in Figure 2-3, taken from the Cleanup Levels Document (EKI, 2002). Recent groundwater elevation data (Treadwell and Rollo, 2005) indicate slight variability in the apparent groundwater flow direction to the approximate west of the interpreted groundwater basin boundary (See Figures A-5-1 and A-5-2 in Appendix H). Such local variations are likely a result of changes in seasonal recharge, infiltration, and evapotranspiration rates. These subtle variations are typical of those observed in fractured bedrock aquifer recharge areas and the data suggest that overall hydraulic gradients are still relatively flat with a general radial flow pattern. It should also be noted that subtle variations in apparent groundwater elevations are likely influenced by the shape of the bedrock surface and the orientation of known fault zones. These features may also influence the apparent groundwater flow direction, especially towards the west of wells 1349MW100 and 1349MW102.

#### **Geochemistry**

Hydrogeochemical conditions at the Study Area were evaluated based on groundwater samples collected from monitoring wells within the Study Area (see Table B-5 and B-11) and adjacent Former Fill Site 5 (data evaluated from Treadwell & Rollo, 2004 – Appendix A-9). Groundwater in most wells in the Study Area exhibits characteristics typical of a groundwater recharge area with moderately oxic conditions and circum neutral pH, based on average concentrations of dissolved oxygen content and pH. However some variability in hydrogeochemistry is observed across the Study Area. This variability is attributed to both anthropogenic factors (presence of petroleum hydrocarbons in the groundwater system) and natural factors (differing geochemistry of rock or overburden materials and differing groundwater flow regimes). Some examples of this variability are discussed below.

- The pH of some wells screened in serpentinite, particularly wells 1349MW03R, 1349MW103, and 1349MW105, are slightly more alkaline with observed average pH of up to 7.8. This is within the range of pH values observed in other Presidio upland wells screened within serpentinite or in areas where groundwater is influenced by serpentinite (Montgomery Watson, 1998).
- The hydrogeochemistry of some wells exhibit evidence of anoxic, or reducing, conditions based on the levels of dissolved oxygen, dissolved iron, and sulfate. For example, reducing conditions are observed in well 1349MW100 as noted by its relatively low dissolved oxygen content, elevated dissolved iron, and low sulfate concentrations. As discussed in Section 2.4.6, well 1349MW100 is impacted by petroleum hydrocarbons. Bacteria involved in the natural degradation of petroleum hydrocarbons in groundwater typically consume available oxygen, resulting in localized reducing conditions.

An evaluation of spatial trends in hydrogeochemistry can provide further insight into understanding groundwater flow in complex anistropic systems such as the system present at the Study Area. To further evaluate the hydrogeochemistry of the Study Area, the relative abundance of typical anion and cation pairs as well as total dissolved solids (TDS) concentrations, based on data presented in Table B-5 and Table B-11 and Appendix A-9 (for Former Fill Site 5 wells) of the Semiannual Groundwater Monitoring Report (Treadwell & Rollo, 2004), were evaluated. Two methods for evaluating hydrogeochemistry were used, which involve plotting the concentration in milliequivalents per liter (meq/l) or relative abundance of anions and cations on Piper plots and Stiff diagrams, respectively. A summary of this observed geochemical variability is shown on Stiff diagrams on Figure 2-3A and Piper plots on Figures G-1 and G-2 in Appendix G. The groundwater data presented in these figures are from the March 2004 groundwater sampling event.

In general, the data suggest that two distinct groundwater types exist at the Study Area based on geochemical signatures. Wells located generally to the west of the inferred groundwater divide, including wells 1349MW101 and LF5GW100 through LF5GW104, tend to have modest TDS and can be classified as magnesium (Mg)/sodium (Na)-chloride (Cl)/bicarbonate (HCO<sub>3</sub>) type water. Wells generally to the east of the groundwater divide (1349MW103, 1349MW104 and 1349MW105), or immediately to the west of the divide (1349MW01), have relatively high TDS and can be characterized as Mg-Cl type water. Other wells, including 1349MW02 and 1349MW102, generally have geochemical signatures that indicate a mixture of the two described groundwater types. Well 1349MW100, as depicted on these figures, has a geochemical signature that is similar to Mg/Na-Cl/HCO<sub>3</sub> water, but exhibits a relatively high TDS content. It should be noted that during other monitoring periods, the relative Na contribution is less and the relative Cl contribution is higher in 1349MW100, thus producing a signature indicating a mixture between the two main types of waters described.

Well 1349MW100 also has a relatively high HCO<sub>3</sub> contribution in relation to the other wells, in addition to virtually no sulfate contribution. Because the degradation of petroleum hydrocarbons can often lead to enriched HCO<sub>3</sub> and depleted sulfate, this observation suggests that the groundwater in this area has been affected by natural degradation of petroleum hydrocarbons. Groundwater at well 1349MW03R has a geochemical signature that is unique from the other wells. The difference is due to a lower relative contribution of Cl at this location. With the exception of the relatively low Cl concentration at this location, the geochemical signature would be very similar to the Mg/Na-Cl/ HCO<sub>3</sub> waters seen in this area.

Waters dominated by Mg and Cl are not common; however, these types of waters could be locally characteristic of rocks containing serpentinite, which is Mg-rich and could also contain a significant fraction of dissolvable Cl as indicated by Sharp and Barnes (2004). Previous hydrogeochemical studies at Presidio uplands areas associated with serpentinite indicate that groundwater has a strong Mg component that is associated with the serpentinite (Montgomery Watson, 1998). The wells that exhibit a Mg-Cl signature are screened within

fractured serpentinite and are located within the area with a generally flat potentiometric surface as indicated in Figure 2-3. Wells exhibiting a mixed geochemical signature are screened either in serpentinite or shales/siltstones of the Sheared Rock or Jurassic/Cretaceous Rock units, but are also within the area of the relatively flat potentiometric surface. This would suggest that a mixing zone may exist near the apparent groundwater divide.

## 2.1.2.3 Summary of Hydrogeologic Conditions

Based on the evaluation of groundwater elevation data and geochemical data, it is apparent that groundwater flow in the Study Area is anisotropic, influenced by the fracture flow network and bedrock geometry. A general radial flow pattern exists in the vicinity of the groundwater divide and recharge area and temporal variations in apparent groundwater flow direction, while minor, may be observed based on local recharge conditions. Two groundwater types are observed in the Study Area with a mixing zone that is roughly coincident with the apparent groundwater divide, which is located to the east of Washington Boulevard. The direction of groundwater flow becomes more consistent and better defined with distance away from the groundwater divide, with flow to the east (the Marina Groundwater Basin) and to the west (the Coastal Bluffs Groundwater Basin). This is especially evident towards the west in the general area of Former Fill Site 5 where a steeper hydraulic gradient is observed and a greater number of downgradient wells exist to effectively interpret apparent groundwater flow direction. The existing groundwater monitoring well network is sufficient for monitoring groundwater hydrogeologic conditions to the east of the apparent groundwater basin divide as well as to the west, north, and south of Washington Boulevard.

#### 2.2 Source Areas

This section presents a summary of the potential sources of contaminant releases at the Study Area, including operational histories. Based on a review of the known Site history (Section 1.2), the following contaminant source areas have been identified for the Study Area:

- *Former fuel oil AST*: Former Building 1349 contained a 100,000-gallon fuel oil AST which was constructed in 1906 in association with the FDS. Fuel oil was stored in the AST and distributed throughout the Presidio via the FDS.
- Former diesel oil AST (i.e., Former Building 1349): The fuel oil AST was replaced in the 1950s by a 100,000-gallon steel AST. The replacement AST was initially used for fuel oil storage and then was converted to diesel fuel storage. A fuel dispensing structure was reportedly installed along Washington Boulevard for dispensing the diesel from the tank to fuel trucks which would then transport the diesel to various locations throughout the Presidio. An underground pipe connected the AST to the fuel dispensing structure.
- *Former FDS piping*: The FDS, a network of pipelines built in the early 1900s, distributed fuel oil throughout the Presidio. The FDS ceased operations and was decommissioned in sections beginning in the 1940s and ending in the early 1960s.

## 2.3 Special Study Area Feature (Telecommunications Conduit)

A telecommunications conduit is located on the eastern side of Washington Boulevard (Figure 2-4). This conduit contains a fiber-optic telecommunications cable owned by the Trust. The conduit is approximately 2- to 2.5-feet wide and 2.5-feet deep. The top of the conduit occurs at approximately 1-foot below grade. It is important that any corrective actions do not unduly threaten or damage the integrity of this line. Appropriate measures would need to be implemented to carefully protect or re-route this line to allow potential corrective actions to be conducted. This is further discussed in Section 4.0.

## 2.4 Previous Investigations and Corrective Actions

This section discusses the results of previous investigations and corrective actions conducted for the Study Area. Two previous corrective actions by the Army have occurred at the Study Area involving (1) the demolition and removal of Building 1349 and its associated piping and (2) the removal of the former FDS at the Study Area. There is no information regarding the removal of the former AST which was replaced by the Building 1349 AST in the early 1950s. It should be noted that these past corrective actions have effectively addressed the majority of petroleum-related impacts in the Study Area. This CAP proposes corrective actions for the remaining petroleum-related impacts, some of which are located in areas where corrective actions have proven to be difficult due to sensitive Study Area infrastructure and geologic conditions, as discussed below.

The chemical analytical results described below are discussed in the context of action levels and/or screening levels that were used at the time of each investigation or corrective action, where available. These action levels and/or screening levels for petroleum hydrocarbons are equivalent to the SCRs adopted by the RWQCB in Order No. R2-2003-0080 (RWQCB, 2003a) for the Presidio and are the cleanup levels selected for this CAP (Section 3.2). Figures 2-4 through 2-7, which are referred to below, present the chemical results exceeding CAP cleanup levels. Tables in Appendices B and C provide the analytical data from the previous investigations and corrective actions.

## 2.4.1 1995-1996 Site Investigation

The USACE retained Montgomery Watson to conduct an SI in three phases to determine the vertical and lateral extent of soil and groundwater contamination (Montgomery Watson, 1995a, 1996). The SI was initially conducted in response to a visual observance of stained soil downgradient from Building 1349. For discussion purposes, the results of the 1995-1996 SI are discussed relative to CAP cleanup levels (Section 3.2), as no screening levels were used in the SI.

## Phases 1 and 2 (Montgomery Watson, 1995a)

During Phase 1 in August 1993, the Army advanced 14 soil borings (1349SB01 through -13; 1349DB01) to depths ranging from 4.5 to 45 feet bgs (Figure 2-4). One grab groundwater sample and 51 soil samples were collected and analyzed for total petroleum hydrocarbons (TPH) as diesel (TPHd); benzene, toluene, ethylbenzene, and xylenes (BTEX); and metals.

In February 1994, Phase 2 of the SI was conducted to better define the extent of hydrocarbon contamination in the area of the drainage gully between the Building 1349 concrete pad and Washington Boulevard. Eight additional soil borings (1349SB14 through -21) were installed to depths ranging from 15 to 40 feet bgs (Figure 2-4). A total of 37 soil samples and one grab groundwater sample were collected during the Phase 2 SI

and analyzed for TPHd and BTEX. Immunoassay screening tests for TPHd were also conducted at six locations to assist in locating shallow soil borings.

Results of the Phase 1 and 2 sampling indicated elevated TPH soil concentrations above cleanup levels in the area of the gully, between the Building 1349 concrete pad and Washington Boulevard. TPHd-extractable (TPHd-e; representing hydrocarbon patterns resembling diesel fuel or fuel oil) was detected at a maximum concentration of 170,000 milligrams per kilogram (mg/kg) at 1 foot bgs in this area (Appendix C) which exceeds the TPHd ecological cleanup level of 700 mg/kg. The source of this contamination was believed to be either a surface spill of diesel and/or fuel oil near the gully or an underground pipeline leak between the fuel dispensing structure and the AST. Toluene, ethylbenzene, and xylenes were detected below cleanup levels at maximum concentrations of 1.1, 2.6, and 20 mg/kg in the area of TPH contamination (Appendix C).

Metals detected at concentrations exceeding serpentinite background values for the Presidio (EKI, 2002) were arsenic, beryllium, copper, lead, mercury, vanadium, and zinc (Appendix C). Metals detected in soil above serpentinite background and cleanup levels were arsenic and vanadium. A statistical evaluation of metals, including an analysis of their occurrence with TPH, ethylbenzene, and xylenes, was conducted in the 1995 SI Report (Montgomery Watson, 1995a). The evaluation demonstrated that the distributions of TPH, ethylbenzene, and xylenes, which were associated with large standard deviations and skewness coefficients, were consistent with the existence of a fuel contamination at the site. In contrast, the distributions of metals were much smaller and fairly consistent. Average concentrations of all analytes (metals, TPH, ethylbenzene, and xylenes), corresponding to each quartile of the TPH levels, were then calculated. The average quartile concentrations of ethylbenzene and xylenes showed a strong relationship to the TPH levels. This is expected as they are constituents of diesel and fuel oil, which are measured as TPH. In contrast, the average metal levels of the samples corresponding to each of the four TPH quartiles were statistically equivalent. Based on this evaluation, Montgomery Watson concluded that metal levels in soil at the Study Area are unrelated to the TPH levels in the area, and with the exception of one lead result of 126 mg/kg (1349SB09 at 0.5 foot bgs), were assumed to be naturally occurring. The lead result is below the ecological special-status cleanup level of 160 mg/kg.

The two grab groundwater samples were collected from borings1349SB09 and -19, both on the west side of Washington Boulevard, downslope of the drainage gully. TPHd was detected at 110,000 micrograms per liter ( $\mu$ g/L), above the cleanup level of 880  $\mu$ g/L, in boring 1349SB19. Xylenes were detected below the cleanup level in the same boring. TPHd-e was detected at 110  $\mu$ g/L in boring 1349SB09 (Appendix C tables). Low concentrations of total metals (chromium, copper, iron, manganese, nickel, vanadium, and zinc) were also detected in groundwater.

Physical and biological tests were also conducted on a few soil samples to assess the viability of various remediation technologies for soil at the Study Area, such as bioventing, in situ bioremediation, and soil vapor extraction (SVE). The results of these analyses indicated that there is an availability of indigenous microorganisms, adequate supplies of nitrogen and phosphorous, and absence of environmental toxins to those microorganisms. These results are further discussed in the context of possible corrective actions in Section 4.5.4.

## Phase 3 (Montgomery Watson, 1996)

In July and August 1995, the Army conducted an Additional SI (Phase 3). The objectives of the Additional SI were to: (1) further assess the extent of saturated zone contamination; (2) better define site geology; (3) collect soil and groundwater samples; and (4) install groundwater monitoring wells to monitor the site hydrogeology and water chemistry. Nine soil borings (1349SB22 through -30) were drilled to depths ranging from 38 to 58

feet bgs (Figure 2-4). A total of 68 soil samples were collected from 5 to 58 feet bgs and analyzed for TPHd-e. TPHd-e was detected at all sample locations, with a maximum concentration of 990 mg/kg at 1349SB25 at 40 feet bgs, which was below the water table at approximately 36 feet bgs. Concentrations of TPHd-e in this boring were 7.7 mg/kg and less from the surface to 30 feet bgs (Appendix C tables). A pattern of relatively low TPHd-e concentrations in shallower samples, but elevated TPHd-e concentrations at depth, was also noted in borings 1349SB23, -26, and -28. However, all concentrations of TPHd-e in samples collected above the water table were below the cleanup levels.

Two surface soil samples (1349SS01 and -02) were also collected in the area of visually stained soil and analyzed for polycyclic aromatic hydrocarbons (PAHs). Only pyrene was detected at 3 mg/kg in sample 1349SS02, below the cleanup level (Appendix C).

One grab groundwater sample was also collected from each of the nine borings and analyzed for TPHd-e and BTEX. TPHd-e was detected in groundwater at borings 1349SB22, -25, and -27 (west and south of former Building 1349), with a maximum concentration of 24,000  $\mu$ g/L at 1349SB25, exceeding the cleanup level of 880  $\mu$ g/L (Appendix C tables). Soil samples from this boring also had the highest concentrations of TPHd-e of the samples collected during Phase 3.

Based on the results of the grab groundwater samples, three borings (1349SB26, -28, and -30) were converted to monitoring wells (1349MW01 through -03) and sampled in August 1995. The groundwater samples were analyzed for TPHd-e and BTEX. No chemicals were detected in these samples (Appendix C tables).

## 2.4.2 Building 1349 AST Removal

In October and November 1995, the USACE implemented a removal action involving the demolition and removal of Building 1349 (100,000-gallon AST) and its associated piping and excavation of fuel-contaminated soil associated with former fueling operations at the Site (IT, 1996). The tank was prepared for demolition by triple-rinsing it using a high-pressure hydroblaster. The tank was then inspected for structural integrity and determined to be in sound condition, with no holes or failures.

Following the demolition and removal of the Building 1349 AST and associated piping, soil excavation activities occurred in three areas, labeled as Areas 1, 2, and 3 on Figure 2-4. The Area 1 excavation was approximately 35 by 25 feet and extended to an approximate depth of 7 feet bgs. Excavation Areas 2 and 3 were located on either side of the telecommunications conduit located parallel to Washington Boulevard, in the vicinity of the TPH contamination identified in the SI (Montgomery Watson, 1995a, 1996). The Area 2 excavation was approximately 70 by 25 feet and extended to a maximum depth of approximately 12 feet bgs. The Area 3 excavation was approximately 40 by 50 feet and extended to a depth of approximately 13.2 feet bgs. All three areas were backfilled with approximately 700 yards of controlled density fill. Excavation Areas 1 and 2 were backfilled with controlled density fill to a minimum of 6 feet below grade and Area 3 was backfilled to within 1 foot of grade to facilitate the repaving of Washington Boulevard (IT, 1996). In addition, approximately 300 yards of pre-approved clean sand fill was backfilled on top of the controlled density fill at Areas 1 and 2 (IT, 1996).

Post-excavation samples were collected to characterize the limits of the excavations. Action levels used during the process were from the Fuel Product Action Level Development Report (FPALDR; Montgomery Watson, 1995b); it is noted that these action levels are equivalent to the SCRs adopted by the RWQCB in Order No. R2-2003-0080 (RWQCB, 2003a) for the Presidio and are the cleanup levels selected for this CAP. Immunoassay tests were initially used to indicate whether TPHd concentrations were below the action levels. Post-excavation

confirmation soil samples were then collected at each of the three areas and analyzed for TPHd, BTEX, and PAHs by a certified laboratory. Post-excavation confirmation data indicated the removal of all soils containing chemical concentrations in excess of the action levels with the exception of soils located directly underneath the telecommunications conduit (Figure 2-6). Soil excavation could not continue in this area without compromising the integrity of the telecommunications conduit. Soil overlaying the conduit was removed during this remedial action. The dimensions of the soil column beneath the conduit across Areas 2 and 3 measured approximately 75 feet long by 6 feet wide and 12 feet bgs.

Soil sample results for the soil left in-place beneath the conduit are provided in Tables B-3 and B-4. Based on the results of nine post-excavation confirmation soil samples, concentrations of TPHd in soil left in-place under or immediately adjacent to the conduit ranged from 14,000 to 24,000 mg/kg in the 3 foot bgs interval; 13,000 to 14,000 mg/kg in the 4 to 6 foot bgs interval; and 3,200 to 10,000 mg/kg in the 12 foot bgs interval (Table B-1). Elevated concentrations of PAHs were also detected in soil under the telecommunications conduit. Concentrations for naphthalene and benzo(a)pyrene ranged up to 51 and 89 mg/kg, respectively. In addition, several PAHs, including benzo(a)anthracene, benzo(a)pyrene, benzo(b)flouranthene, benzo(k)flouranthene, and chrysene, were reported as non-detect in laboratory data; however, the analytical reporting limits (RLs) for these PAHs were several times greater than their corresponding cleanup levels for the area. BTEX were not detected above their respective action levels in the post-excavation confirmation samples.

#### 2.4.3 FDS Removals

In 1996 and 1997, the USACE retained IT to remove all Presidio-wide piping associated with the former FDS (IT, 1999). The FDS removal actions included the: (1) removal of FDS piping or abandonment in place of FDS piping located in inaccessible and/or sensitive areas; (2) assessment of soil in FDS removal sections via field and laboratory analysis of soil samples; (3) excavation of petroleum hydrocarbon-affected soils and recycling and/or disposal of soils; and (4) restoration of each FDS removal section, including backfilling, paving, planting, and/or reseeding. IT divided the FDS removal action into 50 locations, each with its own trench and pipeline description, summary of excavations, and site-specific soil action levels. The soil action levels were the SCRs obtained from RWQCB Order No. 96-070 (RWQCB, 1996); it is noted that these action levels are equivalent to the SCRs adopted by the RWQCB in Order No. R2-2003-0080 (RWQCB, 2003a) for the Presidio and are the cleanup levels selected for this CAP.

Two FDS pipeline removal actions, MT-6 and MT-7, occurred in the vicinity of Building 1349 (IT, 1999). At these areas, soils were excavated beyond the pipe trench to meet the applicable soil action levels. The MT-6 section of piping within the Study Area boundaries originated at Building 1349 and trended northeast to Kobbe Avenue (Figure 2-4a). Approximately 550 linear feet of 6-inch pipeline were excavated and removed from section MT-6 within the Study Area. All piping which was located within the Study Area in section MT-6 was removed. Two nearly parallel trenches, approximately 250 to 300 feet long by 2 feet wide and 3 to 6 feet deep, were excavated within the Study Area (Figure 2-4a).

The MT-7 section of piping within the Study Area boundaries originated at Building 1349 and trended generally east to Harrison Boulevard (Figure 2-4a). Approximately 500 linear feet of pipeline were excavated and removed from section MT-7 within the Study Area. All piping which was located within the Study Area in section MT-7 was removed. The MT-7 removal consisted primarily of three trenches within the Study Area (Figure 2-4a). The two northern trenches were approximately 175 feet long by 2.75 wide, and the southern trench was approximately 75 feet long by 2.75 feet wide. Minor trenches to the former AST were also excavated. The excavation depths varied from 1.5 to 6 feet bgs.

Immunoassay test results for samples collected along the MT-6 and MT-7 trench excavations indicated that all TPH and PAH concentrations were below action levels, except in three areas which were over-excavated (i.e., FDS Remedial Excavations South, Middle, and North). These three excavations were completed in the area north of Building 1349, where the two parallel FDS pipelines in section MT-6 (trending north/south) met the east/west trending pipeline associated with section MT-7 (Figure 2-4a). The total volume of soils excavated from the three FDS Remedial Excavations was approximately 190 cubic yards. Post-excavation confirmation soil samples were collected from the bottoms and sidewalls of the FDS excavations and analyzed for TPH and PAHs by immunoassay analysis. Ten percent of the samples were also analyzed at an off-site laboratory for TPHd, TPH as fuel oil (TPHfo), and PAHs. Immunoassay and laboratory analytical results for confirmation samples indicated that soils exceeding the action levels were left in-place at the following FDS Remedial Excavations (Figure 2-4a and Appendix C tables):

- FDS North: TPH was measured at >1,380 mg/kg and PAHs at >5.0 in four samples; laboratory results for sample FM06043W04 confirmed TPHd at 1,400 mg/kg, TPHfo at 1,800 mg/kg, and benzo(a)pyrene at 0.36 mg/kg;
- FDS Middle: TPH was measured at >1,380 mg/kg and PAHs at >5.0 in two samples; laboratory results for sample FM07044W09 confirmed TPHd at 1,300 mg/kg, TPHfo at 1,800 mg/kg, and benzo(a)pyrene at 0.30 mg/kg; and
- FDS South: TPH was measured at >6,856 mg/kg and PAHs at >5.0 mg/kg in two samples and TPH was measured at >1,380 mg/kg in one confirmation sample.

The northern portions of the MT-6 trench excavations and eastern portions of the MT-7 trench excavations were backfilled with overburden soil from the excavations to 18 inches bgs and with imported topsoil to the ground surface. Prior to using the overburdened soil as backfill, field immunoassay and/or laboratory analyses were performed on the overburden soil to ensure the soil concentrations were below the discharge criteria of 100 mg/kg for TPH, 5.6 mg/kg for PAHs, and no detectable levels of BTEX (IT, 1999; RWQCB, 1996). Laboratory analysis of backfill soils used in the MT-6 trench excavation area suggests that the overburden soils contained TPHfo at 250 mg/kg (with a duplicate result of <540 mg/kg), which exceeded the discharge requirement of 100 mg/kg. However, this concentration did not exceed the human health and ecological action levels (i.e., SCRs from RWQCB Order No. 96-070).

According to the FDS Removal Report (IT, 1999), excavations of the FDS trenches and FDS Remedial Excavations in the vicinity of the former AST (i.e., the southern portions of the MT-6 trench excavations, western portions of the MT-7 trench excavations, and the three FDS Remedial Excavations) were backfilled with low temperature thermal desorption (LTTD)-treated soils to 2 feet bgs and imported top soil to the ground surface. The approximate areas with potential LTTD soil backfill are shown on Figure 2-4a. Analytical results for LTTD treated soils that were used as backfill confirmed that TPH, BTEX, and PAHs were below the action levels or SCRs from RWQCB Order No. 96-070 (IT, 1999; EKI, 2004).

#### 2.4.4 Additional Investigation of FDS

The USACE retained Montgomery Watson to assess the presence of suspected FDS pipeline segments and evaluate whether releases of petroleum fuels occurred along the previously removed pipeline segments (Montgomery Watson, 1999). For the Study Area, the objective of the investigation was to evaluate whether fuel was released from the former FDS pipeline at concentrations above the RWQCB Order 96-070 SCRs for petroleum-impacted soils. The former FDS pipeline evaluated during the investigation trended south from the

tank across Washington Boulevard., approximately parallel to Lincoln Blvd., and through Former Fill Site 5 to Building 1773 (Figure 2-4a).

Three borings, FDSSB227 through -229, were drilled at approximate 100-foot intervals along the former FDS pipeline (Figure 2-4A). Soil samples were collected at approximately 3 feet bgs and 6 to 8 feet bgs. The soil samples collected at 3 feet bgs were analyzed by immunoassay techniques. TPHfo was not detected at a concentration equal to or greater than the SCR of 115 mg/kg in the three samples. Montgomery Watson, therefore, concluded that a decision document should be prepared recommending no further action for this portion of the FDS.

## 2.4.5 2002-2003 Site Investigation

The Trust retained Treadwell & Rollo to conduct an SI to characterize the nature and extent of contamination at the Study Area and collect data required to evaluate potential remedial alternatives for the Study Area (Treadwell & Rollo, 2003a). The SI was conducted in two phases. Phase 1 was conducted in September 2002 to identify the presence of contamination in suspected source areas. The purpose of Phase 2, conducted in April and May 2003, was to delineate the nature and lateral and vertical extent of contamination found during Phase 1.

During Phase 1, a total of 21 soil borings (1349SB100 through -120) were advanced to depths ranging between 3 and 46.5 feet bgs (Figure 2-4). One boring (1349SB106) was later converted into a monitoring well (1349MW100). In preparation for the Fill Site 5 remedial action, which began in January 2003, monitoring well 1349MW03 was abandoned. During Phase 2, a total of 18 soil borings (1349SB121 through -134; 1349MW102, -104, -105, and 03R) were advanced to depths ranging between 6 and 48 feet bgs (Figure 2-4). Six of the borings were later converted into monitoring wells (1349MW101 through -105, and -03R).

A total of 85 soil samples were collected during Phases 1 and 2 of the SI. The soil samples were analyzed for TPHd, TPHfo, and/or PAHs. A total of 11 grab groundwater samples were collected and analyzed for TPHd and TPHfo. Phase 1 monitoring well 1349MW100 was first sampled as part of the Presidio-wide Groundwater Monitoring Program beginning in the Fourth Quarter 2002. The monitoring wells installed during Phase 2 were sampled for the first time as part of the Presidio-wide Groundwater Monitoring Program beginning with the Second Quarter 2003. All Building 1349 monitoring wells are now sampled as part of the Presidio-wide Groundwater Monitoring Program (Treadwell & Rollo, 2004). The analyses for groundwater monitoring well samples include TPH as gasoline (TPHg), TPHd, and TPHfo; PAHs; volatile organic compounds (VOCs); organochlorine pesticides (OCPs) and polychlorinated biphenyls (PCBs); chlorinated herbicides; dissolved oxygen; hexavalent chromium; total dissolved solids; dissolved metals; and general chemistry parameters.

Soil and groundwater results from the SI were compared with screening levels. For petroleum-related constituents in soil (i.e., TPHd, TPHfo, and PAHs), the most stringent of the following SCRs from RWQCB Order No. R2-2003-0080 (RWQCB, 2003a) were used as screening levels:

- **Protection of Human Health, Residential Use** (0 to 10 feet bgs) Although planned land use at the Site is recreational, more stringent residential cleanup levels were used to facilitate decisions for future unrestricted site use.
- Protection of Ecological Receptors, Terrestrial (0 to 3 feet bgs)
- Protection of Groundwater Resources at Drinking Water Levels (greater than 10 feet bgs) Two separate cleanup levels were used depending on whether the contamination was less than or greater than

5 feet above groundwater. In the absence of SCRs and to assess PAHs in soils greater than 5 feet above groundwater, RWQCB environmental screening levels (ESLs; RWQCB, 2003b) for groundwater protection were used.

For groundwater, drinking water cleanup levels from the Cleanup Levels Document (EKI, 2002), which consist of either maximum contaminant levels (MCLs) or risk-based drinking water standards, were used as screening levels. Values for surface water or freshwater seeps were not considered applicable to the Study Area because the nearest identified seep is over 500 feet from the Site and southwest of Former Fill Site 5 (Treadwell & Rollo, 2003a).

It is noted that these screening levels, except for the ESLs used for PAHs in soil, are equivalent to the SCRs adopted by the RWQCB in Order No. R2-2003-0080 (RWQCB, 2003a) for the Presidio and are the cleanup levels selected for this CAP.

The soil sample results are discussed below. The groundwater results are described in Section 2.4.6.

#### Soil TPH Results

Seventy-one soil samples were analyzed for TPHd and TPHfo during the SI. In addition to the TPHd and TPHfo results, the laboratory reported concentrations of TPH within the diesel range (C12-C24) that did not match the typical diesel standard; these results are identified as "unknown" fuel hydrocarbons (TPHd-unk). The majority of TPHd-unk detections had corresponding TPHfo detections which indicates that the heavier hydrocarbon degradation products are likely contributing to the unknown diesel range quantitation. TPHd-unk does not have a specified cleanup level; therefore, TPHd-unk concentrations were evaluated using the more conservative TPHd soil cleanup levels versus the TPHfo soil cleanup levels. The TPHd, TPHfo, and TPHd-unk results are summarized in Table B-1 and shown on Figures 2-4 and 2-5. The following summarizes the detected TPH results:

- TPHd was detected in 35 of the 71 samples at concentrations ranging from 1.1 to 17,000 mg/kg. Six of the results exceeded the applicable screening levels for TPHd.
- TPHfo was detected in 31 of the 71 samples at concentrations ranging from 11 to 11,000 mg/kg. Five of the detections were above the applicable screening levels for TPHfo with one non-detect sample having a laboratory RL above screening levels.
- TPHd-unk was detected in 22 of the 71 samples at concentrations ranging from 1.3 to 2,600 mg/kg. Two of the results were above the applicable screening levels for TPHd.

#### Soil PAH Results

A total of 80 soil samples, including seven quality control duplicate samples, were collected and analyzed for PAHs during the SI. The PAH results are summarized in Table B-2 and shown on Figures 2-4 and 2-5. The following three PAHs had concentrations exceeding screening levels:

• Benzo(a)pyrene was detected in 34 of the 80 samples at concentrations ranging from 0.0019 to 0.260 mg/kg. Nine of these detections exceeded the applicable soil screening level and one non-detect sample had an RL greater than the applicable soil screening level.

- Chrysene was detected in 30 of the 80 samples at concentrations ranging from 0.0016 to 19 mg/kg. One of these detections at 19 mg/kg exceeded the applicable soil screening level.
- Dibenzo(a,h)anthracene was detected in 32 of the 80 samples at concentrations ranging from 0.0021 to 0.23 mg/kg. Three of these detections exceeded the applicable soil screening level.

#### 2.4.6 Groundwater

Groundwater samples for the Study Area have been collected during the 1995-1996 SI, the 2002-2003 SI, and as part of the Presidio-Wide Groundwater Monitoring Program (*Semiannual Groundwater Monitoring Report, First and Second Quarters* 2004 – Treadwell & Rollo, 2004). Tables B-5 through B-11 present the 2003 SI and quarterly groundwater sampling results through the second quarter of 2004. The groundwater results from the 1995-1996 SI are discussed in Section 2.4.1 and presented in Appendix C. Figure 2-7 summarizes the analytical results from the SI grab groundwater samples and groundwater monitoring wells in the Study Area that had observed concentrations of chemicals in excess of cleanup levels, with the exception of select metals to be discussed below.

It should be noted that grab groundwater samples collected from soil borings during SI activities were for screening purposes only. Several factors, including high turbidity and possible cross-contamination as a result of drilling through overlying impacted soil zones, may have affected the data quality of these samples. As such, grab groundwater analytical results may not be indicative of actual groundwater conditions at a given location, though they are used to evaluate nature and extent of contamination in this CAP.

As part of the Presidio-Wide Groundwater Monitoring Program (Treadwell & Rollo, 2004), groundwater samples at the Study Area are analyzed for general minerals, dissolved metals, total dissolved solids, hexavalent chromium, dissolved oxygen, OCPs, PCBs, chlorinated herbicides, VOCs, TPH, and PAHs. Analytes have been detected in various groundwater grab samples and groundwater samples from monitoring wells; however, only a few compounds have been detected above their respective cleanup levels. Compounds detected above cleanup levels include the following:

- TPHg and TPHd in one monitoring well (1349MW100) and three groundwater grab samples from the 2003 SI;
- benzene in two monitoring wells (1349MW100 and 1349MW02);
- several PAHs in one monitoring well (1349MW100) and the PAHs dibenzo(a,h)anthracene and indeno(1,2,3-cd)pyrene in one monitoring well (1349MW03);
- metals, total chromium (1349MW02, 1349MW03, and 1349MW03R), arsenic (1349MW01, 1349MW100, and 1349MW105), and nickel (1349MW103); and
- OCPs in five monitoring wells (1349MW100, 1349MW03R, 1349MW101, and 1349MW102, installed as part of Building 1349 SI activities and LF5GW104, installed as part of Former Fill Site 5 activities).

These results are discussed below.

#### **Groundwater TPH Results**

TPH compounds were detected in three of the 11 groundwater grab samples from the 2003 SI and one of the nine Study Area groundwater monitoring wells at levels that exceed their respective cleanup levels (Table B-6). TPH results are summarized below:

- TPHd was detected in September 2002 groundwater grab samples from 1349SB111, -108, and -103 at concentrations of 960, 24,000, and 14,000 μg/L, respectively. It is noted, however, that TPHd has not been detected in groundwater from nearby wells (i.e., 1349MW103 in the vicinity of borings 1349SB108 and -111; and 1349MW03 and -102 which are proximate to and apparently downgradient of 1349SB103). Note that well 1349MW03 was last sampled in August 2002 and has been subsequently abandoned and replaced by 1349MW03R.
- TPHd and TPHg have been routinely detected in groundwater monitoring well 1349MW100. Concentrations of TPHd and TPHg were 3,600 and 920 µg/L, respectively, in May 2004.

#### **Groundwater VOC Results**

Groundwater samples were analyzed quarterly for VOCs beginning in the fourth quarter 2002 and continuing through the first quarter 2004 as part of the ongoing Presidio-Wide Groundwater Monitoring Program (Table B-7). BTEX compounds have been detected in monitoring well 1349MW100, although only benzene has been detected above the cleanup level of 1  $\mu$ g/L. The maximum concentration of benzene was in June 2003 at a concentration of 27  $\mu$ g/L. The benzene concentration in well 1349MW100 was 24  $\mu$ g/L in March 2004. There was also one detection of benzene at 1.1  $\mu$ g/L in well 1349MW02 in November 2001; however, the duplicate result for this sample was 0.8  $\mu$ g/L and benzene has not been detected in the well since that time. BTEX compounds were not detected above laboratory RLs or cleanup levels in the other Study Area monitoring wells.

#### **Groundwater PAH Results**

Groundwater samples from the Study Area groundwater monitoring wells have been analyzed for PAHs routinely since installation of the wells. Two (1349MW03 and -100) of the Study Area monitoring wells have had detectable concentrations of PAH compounds (Table B-9). Through May 2004, anthracene, benzo(a)anthracene, chrysene, fluoranthene, fluorene, naphthalene, phenanthrene, and pyrene had been detected in groundwater samples collected from well 1349MW100; only benzo(a)anthracene concentrations exceeded the cleanup level. Benzo(a)anthracene was detected in four of the six samples collected from this well since December 2002. The cleanup level for benzo(a)anthracene is 0.1  $\mu$ g/L and all detected concentrations ranged between 0.14 and 0.53  $\mu$ g/L, with the exception of a concentration of 6.2  $\mu$ g/L detected in March 2004. Results from recent sampling conducted in March 2005 indicate benzo(a)pyrene, benzo(b)fluoranthene, and dibenzo(a,h)anthracene concentrations above cleanup levels in well 1349MW100 (These results will be reported in the Semiannual Groundwater Monitoring Report for the First and Second Quarters of 2005).

Dibenzo(a,h)anthracene and indeno(1,2,3-cd)pyrene were detected in well 1349MW03 in November 2001 at concentrations of 0.36 and 0.17  $\mu$ g/L, respectively. These concentrations exceed the laboratory reporting limits of 0.2 and 0.14  $\mu$ g/L for dibenzo(a,h)anthracene and indeno(1,2,3-cd)pyrene, respectively, which are selected as cleanup levels in this CAP (Section 3.2). It is noted, however, that these compounds were not detected in groundwater from this well over the three quarters of sampling conducted in 2002. Well 1349MW03 has subsequently been abandoned to accommodate Former Fill Site 5 corrective action excavation activities.

#### **Groundwater OCP Results**

OCP analyses have been performed on groundwater samples collected from Building 1349 groundwater monitoring wells on a quarterly basis as part of the ongoing Presidio-Wide Groundwater Monitoring Program. OCP analytical results are summarized in Table B-8.

Groundwater monitoring wells 1349MW100, 1349MW03R, 1349MW101, 1349MW102, and LF5GW104 are the only wells that have had detectable concentrations of OCPs. The OCP beta-BHC was detected in March 2004 at laboratory qualified concentrations of 0.08 C  $\mu$ g/L and 0.06 C  $\mu$ g/L at wells 1349MW03R and 1349MW101, respectively. The OCP gamma-BHC was detected once during December 2003 at a laboratory qualified concentration of 0.07 C J+  $\mu$ g/L at well 1349MW102. Former Fill Site 5 monitoring well LF5GW104, located to the west of Building 1349, had one observed detection of beta-BHC in March 2004 (0.07 C  $\mu$ g/L). No other OCPs have been detected during any other quarterly monitoring event in Former Fill Site 5 monitoring wells. Wells 1349MW101, 1349MW102, 1349MW03R and LF5GW104 are all located approximately west of well 1349MW100 in the approximate area of Former Fill Site 5. The only Study Area well to have *repeated* detectable concentrations of OCPs is 1349MW100. Fifteen different OCPs have been detected in 1349MW100 at concentrations ranging from 0.06 to 6.1  $\mu$ g/L. Figure 2-7 depicts the laboratory results of the 10 OCPs at 1349MW100 that have been detected above their respective cleanup levels since groundwater monitoring was initiated in December 2002.

In August 2003, a pilot study was conducted in support of the *Development of Freshwater TPH-diesel and TPH-fuel oil Point of Compliance Concentrations, Presidio of San Francisco, San Francisco, California* (BBL, 2003) to evaluate whether the centrifugation technique could be successful in removing elevated levels of pesticides in well 1349MW100 while retaining similar concentrations of petroleum hydrocarbons. The candidate well was sampled as part of the Presido-wide Groundwater Monitoring Program (Treadwell & Rollo, 2004) and chemical analyses of pesticides were conducted on both centrifuged and uncentrifuged samples. Following centrifugation, pesticides concentrations decreased only slightly. For example, heptachlor decreased from 2.6 to 2.0 µg/L. This is further discussed in Appendix D.

#### Groundwater Metals Results

Three dissolved metals (total chromium, arsenic and nickel) have been detected in groundwater samples from various Study Area monitoring wells during the quarterly sampling events at concentrations in excess of their respective cleanup levels. Table B-11 summarizes the analytical results for dissolved metals and corresponding cleanup levels. Groundwater samples containing concentrations of metals above the applicable cleanup levels are shown on Figure 2-8.

Total chromium has been routinely detected at concentrations in excess of the cleanup level (50  $\mu$ g/L) at three monitoring wells, 1349MW02, 1349MW03, and 1349MW03R. Concentrations in excess of the cleanup level have ranged from 59 to 130 J  $\mu$ g/L at these wells.

Arsenic was detected at concentrations in excess of the cleanup level ( $10 \mu g/L$ ) at three monitoring wells, 1349MW01, 1349MW100, and 1349MW105. Concentrations in excess of the cleanup level have ranged from 11 to 23 J  $\mu g/L$  at 1349MW100 and 10 to 12 J+  $\mu g/L$  at 1349MW105. Only one exceedence of the cleanup level, 14  $\mu g/L$ , was detected at 1349MW01 in December 2002.

Nickel was detected at concentrations in excess of the cleanup level (100  $\mu g/L$ ) at one monitoring well, 1349MW103. Concentrations of nickel in excess of the cleanup level ranged from 100 to 180  $\mu g/L$ . The maximum concentration of 180  $\mu g/L$  was detected in March 2004.

Appendix E provides a more detailed discussion of the occurrence of these dissolved metals at the Study Area and the nature and extent of these metals, in context with Appendix E, is further described in Section 2.5.2.

#### 2.5 Nature and Extent of Contamination

This section presents an analysis of the nature and extent of contamination in soil and groundwater at the Study Area based on the potential source areas and results of previous investigations and corrective actions identified in Section 2.4. For the identification of impacted areas, the chemical data were compared with cleanup levels for this CAP which are introduced and selected in Section 3.2. For petroleum constituents in soil, the cleanup levels include human health (residential) from 0 to 10 feet bgs, ecological (terrestrial) from 0 to 3 feet bgs, and protection of groundwater resources (greater than 10 feet bgs); it is noted that these petroleum cleanup levels are equivalent to the FPALDR and SCR levels used during the AST and FDS removal actions and 2003 SI screening discussed in Section 2.4. For metals in soil, the cleanup levels include human health (residential) from 0 to 10 feet bgs, ecological (special-status) from 0 to 3 feet bgs, and background concentrations (predominantly for serpentinite soils). For groundwater, cleanup levels include drinking water levels (i.e., MCLs or risk-based standards).

This discussion relies on data representing current conditions in soil at the Study Area. Therefore, sample results associated with soils that were removed during the AST and FDS removal actions are not included to evaluate current nature and extent of contamination.

#### 2.5.1 Nature and Extent of Contamination in Soil

Petroleum-related compounds and metals have been detected in soil at concentrations above cleanup levels. OCPs have not been tested in Study Area soil, though OCPs have been detected in groundwater. Below is a discussion of the nature and extent of contamination for each of these constituents in soil at the Study Area. The soil data are presented in Appendix B and C tables and summarized on Figures 2-4 through 2-6.

#### Petroleum-Related Compounds

The results of analyses conducted on soil indicate that TPHd (including TPHd-unk and TPHd-e), TPHfo, and PAHs are present at concentrations above applicable soil cleanup levels at the Study Area. The cleanup level exceedances, which are presented on Figures 2-4 and 2-5, indicate that soil contamination falls into two general zones: shallow soil and deep soil. In addition, residual contamination associated with the telecommunications corridor is a third zone of soil contamination. These zones are summarized below and analyzed in detail in Chapters 3 and 4:

- Shallow soil (0 to 10 feet bgs): Soil analytical results indicate that soil is impacted with the following constituents at concentrations that exceed the applicable soil cleanup levels: TPHd (including TPHd-unk and TPHd-e), TPHfo, total TPH (by immunoassay, assumed to be representative of TPHd or TPHfo), benzo(a)pyrene, dibenzo(a,h)anthracene, and chrysene. Three areas of shallow soil contamination are present at the Study Area as follows:
  - 1. North of Former Building 1349 (in the vicinity of the Former FDS Excavation Areas): An area extending approximately 20 to 90 feet north of the former Building 1349 in the vicinity of the previous FDS excavations contains TPH and PAHs above cleanup levels. The volume of impacted soil is estimated to be approximately 630 cubic yards.

- 2. <u>North FDS</u>: Shallow soil along a former FDS pipeline contains PAHs above cleanup levels in two areas (around borings 1349SB112 and -113). The total volume of impacted soil is estimated to be approximately 60 cubic yards.
- 3. Northeast of telecommunications corridor and southeast of Former Building 1349: An area approximately 5 to 10 feet east-northeast of the telecommunications conduit contains TPHd-e above cleanup levels. The volume of impacted soil is estimated to be approximately 90 cubic yards.
- **Deep soil** (>10 feet bgs): Soil in the vicinity of 1349SB127 is impacted with TPHd at concentrations that exceed the applicable soil cleanup levels. This area of deep soil contamination falls within the boundaries of the shallow soil contamination area north of the former Building 1349. The contamination is known to extend vertically to approximately 20 feet bgs. The volume of impacted soil is estimated to be approximately 30 cubic yards.
- Shallow and deep soil adjacent to the telecommunications corridor: Impacted soil was left in-place in the vicinity of the telecommunications corridor during the previous removal action. Soil in this area is impacted with TPHd and PAHs exceeding applicable soil cleanup levels. The volume of impacted soil is estimated to be approximately 380 cubic yards.

#### Metals

Metals detected in Study Area soils at levels exceeding applicable cleanup levels and background values are arsenic and vanadium. Serpentinite is the predominant soil lithology at the Study Area. Therefore, serpentinite background concentrations were used for an initial screening to assess if metals are present in Study Area soils at concentrations above background, although other soil types are applicable to the Study Area, as discussed below.

The background threshold concentration for arsenic in serpentinite soil is 5.4 mg/kg. Six samples within the 0 to 10 feet bgs depth interval had arsenic concentrations ranging from 5.6 to 9.5 mg/kg, exceeding this background concentration. Four of these detections were in samples collected at 10 feet bgs (at borings 1349SB02, -03, -10, and -12). Only two samples collected in shallower soils (4 feet bgs at boring 1349SB04 and 5 feet bgs at boring 1349SB05) had arsenic concentrations which also exceeded the background serpentinite concentration of 5.4 mg/kg. However, arsenic in Study Area soils is believed to be naturally occurring, based on the following:

- The 95 percent upper confidence limit on the arithmetic mean (95%UCL) concentration for arsenic in Study Area soils from 0 to 10 feet bgs is 4.4 mg/kg, which is below the background concentration for serpentinite soils of 5.4 mg/kg.
- Arsenic concentrations in Study Area soils generally increase with depth which would not be representative of a surface or near-surface release of contaminants (from the former ASTs or FDS). Arsenic concentrations in shallow soils from 0 to 6 feet bgs range up to 6.4 mg/kg with an average concentration of 3.6 mg/kg, whereas arsenic concentrations range up to 13.4 mg/kg with an average concentration of 6.3 mg/kg in deeper soils from 10 to 20 feet bgs. Additionally, four of the highest concentrations of arsenic in 0 to 10 feet bgs soils (ranging from 5.7 to 9.5 mg/kg), which exceed the serpentinite background concentration of 5.4 mg/kg, are all associated with samples collected at 10 feet bgs. It is noted that this general trend of higher arsenic concentrations in deeper soils was also observed in soils prior to the excavations performed during the AST removal.

- There appears to be a strong relationship between arsenic and iron concentrations in Study Area soils. High arsenic concentrations are typically associated with high iron concentrations. In addition, the two highest concentrations of arsenic (9.5 and 7 mg/kg) were detected in samples with two of the highest levels of iron (44,700 and 58,800 mg/kg, respectively). This indicates that elevated arsenic concentrations are likely associated with the natural geochemical environment of Study Area soils.
- A review of boring logs for samples with elevated arsenic concentrations above the serpentinite background level indicates that the sampled soils were generally mixtures of sandy clay, clayey silt, and silty sands, with varying amounts of weathered gravels. Weathered fragments of sandstone, siltstone, and shale were prevalently described in all boring logs for these samples (Montgomery Watson, 1995a). These materials are derived from the weathering of localized Sheared Rock and Jurassic/Cretaceous Sedimentary Rock Units. As noted in Section 2.1.1.2, these secondary geologic units have not be characterized geochemically in terms of background metals for the Presidio (EKI, 2002). For this reason, exceedances of the serpentinite background concentration in these samples are not necessarily indicators that the arsenic is indicative of site-related contamination, but rather could be related to background conditions.

For vanadium, only one result at 77.4 mg/kg in 1-foot bgs soil (1349SB01) slightly exceeded the cleanup level and serpentinite background concentration of 74 mg/kg. The 95% UCL concentration for vanadium remaining in Study Area soils from 0 to 3 feet bgs (which is the depth interval of concern for terrestrial ecological receptors which drive the cleanup level for vanadium) is 70.2 mg/kg, which is below the serpentinite background concentration.

Furthermore, as discussed in Section 2.4.1, a statistical evaluation of metals, including an analysis of their occurrence with TPH constituents, was conducted in the 1995 SI Report (Montgomery Watson, 1995). The evaluation concluded that arsenic and vanadium levels in soil at the Study Area are unrelated to TPH and are likely naturally occurring.

Based on this evaluation, it is concluded that residual metals concentrations in soil at the Study Area are below cleanup levels and/or are naturally occurring.

#### **OCPs**

OCPs have not been analyzed in soil samples at the Study Area. Based on the results of groundwater monitoring, OCPs appear to be limited to the area around well 1349MW100. Soil in this area was previously excavated to a depth of 12 feet bgs during the AST removal program (Section 2.4.2). Therefore, OCPs are not expected to be currently present in soil at levels that would pose a risk to human health or the environment at the Study Area.

#### 2.5.2 Nature and Extent of Contamination in Groundwater

TPHd, TPHg, benzene, benzo(a)anthracene, dibenzo(a,h)anthracene, and indeno(1,2,3-c,d)pyrene, as well as several OCPs and metals have been detected in groundwater at concentrations above cleanup levels. Below is a discussion of the nature and extent of contamination for each of these constituents in groundwater at the Study Area. The groundwater data are presented in Tables B-5 through B-11 and summarized on Figures 2-7 and 2-8.

#### **TPH**

Grab groundwater samples from four locations from the 1995-1996 SI (1349SB25, -27, -22, and -19) and three locations from the 2003 SI (1349SB111, -108, and -103) had elevated TPHd concentrations; however, monitoring wells installed upgradient and downgradient from these boring locations have no groundwater samples with TPHd exceedances since they were installed and first sampled during the second quarter of 2003. TPHd and TPHg have only been detected in excess of the cleanup level at one monitoring well, 1349MW100.

#### **VOCs**

Benzene is the only BTEX compound detected at Study Area monitoring wells in excess of the cleanup level. Benzene has routinely been detected in excess of the cleanup level in one monitoring well, 1349MW100. The low benzene concentration detected in well 1349MW02 was non-repeatable.

#### **PAHs**

Several PAHs have been detected at concentrations in excess of the cleanup level in one monitoring well, 1349MW100. One groundwater monitoring well (1349MW03, which has subsequently been abandoned) had detectable concentrations of dibenzo(a,h)anthracene and indeno(1,2,3-cd)pyrene above cleanup levels in November 2001, but these compounds were not detected in the well over the three quarters of sampling conducted in 2002.

#### **OCPs**

Samples of groundwater from monitoring well 1349MW100 consistently contain concentrations of OCPs above the applicable drinking water cleanup levels. No other Study Area wells or adjacent Former Fill Site 5 wells have had detectable concentrations of OCPs above the applicable cleanup levels for the Study Area. The low concentrations detected in other wells have been non-repeatable and other results for OCPs in those wells were below laboratory RLs.

The occurrence of OCPs at 1349MW100 is not clearly related to any previous Building 1349 operational activities. Appendix D provides a discussion of the properties and occurrence of OCPs in relation to the conditions observed at the Study Area. Appendix D also provides several scenarios that could potentially account for the occurrence of OCPs at the Study Area. Although there are several potential scenarios that could explain the occurrence of OCPs at 1349MW100, there is no clear evidence that any of the scenarios actually occurred at the Study Area and all are based on speculation. Most of the soil column above and immediately adjacent to 1349MW100 has already been excavated as part of previous corrective actions and therefore, the opportunity to further investigate the historic source of the OCPs detected in 1349MW100 is hindered. *Metals* 

The dissolved metals, total chromium, arsenic, and nickel have been detected in Study Area monitoring wells at concentrations in excess of the cleanup level as follows:

- Total chromium has been detected at concentrations in excess of the cleanup level (50 μg /L) at three monitoring wells, 1349MW02, 1349MW03, and 1349MW03R.
- Arsenic was detected at concentrations in excess of the cleanup level (10  $\mu$ g/L) at three monitoring wells, 1349MW01, 1349MW100 and 1349MW105.

• Nickel was detected at concentrations in excess of the cleanup level (100 μg/L) at one monitoring well, 1349MW103.

Concentrations and distributions of these and other trace elements analyzed in groundwater samples suggest it is unlikely that these concentrations represent significant impacts associated with past activities at the Study Area. Rather, it is likely that the limited detections above cleanup levels reflect naturally occurring metals. For example, elevated naturally occurring chromium has been documented in Presidio-wide groundwater (EKI, 2002). The elevated concentrations of chromium are related to naturally occurring chromium in serpentinite, which has also been documented to have elevated concentrations of nickel (EKI, 2002). As discussed in Section 2.5.1, Study Area soil is characterized as slope debris and ravine fill deposits derived from underlying bedrock including serpentinite, shale/siltstone, sandstone, and interbedded weathered clay and silt. Both Study Area soil and the underlying bedrock are understood to contain naturally occurring arsenic, as discussed in Section 2.5.1, based on the statistical evaluation of arsenic concentrations in Study Area soil.

It should be noted that it is common to observe localized variability in concentrations of naturally occurring metals in groundwater. Geochemical variations (and resulting variations in concentrations of metals in groundwater) observed at the Study Area, likely reflect influence from past site activities as well as natural variability. In particular, slightly elevated concentrations of metals in 1349MW100 are likely associated with the development of anoxic conditions due to readily degradable organic compounds associated with releases of diesel or fuel oil. Introduction of petroleum hydrocarbons as a food source for bacteria helped modify geochemical conditions, creating anoxic/low oxic conditions which in turn changed the partitioning relationships among metals, such that aqueous concentrations at some locations slightly exceed groundwater cleanup levels. Additional variations in concentrations of metals in groundwater are likely associated with natural variability in geochemistry across the Study Area. Specifically, slightly elevated concentrations of metals in 1349MW105 are likely associated with higher pH values observed in this area. The observed variability of these constituents and geochemistry are discussed in greater detail in Appendix E. Based on these observations, elevated metals concentrations in groundwater above cleanup levels are considered to be associated with the geochemical conditions at the Study Area.

## 3. Summary of Site Risks

This section presents the remedial action objectives (RAOs) and identifies the cleanup levels, contaminants of concern (COCs), and remedial units (RUs) for this CAP.

## 3.1 Remedial Action Objectives (RAOs)

RAOs are statements of the general goals of an environmental cleanup. For the cleanup remedies to be conducted at the Study Area, the RAOs include the following:

- Protection of human health and the environment;
- Cost-effective cleanup of the Study Area consistent with its potential land use;
- Compliance with State and Federal environmental laws;
- Consistency of selected remedial alternatives at the Study Area with the overall transformation of the Presidio into a national park site; and
- Preference for permanent ("clean closure") remedies whenever practicable, cost-effective, and consistent with current or anticipated land use.

## 3.2 Development of Cleanup Levels and Identification of COCs

This section presents the Study Area corrective action soil and groundwater cleanup levels which are used to evaluate and select COCs. Chemical-specific regulatory levels were adopted as CAP cleanup levels, when available. The chemical-specific regulatory levels include SCRs for petroleum hydrocarbons and related constituents in soil adopted by the RWQCB in Order No. 92-2003-0080 (RWQCB, 2003a) and Federal and California State MCLs for chemicals in groundwater. In the absence of SCRs or MCLs, Presidio-specific risk-based cleanup levels presented in the Cleanup Levels Document (EKI, 2002) were selected.

The Cleanup Levels Document identifies several steps to select chemical- and site-specific cleanup levels (EKI, 2002). For soil, this includes identification of the following: impacted media, predominant soil lithology, planned human land use (residential, recreational, or commercial/industrial), planned ecological land use (including the presence of special-status species), the presence of petroleum related chemicals, depth to groundwater, and resources to be protected. The most stringent soil cleanup level is then selected as the applicable cleanup level. For groundwater or surface water, the following attributes must be identified: type of water body and level of protection required. The most stringent groundwater cleanup level is then selected as the applicable cleanup level. Accordingly, Presidio cleanup levels are media, location, and depth-specific.

## 3.2.1 Soil Cleanup Levels

For petroleum-related constituents in Site soils (i.e., TPHd, TPHfo, and PAHs), the most stringent of the following SCRs from RWQCB Order No. R2-2003-0080 (RWQCB, 2003a) were selected as cleanup levels:

- **Protection of Human Health, Residential Use** (0 to 10 feet bgs) Although planned land use at the Site is recreational (EKI, 2002), more stringent residential cleanup levels were selected to facilitate decisions for future unrestricted Site use.
- Protection of Ecological Receptors, Terrestrial (0 to 3 feet bgs)
- Protection of Groundwater Resources at Drinking Water Levels (greater than 10 feet bgs) Two separate cleanup levels were selected depending on whether the contamination was less than or greater than 5 feet above groundwater. Historically, the minimum depth to groundwater at the Site is 25 feet bgs. Therefore, for the 10 to 20 foot bgs depth interval, it was assumed that the contamination was greater than 5 feet above groundwater. For depths over 20 feet, the contamination was evaluated on a location-specific basis to determine if it was within 5 feet of groundwater, based on historical groundwater measurements.

Non petroleum-related compounds detected in Site soils are metals. The following cleanup levels from the Cleanup Levels Document (EKI, 2002) are applicable for metals in soil:

- **Protection of Human Health, Residential Use** (0 to 10 feet bgs) Although planned land use at the Site is recreational (EKI, 2002), more stringent residential cleanup levels were selected to facilitate decisions for future unrestricted Site use.
- *Protection of Ecological Receptors, Special-Status* (*0 to 3 feet bgs*) The Site falls within a special status species ecological area and historic forest zone (EKI, 2002).
- Background Concentrations for Serpentinite The predominant lithology at the Site is serpentinite or soils that, in part, are derived from serpentinite components of the Franciscan Formation bedrock (slope debris and ravine fill as described in Section 2). Therefore, serpentinite background concentrations were used for an initial screening to assess if metals are present in Study Area soils at concentrations above background. However, as discussed in Section 2.1.1.3, the slope debris and ravine fill deposits at the Study Area are derived from local weathered bedrock sources, including serpentinite, shale/siltstone, sandstone, and interbedded weathered clay and silt. The significance of this is that these secondary geologic units (i.e. the Sheared Rock and Jurassic/Cretaceous Sedimentary Rock) have not been characterized geochemically in terms of background metals for the Presidio (EKI, 2002). Hence, these Study Area units may have background metals "signatures" that differ from the primary soil or bedrock types and therefore, can be confused with contamination (EKI, 2002). For this reason, serpentinite background concentrations are selected as cleanup levels, in conjunction with an evaluation of background trends on a sample-specific basis.

The most stringent of the human health and ecological cleanup levels was selected as the cleanup level for each metal, except in cases where background concentrations where higher, in which case background concentrations were selected as the applicable cleanup levels.

Chemical-specific Site cleanup levels are presented in Table 3-1 for the chemicals detected in soils. The Presidio-Wide Quality Assurance Project Plan (QAPP; Tetra Tech, 2001) analytical RLs and laboratory RLs are also listed. Although in several cases the QAPP analytical RLs exceed the cleanup levels, the laboratory RLs are below the cleanup levels for all compounds listed.

## 3.2.2 Groundwater Cleanup Levels

Groundwater cleanup objectives selected for this CAP are drinking water levels. This is in keeping with the RWQCB's Basin Plan and Order No. R2-2003-0080, which designate municipal and domestic supply as a beneficial use for groundwater within the Marina and Coastal Bluffs Groundwater Basins. However, it is noted that due to the complex hydrology in the vicinity of the Study Area and technical limitations, including low specific yield of wells in the area, the potential for future groundwater development for supply is extremely low.

Drinking water cleanup levels from the Cleanup Levels Document (EKI, 2002), which consist of either MCLs or risk-based drinking water standards, were selected as cleanup levels for the Study Area. For several chemicals, drinking water standards are not available. In these cases, drinking water ESLs developed by the RWQCB were selected as cleanup levels (RWQCB, 2003b). Values for surface water or freshwater seeps were not considered applicable to the Study Area because the nearest identified seep is over 500 feet from the Site and southwest of Former Fill Site 5 (Treadwell & Rollo, 2003a).

Site-specific groundwater cleanup levels are presented in Table 3-2. The QAPP analytical RLs (Tetra Tech, 2001) and laboratory RLs are also listed. Although in several cases the QAPP analytical RLs exceed the cleanup levels, the laboratory RLs are below the cleanup levels for all compounds listed, except for dibenzo(a,h)anthracene, indeno(1,2,3-cd)pyrene, aldrin, heptachlor, and heptachlor epoxide; for these five chemicals, the laboratory RLs were selected as cleanup levels.

#### 3.2.3 Soil COCs

Figures 2-4 through 2-6 show concentrations of COCs exceeding cleanup levels in soil. As discussed in Section 2.5.1, TPHd (represented by TPHd, TPHd-e, and TPHd-unk), TPHfo, and the following six PAHs were found in soil at concentrations greater than applicable cleanup levels: benzo(a)pyrene, dibenzo(a,h)anthracene, benzo(a)anthracene, benzo(b)fluoranthene, benzo(k)fluoranthene, and chrysene. These chemicals are selected as COCs in soil for the Study Area.

As discussed in Section 2.5.1, residual metals concentrations exceeding cleanup levels in soil at the Study Area are likely naturally occurring. Therefore, metals are not selected as soil COCs for this CAP. However, to confirm the evaluation that metals are naturally occurring and not related to petroleum-related impacts, metals will be included for analysis in soil confirmation samples as part of the proposed corrective action for soils, as discussed in Section 5.2. As discussed in Section 2.5.1 and 2.5.2, OCPs have not been previously analyzed in Study Area soils; however, OCPs have been detected in Study Area groundwater, primarily at monitoring well 1349MW100. Although not retained as a soil COC for this CAP, OCPs will be included for analysis in soil confirmation samples as part of the proposed corrective action for soils, as discussed in Section 5.2.

The following are COCs by area of soil impacts:

- COCs for shallow soil are TPHd, TPHfo, and PAHs (benzo(a)pyrene, dibenzo(a,h)anthracene, and chrysene).
- The COC for deep soil is TPHd.
- COCs for the telecommunications corridor are TPHd and PAHs (benzo(a)pyrene, benzo(a)anthracene, benzo(b)fluoranthene, benzo(k)fluoranthene, and chrysene).

#### 3.2.4 Groundwater COCs

Figures 2-7 and 2-8 show concentrations of COCs exceeding cleanup levels in groundwater through 2004. As discussed in Section 2.5.2, compounds detected at concentrations above applicable cleanup levels in groundwater include the following: TPHd, TPHg, benzene, PAHs, OCPs, and metals. These chemicals are discussed below:

- TPHd, TPHg, benzene, and PAHs have routinely been detected above cleanup levels in groundwater at well 1349MW100. Therefore, TPH compounds, benzene, and PAHs are retained as groundwater COCs. These COC impacts appear to be localized around well 1349MW100.
- Two PAHs, dibenzo(a,h)anthracene and indeno(1,2,3-c,d)pyrene, were detected above cleanup levels in well 1349MW03 in November 2001 but were not detected during the last three quarters of monitoring from this well in 2002.
- As discussed in Section 2.5.2 and Appendix E, metals concentrations above cleanup levels in groundwater are considered to be associated with the geochemical environment of the Study Area. Although it is understood that the geochemical environment in some areas within the Study Area has been altered by the natural degradation processes of petroleum hydrocarbons, geochemical conditions exist in some portions of the Study Area in the absence of petroleum hydrocarbon impacts that result in concentrations of metals above groundwater cleanup levels (e.g., arsenic in 1349MW105). In areas impacted by petroleum hydrocarbons, over time, as the petroleum hydrocarbons are consumed by natural processes, natural partitioning relationships amongst metals will be reestablished. In the mean time, there is no evidence for significant mobility of these metals within the groundwater at the Study Area. Elevated concentrations of metals above the cleanup levels are limited to the vicinity of individual wells and no apparent metals "plumes" are indicated. As discussed in Appendix E, modeling shows that transport of metals under worst case conditions is extremely limited. However, arsenic is retained as a COC for the Study Area.
- Lacking conclusive evidence for any particular source scenario (Section 2.5.2 and Appendix D), the
  occurrence of OCPs at 1349MW100 is not clearly related to any previous Building 1349 operational
  activities. However, OCPs have been retained as groundwater COCs for evaluation of potential
  corrective actions.

In summary, the following compounds have been selected as COCs for groundwater in the Study Area:

- TPHd and TPHg;
- benzene;
- PAHs;
- OCPs; and
- arsenic.

Although not retained as COCs, dissolved metals, such as chromium and nickel, will continue to be monitored at the Study Area.

#### 3.3 Identification of Remedial Units

Based on the cleanup level exceedances shown on Figures 2-4 through 2-8, the following RUs have been selected for the Study Area to be evaluated under the CAP process:

- Shallow Soil (0 to 10 feet bgs);
- Deep Soil (>10 feet bgs);
- Telecommunications Corridor Soil; and
- Groundwater.

The soil and groundwater units are summarized in Table 3-3. The approximate areas of these RUs are shown on Figure 3-1. The total volume of impacted soil in the soil RUs is approximately 1,410 cubic yards, as summarized in Table 3-3.

The lateral and vertical extent of the RUs was determined by evaluating the location of former source areas and presence of COCs above cleanup levels using previous data collected at the Study Area. In some cases, the limits of the RUs are not well delineated by sample data. In these cases, assumptions were made based on the limited data. Final limits of the RUs will be determined, as applicable, during implementation of the corrective actions described in Section 5.0.

#### 3.3.1 Shallow Soil

The Shallow Soil RU is comprised of three distinct areas (Areas 1 through 3), as follows (Figure 3-1):

- Shallow Soil Area 1: Area 1 encompasses the Former FDS Remedial Excavation areas. The southern, western, and northern limits of this RU are well delineated by SI, FDS, and AST remedial excavation samples. Although the eastern boundary of the RU is not well delineated by samples, it is likely limited to the vicinity of the former FDS pipelines. The vertical limit of this RU was selected as 10 feet bgs. Contamination in this area has been found in soils to 20 feet bgs. However, because different cleanup levels apply to the 0 to 10 feet bgs soil interval than deeper soils and remedial technologies may be different for shallow and deep soils, a vertical limit of 10 feet bgs was selected for Shallow Soil Area 1. Contamination extending deeper than 10 feet bgs is considered part of the Deep Soil RU (Section 3.3.2). COC impacts at Shallow Soil Area 1 extend to approximately 7 to 9 feet bgs. The approximate volume of soil within Shallow Soil Area 1 is 630 cubic yards.
- Shallow Soil Area 2: Area 2 encompasses two small areas along the northern end of the former FDS pipeline within the Study Area. The lateral extent of this RU is likely limited to the vicinity of the former FDS pipelines. The vertical extent of the COC exceedances in Area 2 is estimated to be approximately 3 feet bgs, because only the trench backfill material is suspected of containing COCs above the cleanup levels. The approximate volume of soil within Shallow Soil Area 2 is 30 cubic yards.
- Shallow Soil Area 3: Area 3 encompasses an area directly northeast of the telecommunications conduit. This area includes residual soil contamination that was left in-place underneath the AST removal excavation Area 2. The lateral extent of this RU is likely limited to the area surrounded by the former excavation boundary as post-excavation confirmation samples collected in the area confirmed that cleanup levels were achieved in the area. The shallow extent of this unit varies from between 2 to 8 feet bgs (the bottom of the previous excavation) to a maximum of 10 feet bgs (samples collected deeper than 10 feet bgs during the 1995-1996 SI indicated that COCs are below cleanup levels). COCs were

detected above cleanup levels between 5 and 10 feet bgs. The approximate volume of soil within Shallow Soil Area 3 is 150 cubic yards.

## 3.3.2 Deep Soil

The Deep Soil RU consists of soil within a small area (around boring 1349SB127) at depths greater that 10 feet bgs, as presented on Figure 3-1. The lateral extent of this RU is well delineated to the north, south, and east by borings 1349SB127, -125, and -126, respectively. Samples collected in these three borings from 10 to 25 feet bgs had no COCs detected above cleanup levels. To the west, the deep soil unit is not well delineated, except by boring 1349SB24 which is located approximately 50 feet away. The vertical extent of this RU is assumed to be approximately 22 feet bgs, based on detections of COCs above cleanup levels to 20 feet bgs but not at 25 feet bgs. The approximate volume of the Deep Soil RU is 30 cubic yards.

## 3.3.3 Telecommunications Corridor Soil

The Telecommunications Corridor Soil RU is a wedge-shaped mass of impacted soil beneath the telecommunications line adjacent to Washington Boulevard. This soil was left in place after previous remedial excavations on the east and west sides of the telecommunications conduit that runs along the east side of Washington Boulevard because it was technically impractical to remove it without jeopardizing the integrity of the conduit. The conduit is 2- to 2.5-feet wide and 2.5-feet deep and the top of the conduit occurs at approximately 1-foot below grade. The vertical extent of this RU is assumed to extend deeper than 12 feet bgs, which is the maximum depth of the previous soil excavations in the area. The contamination may extend to groundwater which is approximately 30 feet bgs. Although different cleanup levels apply to the 0 to 10 feet bgs soil interval than deeper soils, this remedial unit was evaluated as one unit because of its location under the existing telecommunications corridor. The lateral extent of this RU is likely limited to the area surrounded by the former remedial excavation as soil samples collected from borings 1349SB117 through 1349SB120 did not have COC exceedances (Figure 2-4). The approximate volume of the Telecommunications Corridor Soil RU is 570 cubic yards.

## 3.3.4 Groundwater

Based on groundwater monitoring data, the main Groundwater RU is believed to be limited to an area around one well, 1349MW100, in the middle of the Former Building 1349 Area 2 and 3 remedial excavations on the western part of the Study Area. The COCs exceeding respective cleanup criteria at this well include TPHg, TPHd, benzene, PAHs, arsenic, and OCPs, as presented in Figures 2-7 and 2-8. The Groundwater RU also includes well 1349MW105 where only arsenic has been detected consistently above the cleanup level due to hydrogeochemical alterations of groundwater from petroleum hydrocarbon impacts.

# 4. Evaluation of Corrective Actions

This section presents the evaluation of corrective actions for each Study Area RU. Section 4.1 identifies the evaluation criteria used in the CAP. Potential remedial technologies that could be used to achieve the RAOs are discussed in Sections 4.2 and 4.3. Section 4.4 discusses the screening of these remedial technologies pursuant to screening criteria, and Section 4.5 organizes combinations of viable technologies into corrective action alternatives and evaluates these alternatives against the corrective action selection criteria. Finally, the recommended corrective action alternatives are presented in Section 4.6.

#### 4.1 Identification of Evaluation Criteria

Factors that will be used to evaluate corrective action alternatives were applied to initially screen potential remedial technologies identified for the Shallow Soil RU, the Deep Soil RU, the Telecommunications Corridor Soil RU, and the Groundwater RU at the Study Area. The screening criteria are technical effectiveness, implementability, and cost.

#### 4.1.1 Technical Effectiveness

**Screening Criteria 1 - Technical effectiveness**, refers to the ability of a technology to address: 1) the estimated area or volumes of media requiring remediation to meet the RAOs; 2) the potential impacts to human health and the environment during implementation and any construction; and 3) the long-term reliability and proven history of the technology with respect to the types of chemicals and conditions at similar sites.

# 4.1.2 Implementability

**Screening Criteria 2 - Implementability**, refers to both the technical and institutional feasibility of implementing a particular remedial technology, including: 1) the likelihood of obtaining permits and approvals from regulatory agencies; 2) availability of appropriate treatment, storage, and disposal facilities; and 3) availability of the equipment, materials, and skilled workers necessary to implement the particular technology and access to contaminated material (such as underground utilities like the telecommunications conduit).

#### 4.1.3 Cost-Effectiveness

**Screening Criteria 3 - Cost effectiveness**, includes assessing the relative capital and operation and maintenance (O&M) costs associated with a particular technology. Costs are estimated using best engineering judgment at the time of the estimate. Cost-effectiveness weighs required expenditures against potential benefits, and is used to eliminate options that are substantially more expensive than other process options providing the same level of protection.

# 4.2 Identification of Potential Soil Remedial Technologies for Corrective Action

The remediation technologies that are proposed for each of the soil RUs to develop corrective action alternatives are described in the following sub-sections. Table 4-1 provides a summary of potential remedial technologies considered for all RUs.

#### 4.2.1 No Action

For this alternative, soil would be left in place. No additional control or protection of human health and the environment would be implemented for the contamination present other than reduction of COCs from naturally occurring degradation. There is negligible cost associated with this alternative.

# 4.2.2 Excavation and Off-site Disposal

The objective of this alternative would be to remove contaminated soil from the RU. Conventional excavation technologies (e.g. excavators, backhoes, etc) can remove soil to approximately 10 feet bgs without having to shore the sidewalls of the excavation or having considerable health and safety concerns. During past activities at the Presidio, excavations have been completed to depths between 12 and 15 feet bgs; however, at the Study Area weathered bedrock of the Franciscan Formation may render excavation infeasible if relatively competent bedrock is encountered. Excavated soil would be sampled for waste profiling then transported and disposed at an off-site, permitted waste management facility. Confirmation soil sampling of the bottom and sidewalls of the excavation would be performed to ensure all accessible contaminated soil was removed before placing clean fill to a specified elevation. This technology removes the contaminants from the Study Area. However, during implementation, there would be limited short-term exposure to contaminants for workers.

# 4.2.3 Capping

Capping involves placement of an engineering control (cap) over soil to isolate soil, limit human and ecological contact with soil, and/or reduce the infiltration of water and leaching of contaminants. This technology minimizes the potential for human health and environmental risks. Impacted soil would either be directly covered or soil would be excavated to a depth that would allow placement of a cap. Soil would be capped with soil of low permeability (10 -6 cm/s) or synthetic material such as a geosynthetic clay liner (GCL). The purpose of this layer is to prevent infiltration (mitigate leaching of contaminants into underlying groundwater). The cap would be covered with an appropriate soil and vegetation in accordance with the Vegetation Management Plan (VMP; Trust and NPS, 2001). Excavated material and soil would be removed for off-site disposal or recycling. The remedial technology of capping leaves a majority of contaminated soil in place. Therefore, a land use control (LUC) would be required in conjunction with capping to increase the effectiveness of this technology.

#### 4.2.4 Land Use Controls

The LUC is a non-engineering measure designed to limit exposure to contaminants left in place in soil at concentrations above levels considered protective for future site use. Under this alternative, soil would remain in place and LUCs would be implemented to restrict access to the contamination. Implementation of LUCs would restrict future site disturbance and maintain site cover to minimize human or environmental exposure. The Study Area RUs are located in Area B of the Presidio. Existing and planned land uses in Area B are directed by the Trust through its comprehensive land use and management plan, the PTMP (Trust, 2002). LUCs

for Area B remediation sites include restricting or controlling site uses by administrative procedures such as preparing a site-specific addendum to the Presidio Trust's Land Use Control Master Reference Report (LUCMRR). The Trust would notify the RWQCB of any proposed action that may disrupt the effectiveness of the LUCs, and any proposed action that could alter or eliminate the continued need for LUCs. LUCs may be considered in conjunction with other remedial technologies to enhance effectiveness. LUCs for the soil RUs are only applicable for the Shallow Soil RUs for contamination from 0 to 10 feet bgs, as the cleanup criteria for soil below 10 feet bgs are based on protection of groundwater only.

#### 4.2.5 In Situ Treatment

In situ treatment technologies involve the reduction of the toxicity, mobility, or mass of COCs present in the subsurface. Treatment technologies evaluated in this CAP include bioremediation technologies and sparging and extraction technologies which are described below.

Bioremediation technologies rely on microorganisms to biodegrade the contaminants. Two specific examples are as follows:

- Bioventing stimulates the indigenous microorganisms to biodegrade organic constituents absorbed to soils in the unsaturated zone by increasing the transport of oxygen within the subsurface. Air injection wells can be installed by standard well-drilling methods and can be utilized to pump compressed air into the vadose zone. The increased supply of oxygen (as air) serves to aerate the soil and enhance the rate of naturally occurring aerobic biodegradation. Bioventing uses readily available equipment.
- Bioremediation can be enhanced by the addition of oxygen-releasing products into the subsurface via soil borings. Like bioventing, the increased supply of oxygen serves to accelerate the rate of naturally occurring aerobic contaminant biodegradation. This is typically accomplished by circulating a water-based solution through contaminated soil using a combination of either spray irrigation, or injection wells, groundwater pumping wells, and groundwater reinjection wells. This treatment is applicable only to saturated soil.

Sparging and extraction technologies include SVE. SVE is an in situ remedial technology that reduces concentrations of volatile constituents in petroleum products adsorbed to soils in the unsaturated zone. In this technology, a vacuum is applied through wells near the source of contamination in the soil to induce a controlled flow of air. Volatile constituents in the vapor phase are drawn toward the extraction wells. Extracted vapor is then treated as necessary before being released to the atmosphere. The increased air flow through the subsurface can also stimulate biodegradation of some of the contaminants, especially those that are less volatile, if the soil moisture can be maintained at an adequate level. Wells may be either vertical or horizontal. The target contaminants for SVE include VOCs and some semivolatile organic compounds (SVOCs). It is not effective for heavier hydrocarbons such as TPHd.

# 4.3 Identification of Potential Groundwater Remedial Technologies for Corrective Action

The remediation technologies that are proposed for the groundwater RUs to develop corrective action alternatives are described in the following sub-sections. Table 4-1 provides a summary of potential remedial technologies considered for groundwater.

It is noted that the groundwater cleanup objectives selected for this CAP are drinking water levels (Section 3.2.2). This is in keeping with the RWQCB's Basin Plan and Order No. R2-2003-0080, which

designate municipal and domestic supply as a beneficial use for groundwater within the Marina and Coastal Bluffs Groundwater Basins. However, due to the complex hydrology in the vicinity of the Study Area and technical limitations, including low specific yield of wells in the area, the potential for future groundwater development for supply is extremely low. In consideration of these factors, the groundwater remedial technologies below were evaluated in this CAP to provide a range of cleanup alternatives for groundwater at the Study Area and comply with the California State Water Resources Control Board (SWRCB) Resolution No. R2-49 which specifies that groundwater will be consistent with maximum benefit to the people of the State, not unreasonably affect present and anticipated beneficial uses of such water, and not result in water quality less than that prescribed in local plans and policies.

#### 4.3.1 No Action

For this alternative, groundwater would be left in place and existing groundwater monitoring wells would be abandoned. No additional control or protection of human health and the environment would be implemented for the contamination present. Although conditions favorable for natural degradation of COCs have been identified, this alternative provides no further evidence that these processes are occurring over time and that COC concentrations show stable or decreasing trends. There is negligible cost associated with this alternative.

## 4.3.2 Groundwater Monitoring

For this alternative, groundwater would be monitored over a specified time period to demonstrate if observed concentrations of COCs are decreasing or stabilized, confirm the extent of the groundwater plume, and evaluate the effectiveness of the selected soil remedies. Long-term performance monitoring is a fundamental component of this remedial technology. Under certain conditions, natural subsurface processes such as dilution, dispersion, volatilization, biodegradation of contaminants, adsorption to soil particles, and chemical reactions with subsurface materials reduce contaminant concentrations to acceptable levels. Many contaminants are prevented from migrating off-site because they are adsorbed to soil particles or aquifer materials. Dilution and dispersion do not destroy contaminants, but can significantly reduce their potential risk at many sites. This technology is used widely for petroleum hydrocarbons because the biodegradation of these contaminants is well documented. This technology has also been used for VOCs, SVOCs, arsenic, and pesticides to demonstrate stable or decreasing conditions.

#### 4.3.3 Land Use Controls

Under this alternative, groundwater would remain in place and LUCs would be implemented to restrict use of groundwater in the vicinity of the Study Area. Due to the complex hydrology in the vicinity of the Study Area and technical limitations, including low specific yield of wells in the area, the potential for future groundwater development for supply is extremely low. However, municipal and domestic supply is a beneficial use for groundwater within the Marina and Coastal Bluffs Groundwater Basins, according to the Basin Plan and RWQCB Order No. R2-2003-0080. Thus, an LUC for groundwater would act as an administrative control to restrict development of groundwater for municipal or domestic supply and would be implemented in consultation with the RWQCB.

#### 4.3.4 In Situ Treatment

In situ groundwater treatment technologies involve the reduction of the toxicity, mobility, or mass of COCs present in the groundwater. Treatment technologies evaluated include enhanced bioremediation, air sparging, and chemical oxidation technologies.

Enhanced bioremediation of groundwater involves stimulating the growth of naturally occurring microorganisms in order to promote aerobic degradation of contaminants. This can be done by using products, such as  $ORC^{\circledast}$  (a proprietary formulation of phosphate-intercalated magnesium peroxide that time releases oxygen when hydrated) or hydrogen peroxide, to release oxygen into the groundwater.  $ORC^{\circledast}$  can be applied actively (injecting a slurry, straight powder application in excavation, or mixture of water and powder in excavation) or passively (filter sock placed in wells).

Air sparging is an in situ technology in which air is injected into the water-bearing zone. The compressed air is injected at a relatively high flowrate using specially-designed wells that are screened below the water table. The high flowrate "strips" the contaminants from the groundwater. A vapor extraction system is typically used to remove volatilized contaminants from the unsaturated zone, similar to the process of SVE discussed in Section 4.2.5. The added benefit of air sparging is that it provides additional oxygen to the contaminated groundwater and soil which may enhance aerobic biodegradation.

Chemical oxidation is the process where hazardous contaminants are degraded into non-hazardous or less toxic compounds that are more stable, less mobile, and/or inert. Oxidants have been able to cause the rapid and complete chemical destruction of many toxic organic chemicals. This remedial technology can be implemented for groundwater and saturated soil treatment. Two potential technologies include using peroxide with iron and ozone sparging:

- Oxidation using liquid hydrogen peroxide with the addition of ferrous iron produces Fenton's Reagent which creates free hydroxyl radicals. These nonspecific oxidants can rapidly degrade a variety of organic compounds.
- Ozone sparging is a chemical oxidation system that is applied by injecting ozone gas into the saturated zone, a specific method of application is the Perozone<sup>TM</sup> technology which consists of injecting peroxide-coated ozone micro bubbles into the saturated zone. Ozone serves as a chemical oxidant to degrade contaminants.

## 4.3.5 Extraction and Treatment

Ex situ groundwater treatment technologies treat contaminated groundwater after it is pumped or lifted to the surface. The process includes installation of groundwater wells in the vicinity of groundwater impacts and pumping groundwater to an above ground treatment system. In the treatment system, groundwater is pumped through a series of canisters or columns containing activated carbon to which dissolved organic contaminants adsorb. Periodic replacement or regeneration of spent carbon is required. Limited effectiveness may be achieved on halogenated VOCs and pesticides as these constituents preferentially partition in the adsorbed phase and require the extraction of multiple pore volumes to displace the contaminant.

Ex situ technologies have certain advantages over in situ methods, typically including easier verification sampling, greater process control, and lower unit cost. However, construction and operation of the ex situ groundwater treatment unit can be high profile (visibility, odors) and not cost effective.

# 4.4 Screening of Remedial Technologies

In this section, the remedial technologies discussed in Sections 4.2 and 4.3 are evaluated for effectiveness in each RU. Tables 4-2 through 4-5 provide a detailed evaluation of the effectiveness of each technology for the Shallow Soil RU, Deep Soil RU, Telecommunication Corridor RU, and Groundwater RU. All in situ soil remedial technologies were eliminated due to site-specific limitations, including geology (e.g., soil permeability and subsurface heterogeneity) and COCs.

#### 4.4.1 Shallow Soil RU

Based upon the screening of potential soil remedial technologies against the criteria listed in Section 4.1, No Action, Excavation and Off-site Disposal, Capping, and Land Use Controls have been retained for the Shallow Soil RU (Table 4-2). These technologies are developed as corrective action alternatives and screened in Section 4.5.

Bioventing was not retained as a remedial technology for the Shallow Soil RU due to low effectiveness. The technology can be can be limited by low permeable soil. In addition, uniform remediation would not be achieved in heterogeneous soils. The Shallow Soil RU consists of discrete volumes of contaminated material in silty clay/clayey silt (slope debris and ravine fill and weathered bedrock with evidence of secondary mineralization of fractures) which has low permeability and is heterogeneous. This lithology would likely produce preferential flow paths and thus, soil would not be remediated uniformly.

Enhanced bioremediation was not retained as a remedial technology for the Shallow Soil RU due to low effectiveness. As discussed above with bioventing, Study Area soils are such that the effectiveness of this technology would be limited and the lithology would likely produce preferential flow paths. Preferential flow paths caused by fractures in weathered bedrock or heterogeneity in soil would limit the contact between the injected fluid and contaminant which decreases the effectiveness of the treatment. This technology is also not effective in unsaturated soil.

SVE was also not retained as a remedial technology for the Shallow Soil RU due to low effectiveness. The target contaminants for SVE include VOCs and some SVOCs, but it is not effective for heavier hydrocarbons such as TPHd which is a COC for the Shallow Soil RU. The effectiveness of this technology is limited by soils or shallow bedrock with low permeability, such as those observed in the Study Area. As discussed in earlier sections of this CAP, the Study Area soils are variable, heterogeneous mixtures of sand, silt, clay, and weathered fractured bedrock with secondary remineralization of fractures, typical of slope debris and ravine fill and weathered Franciscan Formation. The Study Area lithology would likely produce preferential paths and thus, would not be remediated uniformly.

# 4.4.2 Deep Soil RU

Based upon the screening of potential soil remedial technologies against the criteria listed in Section 4.1, **No Action, Excavation and Off-site Disposal, and Subsurface Capping** have been retained for the Deep Soil RU (Table 4-3). These technologies are developed as corrective action alternatives and screened in Section 4.5.

Bioventing was not retained as a remedial technology for the Deep Soil RU due to low effectiveness. The technology can be can be limited by low permeable soil. In addition, uniform remediation would not be achieved in heterogeneous soils. The Deep Soil RU consists of discrete volumes of contaminated material in

silty clay/clayey silt (slope debris and ravine fill and weathered bedrock with evidence of secondary mineralization of fractures) which has low permeability and is heterogeneous. This lithology would likely produce preferential flow paths and thus, soil would not be remediated uniformly.

Enhanced bioremediation was not retained as a remedial technology for the Deep Soil RU due to low effectiveness in low permeable soils and bedrock. This technology is also not effective in unsaturated soil.

SVE was also not retained as a remedial technology for the Deep Soil RU due to low effectiveness. The target contaminants for SVE include VOCs and some SVOCs, but it is not effective for heavier hydrocarbons such as TPHd which is a COC for the Deep Soil RU. In addition, the low permeability of soil and bedrock would impede volatilization.

#### 4.4.3 Telecommunications Corridor RU

Based upon the screening of potential soil remedial technologies against the criteria listed in Section 4.1, **No Action, Excavation and Off-site Disposal, Capping, and Land Use Controls** have been retained for the Telecommunications Corridor RU (Table 4-4). These technologies are developed as corrective action alternatives and screened in Section 4.5.

Bioventing was not retained as a remedial technology for the Telecommunications Soil RU due to low effectiveness. The technology can be can be limited by low permeable soil. In addition, uniform remediation would not be achieved in heterogeneous soils. The Telecommunications Soil RU consists of discrete volumes of contaminated material in silty clay/clayey silt (slope debris and ravine fill and weathered bedrock with evidence of secondary mineralization of fractures) which has low permeability and is heterogeneous. This lithology would likely produce preferential flow paths and thus, soil would not be remediated uniformly.

Enhanced bioremediation was not retained as a remedial technology for the Telecommunications Corridor Soil RU due to low effectiveness. As discussed above with bioventing, Study Area soils are such that the effectiveness of this technology would be limited and the lithology would likely produce preferential flow paths. Preferential flow paths caused by fractures in weathered bedrock or heterogeneity in soil would limit the contact between the injected fluid and contaminant which decreases the effectiveness of the treatment. This technology is also not effective in unsaturated soil.

SVE was also not retained as a remedial technology for the Telecommunications Corridor Soil RU due to low effectiveness. The target contaminants for SVE include VOCs and some SVOCs, but it is not effective for heavier hydrocarbons such as TPHd which is a COC for the Telecommunications Corridor Soil RU. In addition, the low permeability of soil and bedrock would impede volatilization.

# 4.4.4 Groundwater RU

Based upon the screening of potential groundwater remedial technologies against the criteria listed in Section 4.1, **No Action, Groundwater Monitoring, and Land Use Controls** have been retained for the Groundwater RU (Table 4-5). These technologies are developed as corrective action alternatives and screened in Section 4.5. In situ groundwater technologies were not retained for the Groundwater RU. For bioremediation, the ability to enhance bioremediation can be limited by the subsurface conditions (heterogeneity, relatively low permeability, etc.). The success of the technology relies on the uniform delivery of the material. As described previously in Section 2.1.2.3, Study Area groundwater occurs within the anisotropic fracture system of the Franciscan

Formation. As such, the delivery of the enhanced bioremediation products would be difficult to control. In addition, these types of bioremediation are used to enhance the availability of oxygen to promote biodegradation of contaminants that degrade aerobically whereas OCPs degrade faster in anaerobic conditions.

Limitations to air sparging include uncontrolled movement of vapors if they are not captured by the SVE system. Like other injection technologies, soil heterogeneity may cause some zones to be unaffected and remain contaminated. In addition, the target contaminants for air sparging would be TPH compounds because it enhances the aerobic environment; however, this technology would not be appropriate for OCPs which degrade faster in anaerobic conditions.

The most important considerations for chemical oxidation include the effectiveness and ability to control reaction of the chemical oxidation reagents with the contaminants of interest and the effective delivery of reagents to the zone to be treated. In order to be an effective remedial treatment, the reagent must come in contact with the contaminant. Chemical oxidation works best when the matrix is homogeneous. Additionally, the oxidant contact with the contaminant is limited by diffusion in relatively low permeable soils and weathered bedrock, and the consumption of oxygen by the contaminants and native organic material. Other limitations of this alternative include handling large quantities of hazardous oxidizing chemicals due to the oxidant demand of the target organic chemicals and the potential for negative effects such as formation of toxic byproducts, production of heat and gas, resolubilization of metals, and reduction of biomass.

Extraction and treatment was also not retained as a viable alternative for the Groundwater RU. Extraction and treatment systems require a minimum groundwater flow rate to be successful and low yielding aquifers would impede the effectiveness of this treatment. As discussed previously, the specific yield of wells impacted by COCs is low, with pumping rates of as little as 0.20 gpm, which cannot be sustained without dewatering the well in less than one hour.

# 4.5 Development and Evaluation of Proposed Corrective Action Alternatives

The following subsections present the development of the site-specific corrective action alternatives for each RU using retained remedial technologies as identified in Section 4.4. In addition, these subsections present the evaluation of each corrective action alternative using the screening criteria presented in Section 4.1. This evaluation is summarized in Table 4-6.

The detailed costs for each alternative are developed in Appendix F. For comparison purposes, costs were developed separately for each alternative for each RU. However, it is noted that the costs for implementation of the recommended alternatives will not necessarily be additive and will be reduced when the alternatives for all Study Area RUs are implemented. For example, if excavation and off-site disposal were selected for more than one soil RU, there would likely only be one mobilization cost, assuming that the corrective actions for the soil RUs would be implemented at the same time.

# 4.5.1 Shallow Soil RU

Four corrective action alternatives were developed and analyzed for the Shallow Soil RU. **No Action, Excavation and Off-site Disposal, Capping, and Land Use Controls** were retained for further evaluation based on their technical effectiveness, implementability, and cost effectiveness as presented in Table 4-6.

No Action Alternative: The objective of the no action alternative is to leave existing shallow soil in place. This alternative provides no additional control or protection to human health or the environment for the petroleum-related impacts that exist at the Study Area leaving existing potential exposure pathways uncontrolled. Therefore, this alternative does not prevent ecological or human exposure to contaminated soil and does not protect against impacts to groundwater. The no action alternative provides no technical effectiveness, since no remedial action is undertaken and COCs would not be reduced, other than reduction of COCs from naturally occurring biodegradation. The no action alternative would not likely obtain approval from regulatory agencies and is therefore, not implementable. The costs for the no action alternative are low (minor administrative costs), however it is not considered cost-effective because it fails to address any site impacts and risks associated with the petroleum releases. The cost for the no action alternative is estimated at \$6,000.

Excavation and Off-site Disposal Alternative: The objective of this alternative is to remove impacted shallow soil down to 10 feet bgs. The excavation and off-site disposal alternative is protective of human health, safety, and the environment, because the shallow soil contamination is removed, thereby eliminating potential human and ecological exposure to contaminants. Shallow soil would be removed to a depth of 10 feet bgs using conventional excavation equipment. Confirmation sampling would be performed on the bottom and sidewalls of the excavation areas. An approximate volume of 810 cubic yards would be removed. Excavated soil would be sampled for waste profiling, then transported off-site to a permitted waste management facility. The resultant excavation would be backfilled with approved fill material and restored with approved vegetation per the VMP (Trust and NPS, 2001). Well 1349MW103 would be abandoned before excavation and a replacement well (1349MW103R) installed after backfilling is complete. This alternative is technically effective and permanent. Contaminated soil is removed within the RU, thereby preventing potential impacts to groundwater by these contaminants. Potential exposure of workers and the public to contaminated materials during excavation and loading for off-site transport would be mitigated by engineering and dust control measures. This alternative is implementable and no significant obstacles have been identified. Additionally, long term O&M would not be required. The capital cost for the excavation and off-site disposal alternative for the Shallow Soil RU is estimated to be \$428,000.

Capping: Three geotechnical caps of approximately 1700, 170, and 250 square feet (sf) would be constructed and placed above the Shallow Soil RU Areas 1, 2, and 3, respectively. Contaminated soil would be left in place at 2 feet bgs and deeper. The caps would be covered with clean fill material and topsoil appropriate for approved revegetation per the VMP (Trust and NPS, 2001). The caps would provide a barrier to infiltration and vertical migration of surface water in order to prevent leaching of contaminants in the Shallow Soil RU into groundwater. Because the contaminated soil is not removed, this alternative includes the development and implementation of LUCs to provide advance notice of site conditions in the event of future ground-disturbing activity, and to restrict future land uses compatible with safeguarding the integrity of the subsurface cap. The addition of the LUC for this alternative makes the technology more effective in order to maintain the integrity of the surface soil and cap. The estimated present worth of this alternative is \$639,000, which includes estimated capital costs of \$271,000 and annual costs of \$19,000.

Land Use Controls: The objective of this alternative is to adopt an LUC for the Shallow Soil RU to restrict disturbance of and exposure to contamination left in-place in shallow soil. The LUC would provide advance notice of site conditions in the event of future ground-disturbing activity and restrict future land uses compatible with safeguarding the integrity of the ground surface. The LUC alternative would maintain existing soil cover over the Shallow Soil RU to isolate the contaminated soil from human and environmental exposure. The contaminated soil with COC concentrations above cleanup levels extends from 2 to 10 feet bgs within the Shallow Soil RU. The LUC alternative would be easily implementable, but would require long-term O&M costs to maintain the LUC. The estimated present worth of this alternative is \$136,000, which includes estimated capital costs of \$20,000 and annual costs of \$6,000.

## 4.5.2 Deep Soil RU

Three corrective action alternatives were developed and analyzed for the Deep Soil RU. **No Action, Excavation and Off-site Disposal, and Subsurface Capping** were retained for further evaluation based on their effectiveness, implementability, and cost-effectiveness as presented in Table 4-6.

No Action Alternative: The objective of the no action alternative is to leave existing deep soil in place. This alternative provides no additional control to prevent potential impacts to groundwater. The no action alternative provides no technical effectiveness, since no remedial action is undertaken and COCs would not be reduced other than reduction from naturally occurring biodegradation. The no action alternative would not likely obtain approval form regulatory agencies and is therefore not implementable. The costs for the no action alternative are low (minor administrative costs), however it is not considered cost-effective because it fails to address any site impacts associated with the petroleum releases. The cost for the no action alternative is estimated at \$6,000.

Excavation and Off-site Disposal Alternative: The objective of this alternative is to remove impacted deep soil below 10 feet bgs. Deep soil would be removed between 10 and 22 feet bgs using conventional excavation equipment. Confirmation sampling would be performed on the bottom and sidewalls of the excavation area. An approximate volume of 30 cubic yards would be removed. Excavated soil would be sampled for waste profiling then transported off-site to a permitted waste management facility. The resultant excavation would be backfilled with approved fill material. Well 1349MW103 would be abandoned before excavation and a replacement well (1349MW103R) installed after backfilling is complete (assumed under the Shallow Soil RU analysis). This alternative is technically effective and permanent. Contaminated soil is removed, thereby preventing potential impacts to groundwater by the removed contaminants. Potential exposure of workers and the public to contaminated materials during excavation and loading for off-site transport would be mitigated by engineering and dust control measures. Additionally, long-term O&M would not be required. It is noted that this alternative may not be implementable based on geotechnical parameters encountered during excavation. Typical equipment may not be able to effectively excavate bedrock that may become more competent with depth. The capital cost for the excavation and off-site disposal alternative for the Deep Soil RU is estimated to be-\$198,000.

**Subsurface Capping**: This alternative would be implemented assuming that the shallow soil was removed as part of the corrective action alternative for the Shallow Soil RU. Once the depth of this shallow soil excavation is reached (10 feet bgs), a geotechnical cap of approximately 250 sf would be constructed and placed above the deep soil RU. The cap would be covered with clean backfill material and topsoil appropriate for approved revegetation per the VMP (Trust and NPS, 2001). The cap would provide a barrier to infiltration and vertical migration of surface water in order to prevent leaching of contaminants in the deep soil RU into groundwater. This alternative includes the development and implementation of an LUC to provide advance notice of site conditions in the event of future ground-disturbing activity to safeguard the integrity of the subsurface cap. The estimated present worth of this alternative is \$471,000, which includes estimated capital costs of \$200,000 and annual costs of \$14,000.

# 4.5.3 Telecommunications Corridor RU

Four corrective action alternatives were developed and analyzed in the Study Area for the Telecommunications Corridor Soil RU. **No Action, Excavation and Off-site Disposal, Capping, and Land Use Controls** were retained for further evaluation based on their effectiveness, implementability, and cost-effectiveness as presented in Table 4-6.

No Action Alternative: The objective of the no action alternative is to leave existing soil in place. This alternative provides no additional control or protection to human health or the environment for the petroleum-related impacts that exist at the Study Area leaving existing potential exposure pathways uncontrolled. Therefore, this alternative does not prevent potential ecological or human exposures to contaminated soil and does not protect against impacts to groundwater. The no action alternative provides no technical effectiveness, since no remedial action is undertaken and COCs would not be reduced except by naturally occurring biodegredation. The no action alternative would not likely obtain approval form regulatory agencies and is therefore not implementable. The costs for the no action alternative are low (minor administrative costs), however it is not considered cost-effective because it fails to address any site impacts and risks associated with the petroleum releases. The estimated cost for this alternative is \$6,000.

Excavation and Off-site Disposal Alternative: The objective of this alternative is to remove impacted soil below the telecommunications conduit. The excavation and off-site disposal alternative is protective of human health, safety, and the environment, because the soil contamination is removed, thereby eliminating potential human and ecological exposure to contaminants. The telecommunication conduit would be rerouted and Washington Boulevard would be closed. Well 1349MW100 would be abandoned before excavation and a replacement well (1349MW100R) installed after backfilling is complete. Soil would be removed to the maximum depth possible using conventional excavation equipment. There would be no access to the excavation because it would not be shored. Confirmation sampling would be performed remotely using an excavator on the bottom and sidewalls of the excavation area. Approximately 570 cubic yards of impacted soil would be removed. Excavated soil would be sampled for waste profiling then transported off-site to a permitted waste management facility. The resultant excavation would be backfilled with approved fill material and restored with approved vegetation per the VMP (Trust and NPS, 2001). This alternative is technically effective and permanent. Contaminated soil would be removed within the RU, thereby preventing potential impacts to groundwater by the excavated contaminants. Potential exposure of workers and the public to contaminated materials during excavation and loading for off-site transport would be mitigated by engineering and dust control measures. Additionally, long term O&M would not be required. It is noted that this alternative may not be implementable based on geotechnical parameters encountered during excavation. Typical equipment may not be able to effectively excavate bedrock that may become more competent with depth. The capital cost for the excavation and off-site disposal alternative for the Telecommunications Corridor Soil RU is estimated to be \$455,000.

Capping: The area would be excavated to a grade of approximately 2-3 feet bgs to accommodate the construction of a geotechnical cap. This excavated material would be stockpiled and sampled for disposal. A geotechnical cap of approximately 650 sf would be constructed and placed above the Telecommunication Soil RU. The cap would be covered with clean backfill material and topsoil appropriate for approved revegetation per the VMP (Trust and NPS, 2001). The cap would provide a barrier to infiltration and vertical migration of surface water in order to prevent leaching of contaminants in the Telecommunications Soil RU into groundwater. It is noted that water which runs through the telecommunications conduit (from the upgradient direction) and leaks through joints in the conduit may provide a source of infiltration. However, the impacts from this infiltration are expected to be minor and the cap would provide a barrier to the majority of surface water infiltration through the RU. Because the contaminated soil is not removed, this alternative includes the development and implementation of LUCs to provide advance notice of site conditions in the event of future ground-disturbing activity, and to restrict future land uses compatible with safeguarding the integrity of the subsurface cap. The addition of the LUC for this alternative makes the technology more effective in order to maintain the integrity of the surface soil and cap. The estimated present worth of this alternative is \$696,000, which includes estimated capital costs of \$328,000 and annual costs of \$19,000.

Land Use Controls Alternative: The objective of this alternative is to adopt an LUC for the Telecommunications Conduit RU to restrict disturbance of and exposure to contamination left in-place in shallow soil. The LUC would provide advance notice of site conditions in the event of future ground-disturbing activity and restrict future land uses compatible with safeguarding the integrity of the ground surface. The LUC alternative would maintain existing soil cover over the Shallow Soil RU to isolate the contaminated soil from human and environmental exposure. The LUC would not be effective for deep soil (below 10 feet bgs) which contains COCs above cleanup levels protective of groundwater resources. The LUC alternative would be easily implementable, but would require long-term O&M costs to maintain the LUC. The estimated present worth of this alternative is \$136,000, which includes estimated capital costs of \$20,000 and annual costs of \$6,000.

#### 4.5.4 Groundwater RU

Three corrective action alternatives were developed and analyzed for the Groundwater RU. **No Action, Groundwater Monitoring, and Land Use Controls** were retained for further evaluation based on their effectiveness, implementability, and cost-effectiveness as presented in Table 4-6.

No Action Alternative: The objective of the no action alternative is to leave existing groundwater in place. This alternative provides no additional control or protection to human health or the environment for the petroleum-related impacts that exist at the Study Area leaving existing potential exposure pathways uncontrolled. Under this alternative, existing groundwater monitoring would cease and Study Area monitoring wells would be abandoned. The no action alternative provides no technical effectiveness, since no remedial action is undertaken and COCs would not be reduced other than by naturally occurring degradation. Although conditions favorable for natural degradation of COCs have been identified, this alternative provides no further evidence that these processes are occurring over time and that COC concentrations show stable or decreasing trends. The no action alternative would not likely obtain approval from regulatory agencies and is therefore not implementable. The no action alternative also does not comply with the RWQCB Basin Plan, RWQCB Order No. R2-2003-0080, and SWRCB Resolution 92-49. The costs for the no action alternative are low (minor administrative costs and costs for abandonment of wells), however it is not considered cost-effective because it fails to address any site impacts and risks associated with the petroleum releases. The estimated cost for this alternative is \$38,000.

Groundwater Monitoring Alternative: The objective of groundwater monitoring would be to effectively demonstrate if observed concentrations of TPHg and TPHd, VOCs, PAHs, and OCPs are decreasing or stabilized at well 1349MW100, demonstrate if the groundwater plume is limited to the area around well 1349MW100, and if the selected soil remedies have a positive effect on the dissolved-phase concentrations. Groundwater monitoring is a practicable alternative for localized groundwater impacts that are nominally above the cleanup levels for constituents of concern, sufficiently isolated from potential receptors, and/or expected to attenuate over time due to natural physical, chemical and biological processes. It is likely that site-wide aerobic conditions are present to assess the viability of various remediation technologies at the Study Area. Based on the results of the physical and biological tests conducted as part of the 1995 SI (Montgomery Watson, 1995a), the SI concluded that there are adequate naturally occurring microorganisms based on total plate counts and that neither nitrogen nor phosphorous would be limiting factors for microorganism growth. Reducing conditions are present in the vicinity of 1349MW100, as demonstrated by the low dissolved oxygen, high dissolved iron, and low sulfate (Section 2.1.2.2) which are favorable for OCP reduction. Groundwater monitoring would demonstrate whether groundwater COCs are decreasing in concentration and the impacted area is localized. In order to monitor naturally occurring degradation, sampling parameters would include groundwater COCs and dissolved metals, as well as general chemistry parameters including alkalinity, chloride, nitrate, nitrite, sulfate, sulfite, and dissolved gases. This alternative also recommends the installation of two additional groundwater

wells, 1349MW106 and 1349MW107, located approximately to the north and west of well 1349MW100, respectively, to monitor TPH, PAH, and OCP concentrations, as well as better define apparent groundwater flow direction in the vicinity of the groundwater basin divide. This alternative can also be implemented to monitor the effectiveness of the alternatives for soil RUs. Under this alternative, groundwater would be sampled on a quarterly basis for a period of up to five years to show that the groundwater impacts are adequately assessed, remain localized (around 1349MW100), and moving towards the cleanup goals of remediation. This alternative also includes implementation of an LUC to restrict use of groundwater within the Study Area as a drinking water or municipal water supply during the period of groundwater monitoring. The LUC would be rescinded when cleanup goals are achieved. This alternative is in compliance with the RWQCB Basin Plan, RWQCB Order No. R2-2003-0080, and SWRCB Resolution 92-49. The estimated present worth of this alternative is \$363,000 which includes estimated capital costs of \$73,000 and annual costs ranging from \$6,000 to \$110,000.

Land Use Controls Alternative: The objective of the LUC alternative is to restrict the use of groundwater in the vicinity of well 1349MW100. This alternative would be effective in preventing exposure to contaminated groundwater. Also, due to the complex hydrology in the vicinity of the Study Area and technical limitations, including low specific yield of wells in the area, the potential for future groundwater development for supply is extremely low. This alternative is also easily implementable, but would require long-term O&M costs to maintain the LUC restriction on groundwater use. However, this alternative is not in compliance with the beneficial use designation for the groundwater basin as a municipal and domestic supply per the RWQCB Basin Plan, RWQCB Order No. R2-2003-0080, and SWRCB Resolution 92-49. The estimated present worth of this alternative is \$136,000, which includes estimated capital costs of \$20,000 and annual costs of \$6,000.

#### 4.6 Recommended Corrective Actions

The recommended corrective action alternatives for each RU are summarized below. Detailed descriptions of the recommended alternatives are provided in Sections 5.2 for the soil RUs and Section 5.3 for the Groundwater RU.

As noted earlier, the costs provided above were developed in Appendix F separately for each alternative for each RU so that comparisons could be made in this CAP. Table F-7 provides an estimate of total costs for the preferred corrective actions for all Soil RUs, assuming that they are implemented at the same time. The total estimated capital cost for the recommended corrective actions for the Soil RUs, as discussed below, is \$737,000. Together with the Groundwater Monitoring remedy for the Groundwater RU, the total estimated cost for the preferred corrective action for the Study Area is-\$1,190,000, which includes estimated capital costs of \$810,000 and annual costs ranging from \$6,000 to \$110,000.

### 4.6.1 Shallow Soil RU

The recommended alternative for the Shallow Soil RU is the Excavation and Off-site Disposal Alternative.

Under the recommended alternative, well 1349MW103 will be abandoned and soil contaminated with petroleum products at concentrations above the cleanup levels will be excavated to up to 10 feet bgs. Excavated soil will be sampled for waste characterization parameters then transported and disposed of at an off-site permitted waste management facility. The excavation activities will continue until soil confirmation sampling results indicate that cleanup levels for the soil COCs specified in Table 3-1 are met according to the soil confirmation sampling program detailed in Section 5.2. The excavation will be backfilled with clean fill and covered with appropriate topsoil and vegetation in accordance with the VMP (Trust and NPS, 2001). A replacement well

(1349MW103R) will also be installed. It is noted that if contamination extends deeper than 10 feet bgs, it will be addressed as part of the preferred alternative for the Deep Soil RU (Section 4.6.2).

# 4.6.2 Deep Soil RU

The recommended alternative for the Deep Soil RU is the Excavation and Off-site Disposal Alternative.

Under the recommended alternative, soil contaminated with petroleum products at concentrations above the cleanup levels will be excavated between 10 and 22 feet bgs, or as deep as possible to remove all impacted soil with conventional equipment. Excavated soil will be sampled for waste characterization parameters then transported and disposed of at an off-site permitted waste management facility. The excavation activities will continue until soil confirmation sampling results indicate that cleanup levels for the soil COCs specified in Table 3-1 are met according to the soil confirmation sampling program detailed in Section 5.2. The excavation will be backfilled with clean fill and covered with appropriate topsoil and vegetation in accordance with the VMP (Trust and NPS, 2001). It is noted that abandonment and replacement of well 1349MW103 will be conducted under the preferred alternative for the Shallow Soil RU.

It is noted that if bedrock conditions preclude excavation of all impacted soil within the Deep Soil RU, the contamination will be left in-place and groundwater monitoring will be conducted to confirm that groundwater is not impacted by soil COCs (evaluated under the Groundwater RU). Current and historical groundwater data from well 1349MW103 demonstrate that soil has not impacted groundwater in the area.

#### 4.6.3 Telecommunications Corridor Soil RU

The recommended alternative for the Telecommunications Corridor Soil RU is the Excavation and Off-site Disposal Alternative.

Under the recommended alternative, the telecommunications conduit will be temporarily rerouted and soil contaminated with petroleum products at concentrations above the cleanup levels will be excavated to the maximum depth possible with conventional equipment (assumed to be approximately 16 feet bgs). Excavated soil will be sampled for waste characterization parameters then transported and disposed of at an off-site permitted waste management facility. The excavation activities will continue until soil confirmation sampling results indicate that cleanup levels for the soil COCs specified in Table 3-1 are met according to the soil confirmation sampling program detailed in Section 5.2. The excavation will be backfilled with clean fill and covered with appropriate topsoil and vegetation in accordance with the VMP (Trust and NPS, 2001).

Monitoring well 1349MW100 may need to be abandoned to accommodate excavation activities. Although not located within the limits of the RU as shown on Figure 3-1, excavation sidewall sloping and over-excavation may be required to access deeper impacted soils within the RU. It is recognized that well 1349MW100 is located within an area that has been previously excavated and subsequently backfilled with clean sand and controlled density fill. While the controlled density fill may provide some inherent slope stability during excavation activities, the thickness of the controlled density fill increases to the west of the RU, as shown on Figures 3-1 and 2-6). Due to excavation depths required at this RU, sloughing of fill and native materials underlying the controlled density fill may jeopardize the integrity of well 1349MW100. In addition, staging of excavation equipment is more feasible on Washington Boulevard due to the natural slope that occurs to the west of the telecommunications conduit that could impede the safe operation of heavy equipment. Although protective measures will be taken, the integrity of well 1349MW100 may be compromised due to heavy

equipment traffic. If well 1349MW100 requires abandonment, replacement well 1349MW100R will be installed. As a conservative measure, this worst-case scenario was assumed for further discussion and included for cost estimating purposes.

It is noted that if bedrock conditions preclude excavation of all impacted soil within the Telecommunications Corridor Soil RU (i.e. unable to excavate relatively more competent bedrock), the contamination will be left in-place and groundwater monitoring will be conducted to address impacts in the vicinity of well 1349MW100 (evaluated under the Groundwater RU).

#### 4.6.4 Groundwater RU

The recommended alternative for the Groundwater RU is the Groundwater Monitoring Alternative.

Groundwater monitoring will effectively demonstrate if observed concentrations of TPHg and TPHd, VOCs, PAHs, OCPs, and arsenic, as well as other metals, are decreasing or stabilized at well 1349MW100. Groundwater Monitoring will also adequately demonstrate if the groundwater plume is limited to the area around well 1349MW100 and if the selected soil remedies have a positive effect on the dissolved-phase concentrations.

To monitor groundwater quality in the vicinity of the Groundwater RU, the following wells (shown on Figure 5-2) will be monitored for a period of up to 5 years:

- Existing wells: 1349MW01, 1349MW02, 1349MW03R, 1349MW101, 1349MW102, 1349MW104, 1349MW105; and
- New wells: 1349MW100R (replacement for well 1349MW100, if decommissioned), 1349MW103R (replacement for well 1349MW103, 1349MW106 (new well north of 1349MW100R), and 1349MW107 (new well west of 1349MW100R).

Well 1349MW100 may be removed and well 1349MW103 will be removed during excavations but will be reinstalled at the same locations following soil excavation activities. Monitoring of replacement wells 1349MW100R and -103R will commence following backfilling and site restoration.

In addition to the two replacement wells, two additional wells will be installed at new locations: 1) well 1349MW106, north of existing well 1349MW100 in the immediate vicinity of the former fuel dispensing station and 2) well 1349MW107, west of Washington Boulevard, adjacent to the current well 1349MW100 location (Figure 5-2). Recognizing that groundwater flow is anisotropic, the selection of these two monitoring locations will allow for a better understanding of the complex hydrogeologic conditions that exist at the Study Area and provide verification that groundwater flow in this location is to the west/southwest. The placement of the new wells will also better define the nature and extent of COCs identified at well 1349MW100, as well as the potential relationship with the sporadic detections of OCPs in samples collected from wells located to the west of well 1349MW100.

This alternative also includes implementation of an LUC to restrict use of groundwater within the Study Area as a drinking water or municipal water supply until achievement of cleanup goals can be demonstrated.

The Five-Year Status Report, which is required under the RWQCB Order No. R2-2003-0080, will demonstrate the effectiveness of the remedy. This is further discussed in Section 5.3.

# 5. Implementation of the Preferred Alternatives

This section discusses how the preferred CAP remedies will be implemented including confirmation sampling and groundwater monitoring, LUCs, LTTD soil tracking and management, FDS closure, applicable laws and regulatory requirements, and schedule. Figure 5-1 provides the targeted excavation areas for the Shallow Soil (Areas 1-3), Deep Soil, and Telecommunications Corridor RUs. Figure 3-1 provides the locations of those samples with concentrations of COCs in excess of the cleanup levels. In most cases, the vertical and horizontal extents of the various RUs have been estimated based on the spatial distribution of available data, indicating locations of samples where exceedances of the soil cleanup levels had or had not been observed, as discussed in Section 3.3. The limits of some RUs, however, are not well defined with sample data. Implementation of the preferred remedy for each RU will effectively address these data gaps (i.e. post-excavation soil confirmation sampling to define the extents of the soil RUs and groundwater monitoring to address extent of groundwater impacts).

# 5.1 Remedy Implementation

The corrective actions set forth in Section 4.6.1 for the Shallow Soil RU, Section 4.6.2 for the Deep Soil RU, Section 4.6.3 for the Telecommunications Corridor RU, and Section 4.6.4 for the Groundwater RU will be implemented by the Trust. Upon regulatory agency approval of the Final CAP, a separate implementation Work Plan (called CAP Work Plan) will be prepared for the soil RUs (i.e., Shallow, Deep, and Telecommunications Corridor). Implementation of the Groundwater RU will be made through any necessary modifications to the existing Presidio-Wide Groundwater Monitoring Program specific to the Study Area. In addition, in accordance with the Trust LUCMRR for Area B, the Trust will prepare appropriate documentation for LUCs, as applicable, for any contamination left in-place at the Study Area at concentrations exceeding cleanup levels based on protection of human health or ecological receptors.

# 5.2 Soil Confirmation Sampling Program

The confirmation soil sampling program for the soil RUs will be detailed in the CAP Work Plan. It is anticipated that after the impacted materials are removed from each excavation, the exposed land surface will consist of an excavation "bottom" with the perimeter of the excavation having "sidewalls." The collection and analysis of confirmation soil samples will determine if the preferred remedy has been effective (i.e., soils in excess of the cleanup levels have been removed).

Bottom sampling will be based on the estimated size of the excavation, with a minimum of one bottom sample per excavation and at least one per 625 sf. A 25- by 25-foot sampling grid will be used to guide the collection of excavation bottom samples.

Each sidewall will be sampled every 50 feet of its lateral extent. At a minimum, one sidewall sample for each excavation sidewall will be collected (assuming four sidewalls per excavation). The initial vertical depth intervals targeted for sidewall sampling were evaluated and selected separately for each soil RU, as follows:

• Shallow Soil RU - Area 1: Area 1 encompasses the Former FDS Remedial Excavation areas. In the southern half of Area 1, the COC impacts extend from approximately 2 to 7 feet bgs. In the northern half of Area 1, the COC impacts extend from approximately 2.5 to 9 feet bgs (and to 20 feet bgs in the vicinity of boring 1349SB127 [Deep Soil RU]). Thus, initial excavation within Area 1 will proceed to a

minimum of 7 feet bgs in the southern portion of the RU and to 9 feet bgs in the northern portion of the RU. For every 50 feet of sidewall, the following samples will be collected:

- o One sample at midpoint of 0 to 3 feet bgs interval;
- One sample at midpoint of 3 to 8 feet bgs interval (for excavations up to 8 feet bgs); and
- Two samples at 1/3 and 2/3 vertical intervals of the 3 to 10 feet bgs interval (for excavations deeper than 8 feet bgs).
- Shallow Soil RU Area 2: Area 2 encompasses two small areas along the northern end of the former FDS pipeline. The vertical extent of the COC exceedances in Area 2 is estimated to be approximately 3 feet bgs, because only the trench backfill material is suspected of containing COCs above the cleanup levels. For every 50 feet of sidewall, the following sample will be collected:
  - One sample at midpoint of 0 to 3 feet bgs interval.
- Shallow Soil RU Area 3: Area 3 includes residual soil contamination that was left in-place underneath the previous AST removal excavation. COC impacts in Area 3 are estimated to extend from approximately 5 to 10 feet bgs. Clean backfill soils are present in this area over the impacted soils. For every 50 feet of sidewall, the following samples will be collected:
  - o One sample at midpoint of 0 to 3 feet bgs interval; and
  - One sample at midpoint of 5 to 10 feet bgs interval. Because contamination is expected to be concentrated in this 5-foot depth interval (from 5 to 10 feet bgs) and is covered by clean soils, one sidewall sample collected from this interval would target the area of greatest contamination.
- Deep Soil RU: The Deep Soil RU consists of soil within a small area (around boring 1349SB127) at depths greater than 10 feet bgs. The vertical extent of this RU is assumed to be approximately 22 feet bgs, which is greater than 5 feet above groundwater. For every 50 feet of sidewall, the following sample will be collected:
  - One sample at midpoint of >10 feet bgs and bottom of excavation.
- Telecommunications Corridor RU: The telecommunications soil RU is a wedge-shaped mass of impacted soil beneath the telecommunications line adjacent to Washington Boulevard. The purpose of excavation in this area is to remove the impacted soil left in place below the conduit. The vertical extent of this RU is assumed to extend deeper than 12 feet bgs, which is the maximum depth of the previous soil excavations in the area. Sidewall samples collected from between 0 and 10 feet bgs from this narrow excavation are not expected to show cleanup level exceedances because the area surrounding the conduit has been backfilled with clean soils to approximately 12 feet bgs. For every 50 feet of sidewall, the following samples will be collected:
  - One sample at midpoint of 0 to 3 feet bgs interval;
  - One sample at midpoint of 3 to 10 feet bgs interval;
  - o One sample at midpoint of >10 feet bgs and >5 feet above groundwater interval; and
  - o One sample at midpoint of 5-foot interval above groundwater.

The actual physical dimensions of each excavation will determine the number of bottom and sidewall samples collected. Additional sidewall or bottom samples may be collected if field observations indicate the presence of soil staining or other evidence of residual COC impacts (e.g., elevated PID readings). All confirmation samples for the excavations within the Study Area will be analyzed for the following COC constituents:

- PAHs by United States Environmental Protection Agency (USEPA) Method 8270C; and
- TPHg, TPHd and/or TPHfo by USEPA Method 8015 modified and USEPA Method 3630A Silica Gel Cleanup.

Soil confirmation samples from all soil RUs will be analyzed for OCPs by USEPA Method 8081 because these constituents are COCs for the groundwater RU but have not been previously tested in soil at the Study Area. In addition, as described in Section 3.2.3, metals are believed to be naturally-occurring. To confirm this, metals will be analyzed in all confirmation soil samples by USEPA Method 6000/7000 series.

As detailed in Table 3-1, depth-specific cleanup levels (i.e., 0 to 3 feet bgs, 3 to 10 feet bgs, and greater than 10 feet bgs and within or not within 5 feet of groundwater) will be used for soil excavations within the Study Area. The soil confirmation data will be compared with the cleanup levels in Table 3-1 to assess if further excavation is necessary. If all concentrations are below the cleanup levels, the excavation activities will be terminated. If a particular confirmation sample has one or more chemical concentrations from the analytical suite exceeding soil cleanup level(s), the contamination will be assessed, based on field observations (e.g., visual contamination, odors, etc.), to determine if it is related to a site-specific release. If the contamination appears to be related to a site-specific release, further soil will be excavated in the area where levels remain elevated and the newly excavated area will be resampled. If the contamination does not appear to be related to a site-specific release, either:

- Further soil will be excavated in the area where levels remain elevated and the newly excavated area will be re-sampled; or
- No further excavation will be conducted if it can be demonstrated that the residual contamination does not pose a risk to human health or the environment (based on a 95% UCL concentration).

Any over-excavations will continue vertically and/or laterally in 1.0-ft increments. The RWQCB will be consulted regarding further excavation decisions. When it is determined that a soil RU no longer poses a risk to human health or the environment and RWQCB concurs with the assessment, the excavation will be considered complete. If cleanup levels cannot be achieved due to technical considerations (such as the inability to effectively excavate weathered bedrock), the soil removal program will be terminated and LUC(s) will be adopted, as necessary, in accordance with Section 5.4 below.

# 5.3 Groundwater Monitoring Program

The recommended remedial alternative for the Groundwater RU is Groundwater Monitoring. Groundwater monitoring will effectively determine if observed concentrations of TPHg and TPHd, VOCs, PAHs, and OCPs are decreasing or stabilized at well 1349MW100. Groundwater Monitoring will also effectively demonstrate if the groundwater plume is limited to the area around well 1349MW100. An additional component of this alternative is implementation of an LUC to restrict use of groundwater in the area for drinking water or municipal supply purposes (see Section 5.4).

To monitor groundwater quality in the vicinity of the Groundwater RU, the following wells will be monitored (Figure 5-2):

- Existing wells: 1349MW01, 1349MW02, 1349MW03R, 1349MW101, 1349MW102, 1349MW104, 1349MW105; and
- New wells: 1349MW100R (replacement for well 1349MW100, if decommissioned), 1349MW103R (replacement for well 1349MW103, 1349MW106 (new well north of 1349MW100R), and 1349MW107 (new well west of 1349MW100R).

Well 1349MW100 may be removed and well 1349MW103 will be removed during excavations but replacement wells 1349MW100R and -103R will be re-installed in the same locations following soil excavation activities. Monitoring of replacement wells 1349MW100R and -103R will commence following backfilling and site restoration.

In addition to the two replacement wells, two additional wells will be installed at new locations: 1) 1349MW06, north of existing well 1349MW100 in the immediate vicinity of the former fuel dispensing station and 2) 1349MW107, west of Washington Boulevard, adjacent to the current well 1349MW100 location (Figure 5-2). Recognizing that groundwater flow is anisotropic, the selection of these two monitoring locations will allow for a better understanding of the complex hydrogeologic conditions that exist at the Study Area and provide verification that groundwater flow in this location is to the west/southwest, as well as better evaluate and define apparent groundwater flow directions in the vicinity of the groundwater basin divide. The placement of the new wells will also better define the nature and extent of COCs identified at well 1349MW100, as well as the potential relationship with the sporadic detections of OCPs in samples collected from wells located to the west of well 1349MW100.

Groundwater monitoring will be conducted for a period of up to 5 years. The depth to groundwater will be measured and groundwater elevations calculated during each sampling event. Groundwater samples, including quality assurance/quality control (QA/QC) samples (duplicates, equipment blanks, and trip blanks), will be collected and analyzed, in accordance with the QAPP (Tetra Tech, 2001) and as provided by Table 5-2 for the following analytes:

- PAHs by USEPA Method 8270C;
- TPHg, TPHd and/or TPHfo by USEPA Method 8015 modified;
- VOCs by USEPA Method 8260B;
- OCPs by USEPA Method 8081;
- Dissolved metals by USEPA Method 6010;
- General chemistry parameters: alkalinity (total), bicarbonate, carbonate, chloride, fluoride, nitrate as N, nitrite as N, and sulfate (by various analytical methods);
- Sulfide (EPA 376.2/SW9030);
- Total dissolved solids (EPA 160.1);

- TOC (SW 9060); and
- Field parameters including DO, specific conductance, temperature, turbidity, and pH.

The groundwater cleanup levels for these constituents are presented in Table 3-2. Groundwater will be analyzed quarterly for a minimum of one year for all constituents identified above. If all constituents within an analytical suite have concentrations below cleanup levels for four consecutive quarterly sampling events sitewide, then the frequency of monitoring for the analytical suite will be reduced to a semi-annual basis. If after two years of semi-annual sampling, all constituents within the analytical suite have concentrations below cleanup levels sitewide, the analytical suite will no longer be analyzed in groundwater samples. Similarly, if all analyzed constituents at an individual well have concentrations below cleanup levels for four consecutive quarterly sampling events, then the frequency of monitoring for the well will be reduced to a semi-annual basis. If after two years of semi-annual sampling of the well all constituents within the well have concentrations below cleanup levels, the well will no longer be sampled. If all analytical suites and groundwater wells meet these criteria on a sitewide basis within a 5-year monitoring period, the groundwater monitoring program will be discontinued and the wells will be considered for abandonment at that time. The monitoring frequency described in this paragraph will be reviewed by the Trust on an ongoing basis and the Trust may request adjustments to this sampling program, subject to RWQCB approval.

In accordance with Task 13 of RWQCB Order R2-2003-0080, a Five-Year Status Report, which evaluates the effectiveness of this CAP for groundwater, will be completed and submitted to the RWQCB for approval. In the Five-Year Status Report, groundwater conditions within the Study Area will be evaluated and future corrective actions will be assessed based on the following general criteria:

- If cleanup levels for all analyzed constituents are achieved within the 5-year monitoring period as
  described above, the groundwater monitoring program will be discontinued and the LUC will be
  rescinded;
- If it is demonstrated that constituent concentrations are moving towards cleanup levels (i.e., showing a consistent decreasing trend) within a reasonable time period, the groundwater monitoring program will either be discontinued or continued for a specified time period to confirm attainment of cleanup levels and the LUC will be maintained, as appropriate;
- If constituent concentration(s) are above cleanup levels but have remained generally stable (i.e., no increasing trend) and the groundwater impacts are shown to be localized around well 1349MW100, the groundwater monitoring program will either be discontinued or continued for a specified time period to confirm that constituent concentration(s) are stable and the LUC restricting use of groundwater in the area will be maintained, as appropriate. These decisions will be made based on an updated evaluation of groundwater data, cost-effectiveness, current remedial technologies, probability of potential groundwater development, etc. as required by Task 13 of the Order; and
- If constituent concentrations(s) are above cleanup levels and not generally stable (i.e., increasing trend) or a larger groundwater plume (beyond the general vicinity of well 1349MW100) is identified, an alternative cleanup strategy for the Groundwater RU will be evaluated and the LUC will be maintained.

It is noted that metals data in groundwater, including total chromium, arsenic, and nickel, will be evaluated in the context of cleanup levels, but also to evaluate geochemical conditions at the Study Area. As discussed in Appendix E and Section 2.5.2, dissolved metals concentrations in groundwater above cleanup levels are considered to be related to the geochemical environment of the Study Area. The presence of dissolved metals is

related to the complex geochemical interactions that occur as a result of naturally occurring conditions and those conditions affected by the degradation of petroleum hydrocarbons. As discussed in Appendix E, the fate and transport of observed dissolved metals concentrations are limited under worst case conditions and are expected to be even more limited as degradation of petroleum hydrocarbons becomes complete. The Five-Year Status Report will evaluate current geochemical conditions and trends to assess if metals concentrations above cleanup levels in groundwater can remain with no further action. In addition, the evaluation of dissolved metals data as well as general chemistry parameters will help determine if observed existing natural degradation processes continue to occur over time which will further demonstrate the effectiveness of the preferred alternative.

#### 5.4 Land Use Controls

As discussed in Section 5.2, the preferred remedy for all soil remedial units is excavation and off-site disposal. However, it is possible that soil with constituent concentrations exceeding cleanup levels may be left in-place following soil removal due to technical limitations (such as the inability to effectively excavate weathered bedrock). This is particularly likely for the Deep Soil RU and the Telecommunications RU, which contain deep soil (below 10 feet bgs) with chemical concentrations exceeding cleanup levels. LUC(s) may need to be adopted for contamination left in-place, depending on whether the contamination falls within the 0 to 10 feet bgs or greater than 10 feet bgs depth intervals.

The cleanup criteria for soils below 10 feet bgs were selected based on protection of groundwater. If soils with constituent concentrations are left in-place below 10 feet bgs, no LUCs will be adopted as there is no exposure for humans and ecological receptors at this depth interval.

If soils with constituent concentrations are left in-place following soil excavations within the 0 to 10 feet bgs depth interval, LUC(s) will be adopted to protect human health and the environment. The LUC is a non-engineering measure designed to limit exposure to the contaminants left in place in soil above levels considered protective for specific use(s) of a site. The LUC prohibits specific use(s) of a site and notifies present or future owners and tenants at the site of the potential presence of contaminants remaining in soil at concentrations that may not be protective of unrestricted future site use. The LUC requirements and restrictions are binding on current or subsequent property owners and remain in effect until they are formally removed or modified.

Residential human health and ecological special-status cleanup levels were selected as cleanup criteria in soil from 0 to 10 feet bgs and 0 to 3 feet bgs, respectively, to allow unrestricted future site use. Therefore, although current and planned land use at the Building 1349 Area is recreational with special-status ecological species potentially present (EKI, 2002), non-attainment of cleanup levels provided in this CAP will require LUCs to restrict unlimited site use.

As detailed in Section 5.3, groundwater monitoring will be conducted at the Study Area to address potential impacts to groundwater. In addition, an LUC will be adopted for groundwater at the Study Area during implementation of the Groundwater Monitoring alternative to prohibit use of groundwater as a drinking water or municipal water supply until cleanup levels are attained.

The goals of the soil and/or groundwater LUC(s) are as follows:

- Prevent inappropriate land use of the property containing residual contamination in soil or groundwater;
- Assure that information about the property containing residual contamination in soil or groundwater is available to the public (via the LUCMRR);

- Ensure that long-term mitigation measures and monitoring requirements are carried out and maintained (as described below);
- Ensure that the integrity and stability of the remedy is maintained;
- Ensure that subsequent property owners or transferees have a duty to assume any responsibility for requirements or restrictions pertaining to the residual contamination in soil or groundwater when the property is transferred; and
- Ensure that the RWQCB would be contacted prior to a change in land use or the selected remedy.

The procedures below, if applicable, will be followed to ensure that the specified LUC(s) for the Study Area are adhered to by present and future owners and users of the property:

- Project Permit Process In advance of implementation, all Presidio plans and projects must be screened for compliance with the National Environmental Policy Act (NEPA) and the National Historic Preservation Act (NHPA). The Trust will use its interdisciplinary NEPA/NHPA environmental screening process to notify planning/project proponents of the LUC. In addition, for any project involving excavation or subsurface intrusion within an "LUC Zone," the Trust must approve a "dig permit" to ensure that subsurface utilities (e.g., water, gas, sewer, fiber optic) are not damaged. The Trust would also use its Excavation Clearance Permit process to notify and require adherence by excavation project proponents of the LUC restrictions and requirements.
- LUC Master Reference Report The LUC Zone(s) at the Study Area will be included in the Trust's LUCMRR. The LUCMRR, which includes a master map showing all Presidio-wide LUC Zones and a compilation of all Presidio LUC requirements and restrictions, is maintained and kept current at the Trust Library. Planning/project proponents and other members of the public may review all existing LUCs for the Presidio by reviewing the LUCMRR in the Trust Library.
- Notification and Annual Monitoring The Trust will notify the RWQCB regarding any proposed land use plan or project that may be inconsistent with the LUC, any proposed action that may disrupt the effectiveness of the LUC, and any proposed action that could alter or eliminate the continued need for the LUC. The Trust submits an annual Presidio LUC Report to confirm that human land uses within Presidio LUCs Zones are consistent with the restrictions and requirements specified herein.
- Transfer of Ownership or Control The Trust will notify the RWQCB of any anticipated transfer of ownership or control of any portion of the LUC Zone(s) for the Study Area. In the event of a transfer of ownership or control of an LUC Zone, in whole or in part, the Trust will record the Presidio's LUCMRR with the City and County of San Francisco Recorder's Office and the Federal General Services Agency (GSA) to place subsequent Presidio owners or managers on notice of the existence of the LUC Zone(s). As part of the administrative transfer of the property, the Trust will notify the subsequent owner or manager of the duty to comply with the LUC and provide a complete copy of the LUCMRR.

# 5.5 LTTD Soil Tracking and Management

LTTD soils previously used as backfill within the FDS trench and remedial excavations (Figure 5-1) will be managed and tracked in accordance with the LTTD Soil Tracking and Management Plan (EKI, 2004). LTTD

soils are expected to be encountered and removed during excavation of the Shallow Soil RU Area 1. Notification for the presence of LTTD soils will be addressed in the Trust's "dig permit" prior to excavation activities. If the LTTD soils are stockpiled onsite, they will be segregated and stockpiled separately from non-LTTD soil. The LTTD soils will be disposed off-site at a permitted treatment and/or disposal facility in accordance with applicable laws and regulations. Tracking and management of the LTTD soils by the Trust will no longer be applicable once the soils are removed and disposed off-site.

LTTD soils also extend beyond the assumed limits for Shallow Soil RU Area 1 (Figure 5-1). The Trust may opt to either excavate these LTTD soils as part of the CAP excavations to eliminate the necessity of tracking the soils or leave the LTTD soils in-place. No sampling will be required to leave these LTTD soils in-place, as previous sampling has indicated that TPH and PAH concentrations meet the SCRs from Order No. R2-2003-0080 (RWQCB, 2003a; Section 2.4.3). Soils remaining in-place will be retained in the Trust's geographical information system (GIS) database for tracking of LTTD soils. Appropriate personnel will be notified prior to any future construction, maintenance, or other subsurface operations conducted in the area so that restrictions and requirements for the LTTD soils identified in the LTTD Soil Tracking and Management Plan (EKI, 2004), such as restrictions on removal, relocation, and reuse, are followed.

#### 5.6 Closure of FDS

Upon completion of the corrective actions selected in this CAP for the Study Area, the portions of the former FDS pipelines within the Study Area will be considered closed in accordance with RWQCB Order R2-2003-0080 (RWQCB, 2003a). The portions of the FDS pipelines within the Study Area extend from the general vicinity of the former AST northwards to Kobbe Avenue, eastwards to Harrison Boulevard, and southwards to the limits of the former Fill Site 5. Per Task 12 of the RWQCB Order, the CAP Closure Report will include confirmation soil sampling results for the former FDS pipeline trenches and excavations to demonstrate compliance with the cleanup levels specified in Table 3-1 of this CAP.

# 5.7 Applicable State and Federal Laws and Regulatory Requirements

Implementation of the selected corrective action alternatives will comply with applicable state and federal laws and regulations including the requirements of Title 23, Division 3, Chapter 16, Article 11, which are the primary regulations establishing the requirements and standards for petroleum-related corrective action in the State of California. The alternatives selected by this CAP will also comply with applicable laws and regulations regarding management and disposal of excavated soil, including transport to and treatment at regulated and permitted facilities. As detailed in the RWQCB Order No. R2-2003-0080, the Study Area is a known petroleum contamination site requiring preparation and implementation of this CAP to meet the requirements of 23 CCR § 2725. The RWQCB Order No. R2-2003-0080 presents cleanup standards as SCRs for the protection of human health, ecological receptors, and water quality, which were used to set the applicable CAP cleanup levels.

The Presidio as a whole is within the GGNRA and is listed in the National Register of Historic Places as a Historic Landmark, which affords its historic resources and cultural landscapes certain protection under the NHPA. The Trust Programmatic Agreement, which sets forth the procedures to implement the historic compliance process of Section 106 of the NHPA for Area B, will be followed. In addition, archeological sites and resources are known to exist or may be discovered within the Presidio. During corrective action implementation, the Trust will comply with applicable provisions of the Archeological and Historic Preservation Act (AHPA) and the Native American Graves Protection and Repatriation Act (NAGPRA) if such resources are encountered during implementation work concerning this CAP. Other federal and state statutes, such as the

federal and state Endangered Species Acts (ESA and CESA) and the Migratory Bird Treaty Act (MBTA) also provide standards for protection of natural resources found on the Presidio that will be followed during this corrective action.

Since the Study Area is within Area B of the Presidio, the corrective action will be completed in a manner consistent with land uses established by the PTMP. NPS Management Policies and the Presidio VMP (Trust and NPS, 2001) apply to the corrective action work.

With regard to soil excavation and disposal, state laws and regulations implement the federal Resource Conservation and Recovery Act (RCRA) standards and are applicable to the corrective actions at the Study Area. These provisions include standards for properly storing, handling, and transporting excavated soils that may contain hazardous constituents. These regulations also set standards for testing of potential hazardous wastes prior to management and proper off-site disposal.

The impacted soil at the Study Area is not believed to be hazardous waste. The transport and disposal of non-hazardous waste that may be generated during the corrective action will be performed in accordance with the pertinent sections of Title 27 of the CCR, which addresses the proper management of solid wastes.

The corrective actions at the Study Area consider the RWQCB Basin Plan policy of no loss of wetlands, as well as Presidio wetlands resources (NPS and Trust, 2003). Any applicable discharge prohibitions and erosion control measures will protect surface water and wetland resources.

The corrective actions at the Study Area also consider stormwater discharges as described in the Basin Plan-Chapter 4, as part of the Porter-Cologne Water Quality Control Act promulgated under California Water Code \$13240-13241. Limitations to construction-related stormwater discharges are described in this provision. The Stormwater Discharges program is regulated by the RWQCB for certain municipal, industrial, and construction stormwater discharges through NPDES permits. The Construction Activity Control Program requires an NPDES permit for construction activities involving disturbance of one acre or greater total land area. Permit conditions address pollutant and waste discharges occurring during construction activities and the discharge of pollutants in runoff after construction. The Erosion and Sediment Control program establishes guidelines for the regulation of erosion and sedimentation for the protection of beneficial uses of water due to the impairment by sediment. Corrective action efforts at the Study Area will not likely include stormwater discharge and the total excavation areas total less than one acre in size; therefore a stormwater NPDES is not required. However, any corrective action related stormwater discharges will use controls to reduce pollutant loads in stormwater in a manner that will not adversely impact groundwater or surface water, in accordance with the Basin Plan are part of the planned remediation actions to be implemented at the Study Area.

Also, Bay Area Air Quality Management District (BAAQMD) regulations pertinent to dust suppression and onsite air monitoring during excavation work will be met to prevent air quality impacts from the selected remedial actions. BAAQMD regulations under the Clean Air Act pertaining to remediation activities in areas of serpentinite rocks and soil will be followed. A dust mitigation plan for on-site dust mitigation and monitoring for asbestos will be prepared in accordance with the Air Resources Board Model Rule. Although not anticipated to be present, if unknown underground storage tanks (USTs) are found during remedial activities, removal will comply with applicable state and local requirements.

# 5.8 Implementation Schedule

Upon final regulatory approval by the RWQCB of the Final CAP, all deliverables and corrective actions authorized by the CAP will be prepared and implemented according to the schedule, as amended, required by the RWQCB Order. The RWQCB Order schedule currently requires that remedy construction at the Study Area begin by February 28, 2006.

Upon regulatory agency approval of the Final CAP, the CAP Work Plan for application of the preferred alternatives for the soil RUs will be prepared. Once the CAP Work Plan is approved by the RWQCB, the CAP will be implemented. As required by the RWQCB Order No. R2-2003-0080, a report documenting implementation of the soil corrective actions, construction completion, and groundwater monitoring results will be issued on or before January 30, 2007. In accordance with Task 13 of RWQCB Order No. R2-2003-0080, a Five-Year Status Report, which evaluates the effectiveness of the CAP for groundwater, will be issued in 5 years following implementation of this CAP.

# 6. References

Blasland, Bouck, and Lee, Inc. (BBL), 2003. Development of Freshwater TPH-diesel and TPH-fuel oil Point of Compliance Concentrations, Presidio of San Francisco, California. November 14.

California Department of Toxic Substances Control (DTSC), the Presidio Trust (Trust), and National Park Service (NPS), 1999. Consent Agreement Between the California Department of Toxic Substances Control, the Presidio Trust, and the US Department of the Interior, National Park Service for the Remediation of Hazardous Substances at the Presidio of San Francisco. 30 August.

California Regional Water Quality Control Board, San Francisco Bay Region (RWQCB), 1996. *Order No. 96-070, Site Cleanup Requirements (SCRs)*.

RWQCB, 2003a. Order No. R2-2003-0080, Revised Site Cleanup Requirements (SCRs) and Rescission of Order No. 91-082 and Order No. 96-070. August.

RWQCB, 2003b. Screening For Environmental Concerns at Sites With Contaminated Soil and Groundwater. Interim Final. July 2003 (updated 2/4/04).

Dames & Moore, 1997. Final Remedial Investigation Report, Presidio Main Installation, Presidio of San Francisco. January.

Erler & Kalinowski, Inc. (EKI), 2002. Development of Presidio-wide Cleanup Levels for Soil, Sediment, Groundwater, and Surface Water. October.

EKI, 2004. Low Temperature Thermal Desorption-Treated Soil Tracking and Management Plan. November.

ESI. 1995. Wintran Version 1.03. Environmental Simulations, Inc.

International Technology, Inc. (IT), 1996. Aboveground Storage Tank Closure Report, May.

IT, 1999. Fuel Distribution System Closure Report, Presidio of San Francisco, California, Volumes 1 through 3. May.

MACTEC, 2003. Final Closure Report, DEH Study Area, Presidio of San Francisco, California. September.

Montgomery Watson, 1995a. Draft Building 1349 Site Investigation, Final Site Investigation Report, Presidio of San Francisco, California. January.

Montgomery Watson, 1995b. Final Fuel Product Action Level Development Report, Presidio of San Francisco. October.

Montgomery Watson, 1996. Final Building 1349 Additional Site Investigation Report, Presidio of San Francisco, California. May.

Montgomery Watson, 1998. Technical Memorandum – Hexavalent Chromium in Groundwater, Presidio of San Francisco, California. April.

Montgomery Watson, 1999. Additional Investigation of Fuel Distribution Systems, Presidio of San Francisco, California. August.

NPS, 1994. Creating a Park for the 21st Century, from Military Post to National Park-Final General Management Plan Amendment, Presidio of San Francisco, California. July.

NPS and Trust, 2003. Presidio Wetlands Resources: U.S. Army Corps of Engineers Potential Jurisdictional Wetlands and U.S. Fish and Wildlife Wetland Habitat on the Presidio of San Francisco. April.

Parkhurst, D.L. and Appelo, C.A.J, 1999. *User's Guide to PHREEQC (Version 2) - A Computer Program for Speciation, Batch-Reaction, One-Dimensional Transport, and Inverse Geochemical Calculations*, WRIR 99-4259, 326 p.

Schlocker, J., 1974. Geology of San Francisco North Quadrangle, California, United States Geological Survey, Professional Paper 782.

Sharp, Z.D. and Barnes, J.D., 2004. Water-Soluble Chlorides in Massive Seafloor Serpentinites: A Source of Chloride in Subduction Zones, Elsevier Press, June.

Tetra Tech EM Inc. (Tetra Tech), 2001. Presidio-wide Quality Assurance Project Plan, Sampling and Analysis Plan, Presidio of San Francisco, Revision 1 April.

Treadwell & Rollo, 2002. Draft Site Investigation Work Plan, Building 1349 Study Area, Presidio of San Francisco, California. July.

Treadwell & Rollo, 2003a. Draft Site Investigation Report, Building 1349 Study Area, Presidio of San Francisco. October.

Treadwell & Rollo, 2003b. Draft Construction Completion Report for Landfill 4 and Fill Site 5.

Treadwell & Rollo, 2004. Semiannual Groundwater Monitoring Report, First and Second Quarters 2004, Presidio of San Francisco. October.

Treadwell & Rollo, 2005. Semiannual Groundwater Monitoring Report, Third and Fourth Quarters 2004, Presidio of San Francisco. April.

Trust, 2002. Presidio Trust Management Plan, Land Use Policies for Area B of the Presidio of San Francisco, California. May.

Trust and NPS, 2001. Vegetation Management Plan and Environmental Assessment for the Presidio of San Francisco. May.

# **Tables**



Table 2-1 Summary of Groundwater Elevations Building 1349 Area Presidio of San Francisco, California

Well ID	Date <sup>1</sup>	Average Depth to Water <sup>2</sup> (feet)	Top of Casing Elevation (feet PLLW)	Groundwater Elevation (feet PLLW)	Well Type
1349MW01	05/24/04	27.78	300.44	272.66	MW
	03/08/04	26.84	300.44	273.60	MW
	12/01/03	29.38	300.44	271.06	MW
	08/11/03	27.91	300.44	272.53	MW
	06/02/03	28.33	300.44	272.11	MW
	03/10/03	28.19	300.44	272.25	MW
	12/02/02	29.61	300.44	270.83	MW
	08/26/02	28.69	300.44	271.75	MW
	05/28/02	28.38	300.44	272.06	MW
	03/04/02	27.70	300.44	272.74	MW
	11/26/01	29.76	300.44	270.68	MW
	08/27/01	30.17	300.44	270.27	MW
	05/08/01	29.45	300.44	270.99	MW
1349MW02	05/24/04	34.20	311.22	277.02	MW
	03/08/04	34.14	311.22	277.08	MW
	12/01/03	36.66	311.22	274.56	MW
	08/11/03	35.46	311.22	275.76	MW
	06/02/03	35.03	311.22	276.19	MW
	03/10/03	35.46	311.22	275.76	MW
	12/02/02	36.98	311.22	274.24	MW
	08/26/02	35.94	311.22	275.28	MW
	05/28/02	34.95	311.22	276.27	MW
	03/04/02	35.54	311.22	275.68	MW
	11/26/01	37.75	311.22	273.47	MW
	08/27/01	36.79	311.22	274.43	MW
	05/08/01	35.47	311.22	275.75	MW
1349MW03	08/26/02	28.63	300.54	271.91	MW
	05/28/02	26.64	300.54	273.90	MW
	03/04/02	25.20	300.54	275.34	MW
	11/26/01	30.67	300.54	269.87	MW
	08/27/01	29.65	300.54	270.89	MW
	05/08/01	26.56	300.54	273.98	MW
1349MW03R	05/24/04	29.40	304.13	274.73	MW
	03/08/04	28.43	304.13	275.70	MW
	12/01/03	33.33	304.13	270.80	MW
	08/11/03	31.69	304.13	272.44	MW
	06/02/03	30.48	304.13	273.65	MW
1349MW100	05/24/04	32.05	309.60	277.55	MW
	03/08/04	31.63	309.60	277.97	MW
	12/01/03	34.42	309.60	275.18	MW
	08/11/03	32.98	309.60	276.62	MW
	06/02/03	32.75	309.60	276.85	MW
	03/10/03	33.30	309.60	276.30	MW
	12/02/02	34.67	309.60	274.93	MW

Table 2-1 Summary of Groundwater Elevations Building 1349 Area Presidio of San Francisco, California

Well ID	Date <sup>1</sup>	Average Depth to Water <sup>2</sup> (feet)	Top of Casing Elevation (feet PLLW)	Groundwater Elevation (feet PLLW)	Well Type	
1349MW101	05/24/04	32.23	311.63	279.40	MW	
	03/08/04	32.90	311.63	278.73	MW	
	12/01/03	35.25	311.63	276.38	MW	
	08/11/03	34.14	311.63	277.49	MW	
	06/02/03	33.59	311.63	278.04	MW	
1349MW102	05/24/04	25.68	305.68	280.00	MW	
	03/08/04	25.62	305.68	280.06	MW	
	12/01/03	28.17	305.68	277.51	MW	
	08/11/03	26.96	305.68	278.72	MW	
	06/02/03	26.51	305.68	279.17	MW	
1349MW103	05/24/04	38.40	318.07	279.67	MW	
	03/08/04	38.75	318.07	279.32	MW	
	12/01/03	40.69	318.07	277.38	MW	
	08/11/03	39.51	318.07	278.56	MW	
	06/02/03	39.33	318.07	278.74	MW	
1349MW104	05/24/04	35.18	314.58	279.40	MW	
	03/08/04	35.76	314.58	278.82	MW	
	12/01/03	37.43	314.58	277.15	MW	
	08/11/03	36.27	314.58	278.31	MW	
	06/02/03	35.96	314.58	278.62	MW	
1349MW105	05/24/04	33.20	312.05	278.85	MW	
	03/08/04	33.71	312.05	278.34	MW	
	12/01/03	34.38	312.05	277.67	MW	
	08/11/03	33.77	312.05	278.28	MW	
	06/02/03	34.20	312.05	277.85	MW	
LF5GW100	5/24/2004	9.05	229.74	220.69	MW	
	3/8/2004	9.1	229.74	220.64	MW	
	12/1/2003	9.3	229.74	220.44	MW	
	8/11/2003	6.71	229.74	223.03	MW	
	6/2/2003	6.98	229.74	222.76	MW	
	3/10/2003	9.1	229.74	220.64	MW	
	12/2/2002	7.17	229.74	222.57	MW	
LF5GW100	8/26/2002	5.05	229.74	224.69	MW	
	5/28/2002	6.31	229.74	223.43	MW	
	3/4/2002	5.25	229.74	224.49	MW	
	11/26/2001	6.73	229.74	223.01	MW	
	8/27/2001	11.09	229.74	218.65	MW	
	5/8/2001	6.32	229.74	223.42	MW	

Table 2-1 Summary of Groundwater Elevations Building 1349 Area Presidio of San Francisco, California

Well ID	Well ID Date 1		Top of Casing Elevation (feet PLLW)	Groundwater Elevation (feet PLLW)	Well Type
LF5GW101	5/24/2004	4.95	234.36	229.41	MW
	3/8/2004	3.97	234.36	230.39	MW
	12/1/2003	5.15	234.36	229.21	MW
	8/11/2003	5.95	234.36	228.41	MW
	6/2/2003	5.78	234.36	228.58	MW
	3/10/2003	6.85	234.36	227.51	MW
	12/2/2002	9.19	234.36	225.17	MW
	8/26/2002	5.84	234.36	228.52	MW
	5/28/2002	8.65	234.36	225.71	MW
	3/4/2002	6.77	234.36	227.59	MW
	11/26/2001	8.38	234.36	225.98	MW
	8/27/2001	6.66	234.36	227.7	MW
	5/8/2001	2	234.36	232.36	MW
LF5GW102	5/24/2004	29.67	294.76	265.09	MW
	3/8/2004	30.51	294.76	264.25	MW
	12/1/2003	31.23	294.76	263.53	MW
	8/11/2003	30.75	294.76	264.01	MW
	6/2/2003	29.35	294.76	265.41	MW
LF5GW103	5/4/2004	13.31	279.12	265.81	MW
	3/8/2004	13.47	279.12	265.65	MW
	12/1/2003	14.31	279.12	264.81	MW
	8/11/2003	13.45	279.12	265.67	MW
	6/2/2003	12.33	279.12	266.79	MW
LF5GW104	5/24/2004	25.45	286.05	260.6	MW
	3/8/2004	20.89	286.05	265.16	MW
	12/1/2003	27.06	286.05	258.99	MW
	8/11/2003	25.35	286.05	260.7	MW
	6/2/2003	23.44	286.05	262.61	MW

# **Notes**

- 1 Data collected through May 2004 are presented.
- 2 All depth to water measurements are an average of three measurements recorded in the field.

MW - Monitoring well

feet PLLW - feet above Presidio lower low water vertical datum

# Table 2-2 Summary of Previous Site Investigation and Corrective Actions Building 1349 Area Presidio of San Francisco, California

Investigation Report	Date/Performed By	Summary of Activity	Potential Contaminants of Concern
Final Building 1349 Site Investigation	January 1995/ Montgomery Watson	<ul> <li>Site investigation conducted in two phases at the Site.</li> <li>Phase 1: Fourteen soil borings were advanced in August 1993.</li> <li>One grab groundwater sample and 51 soil samples were collected for TPHd, BTEX, and metals.</li> <li>Analytical results indicated high soil concentrations of TPHd in the area of the former drainage gully, east of Washington Boulevard.</li> <li>Phase 2: Eight soil borings were advanced in February 1994.</li> <li>Thirty-seven soil samples and one groundwater sample were collected for TPHd and BTEX analyses.</li> <li>Analytical results indicated high soil concentrations of TPHd in the area of the former drainage gully, east of Washington Boulevard and groundwater.</li> <li>Select soil samples were analyzed for physical and biological parameters to help assess potential soil remediation technologies.</li> <li>A leaking, shallow underground fuel pipe between the tank and fuel dispensing structure was located and identified as a potential source area.</li> </ul>	TPHd
Final Building 1349 Additional Site Investigation	May 1996/ Montgomery Watson	<ul> <li>High-resolution seismic reflection study indicated up to eight bedrock lineaments at the site.</li> <li>Phase 3: Nine soil borings were advanced to depths ranging from approximately 38 to 58 feet below ground surface (bgs).</li> <li>Relatively low concentrations of TPHd were detected from 0 to 30 feet bgs with concentrations ranging from 1.0 to 7.7 mg/kg, and increasing concentrations of TPHd were observed in soil from 30 to 50 feet bgs ranging from 330 to 990 mg/kg.</li> <li>TPHd was detected in three grab groundwater samples at concentrations of 1,300 ppb, 24,000 ppb, and 4,700 ppb. Concentrations in groundwater were above the cleanup level of 880 ppb.</li> <li>Three groundwater monitoring wells were installed in converted soil borings.</li> </ul>	TPHd

# Table 2-2 Summary of Previous Site Investigation and Corrective Actions Building 1349 Area Presidio of San Francisco, California

Investigation Report	Date/Performed By	Summary of Activity	Potential Contaminants of Concern
Aboveground Storage Tank Closure	May 1996/ IT Corporation	Removal action activities included the removal of Building 1349 and associated piping. In addition, soil was removed from the areas at the site as follows:  • Area 1: Excavation area of approximately 25 by 35 feet to a depth of 7.0 feet bgs.  • Area 2: Excavation area of approximately 70 by 25 feet to a depth of 12 feet bgs.  • Area 3: Excavation area of approximately 40 by 50 feet to a depth of 13.2 feet bgs.  Confirmation samples were collected for soil remaining in place. Concentrations of TPHd in soil ranged from 14,000 to 24,000 mg/kg beneath the communications conduit at 3.0 feet bgs. Two additional samples were collected at depths of 4 and 6 feet gbs. TPHd was detected at concentrations of 13,000 and 14,000 mg/kg. Four samples were collected at 12 feet bgs with concentrations of TPHd ranging from 3,200 to 10,000 mg/kg. PAHs were detected at a maximum concentration of 51 mg/kg for naphthalene.	TPHd and PAHs
Fuel Distribution System Closure Report	May 1999/ IT Corporation	<ul> <li>A portion of the Presidio-wide FDS piping removal corrective action. Two FDS pipeline removal actions, MT-6 and MT-7, occurred in the vicinity of Building 1349 (IT, 1995).</li> <li>Approximately 1,000 linear feet of 6-inch pipeline were excavated and removed from the MT-6 area and 2,000 linear feet excavated and removed from MT-7.</li> <li>Trench excavations were backfilled with overburden soil from the excavations to 18 inches bgs and with imported topsoil from 18 inches bgs to ground surface.</li> <li>Three FDS Remedial Excavations (total of approximately 190 cubic yards) were completed in the area north of Building 1349 at areas overlapping former MT-6 and MT-7 excavations.</li> <li>Post-excavation confirmation soil samples were collected from the bottoms and sidewalls of the excavations.</li> <li>Field immunoassay analytical tests were performed on the confirmation samples as well as laboratory confirmation analysis based on the field immunoassay results (IT, 1999).</li> <li>Immunoassay and laboratory analytical results indicate that soils with TPH and PAHs exceeding the action levels were left in place.</li> <li>Excavated soils were LTTD-treated and used as backfill.</li> </ul>	TPHd, TPHfo and PAHs

## Table 2-2 Summary of Previous Site Investigation and Corrective Actions Building 1349 Area Presidio of San Francisco, California

Investigation Report	Date/Performed By	Summary of Activity	Potential Contaminants of Concern
Additional Investigation of Fuel Distribution Systems	August 1999/ Montgomery Watson	<ul> <li>Investigation of former FDS pipeline trending south from Building 1349 across Washington Blvd.</li> <li>Soil borings advanced at 100-foot intervals along former pipeline.</li> <li>TPHfo not detected above 115 mg/kg.</li> <li>Decision document indicating "no further action" recommended.</li> </ul>	None
Draft Building 1349 Site Investigation Report	October 2003/ Treadwell & Rollo	<ul> <li>Soil and groundwater data gap assessment. Total of 31 soil borings advanced to various depths.</li> <li>Soil and grab groundwater samples analyzed for TPHd, TPHfo and PAHs.</li> <li>Shallow soil samples collected at 2.5 feet bgs to 7.5 feet bgs from nine borings from the former FDS remedial excavations and FDS trench excavations contained TPHd, TPHfo and several PAH concentrations above their respective cleanup levels.</li> <li>Deep soil samples collected at 12 feet bgs and 20 feet bgs from 1349SB127 at former FDS remedial excavation contained TPHd at 17,000 mg/kg and naphthalene at 17 mg/kg.</li> <li>TPHd exceedances of cleanup levels detected in grab groundwater samples collected from borings 1349SB103, 1349SB108 and 1349SB111.</li> <li>Seven monitoring wells installed at the site (1349MW100 through 1349MW105), including replacement well 1349MW03R.</li> <li>Wells included in quarterly Presidio-wide groundwater monitoring network.</li> <li>TPHd and PAHs detected at 1349MW100 above their respective cleanup levels.</li> <li>Several OCPs detected at concentrations above screening levels at 1349MW100; most data qualified or of apparent low quality.</li> <li>PAHs detected in excess of cleanup goals once at 1349MW03 during Fourth Quarter 2001.</li> </ul>	TPHd, TPHfo, PAHs and OCPs (OCPs in groundwater only)

### **Notes**

BTEX - benzene, toluene, ethylene, and xylenes

FDS - Fuel Distribution System

mg/kg - milligrams per kilogram

PAHs - polycyclic aromatic hydrocarbons

μg/L - micrograms per liter

μg/kg – micrograms per kilogram

TPHd - total petroleum hydrocarbons as diesel

TPHfo - total petroleum hydrocarbons as fuel oil (using a motor oil standard with carbon range C24-C36)

TPHg - total petroleum hydrocarbons as gasoline.

VOCs - volatile organic compounds

OCPs – Organochlorine Pesticides

LTTD – Low Temperature Thermal Desorption

Table 3-1 Summary of Soil Cleanup Levels Building 1349 Area Presidio of San Francisco, California

Chemical	Protection of Human Health Recreational Cleanup Level <sup>a</sup>	Protection of Human Health Residential Cleanup Level <sup>a,b,d</sup>	Protection of Ecological Receptors Cleanup Level for Terrestrial Receptors <sup>a</sup>	Protection of Ecological Receptors Cleanup Level for Special- Status Receptors <sup>a</sup>	Background Metals Concentrations for Serpentinite Soil <sup>f</sup>	Protection of Groundwater Resources Cleanup Level for Soil to Maintain Drinking Water Standard in Groundwater Soil Less Than 5 feet Above Groundwater <sup>a</sup>	Protection of Groundwater Resources Cleanup Level for Soil to Maintain Drinking Water Standard in Groundwater Soil Greater Than 5 feet Above Groundwater <sup>a</sup>	QAPP Analytical Reporting Limit	Laboratory Detection Limit	Effective Soil Cleanup Level Soil 0 to 3 feet bgs <sup>c</sup>	Effective Soil Cleanup Level Soil 3 to 10 feet bgs <sup>d</sup>	Effective Soil Cleanup Level Soil Greater Than 10 feet bgs and Less Than 5 feet above groundwater <sup>e</sup>	Effective Soil Cleanup Level Soil Greater Than 10 feet bgs and Greater Than 5 feet above groundwater
Metals (mg/kg) <sup>f</sup>													
Antimony	70	29		5	3.0			0.2	0.25	5	29		
Arsenic	0.88	0.36		10	5.4			0.2	0.25	5.4 320	5.4 5,000		
Barium Beryllium	12,000 350	5,000 140		320 10	230 1.1			0.2 0.1	0.25 0.1	10	5,000 140		
Cadmium	4.2	1.7	 	0.017	1.9		 	0.1	0.25	1.9	1.9	 	
Chromium	2,800	1,200		4	1,700			0.2	0.5	1,700	1,700		
Cobalt	10,000	4,000		20	170			0.2	0.25	170	4,000		
Copper				30	85			0.2	0.5	85			
Iron					 66			5.0	10	160	400		
Lead Manganese	500	400		160	66			0.1 0.1	0.25 0.5	160	400		
Mercury	52	20	 	0.4	0.2		 	0.1	0.02	0.4	20	 	
Nickel	3,500	1,400		30	4,500			0.2	0.25	4,500	4,500		
Selenium	870	360		0.2	0.5			0.2	0.25	0.5	360		-
Thallium	14	5.7		0.15	1.0			0.2	0.25	1.0	5.7	-	- 1
Vanadium	1,600 52,000	650 22,000		2	74 160			1.0 0.2	0.25	74 160	650 22,000		-
Organochlorine Pesticides (mg/kg) <sup>h</sup>	52,000	22,000	<del></del>	4	160			0.2	1	160	22,000	<u> </u>	
Aldrin	0.07	0.029		0.0039				0.002	0.0017	0.0039	0.029		
alpha-BHC	0.44	0.18		0.062				0.002	0.0017	0.062	0.18		
beta -BHC	0.79	0.32		0.062				0.002	0.0017	0.062	0.32		
delta-BHC	0.44	0.18		0.062				0.002	0.0017	0.062	0.18		
Chlordane (alpha and gamma)e	0.91	0.37		0.009				0.002	0.0017	0.009	0.37		
4,4-DDD 4,4-DDE	4.9 3.5	2 1.4		0.049 0.098				0.002 0.004	0.0033 0.0033	0.049 0.098	2		
4,4-DDE 4,4-DDT	3.5	1.4		0.0082				0.004	0.0033	0.098	1.4 1.4		
Dieldrin	0.074	0.03		0.039				0.004	0.0033	0.03	0.03		
Endosulfan	900	370		1.1				0.002	0.0017	1.1	370		
Endosulfan sulfate	900	370		1.1				0.004	0.0033	1.1	370		
Endrin	45	18		0.004				0.004	0.0033	0.004	18		
Endrin aldehyde gamma-BHC	45 1.1	18 0.44		0.004 0.01				0.004 0.002	0.0033 0.0017	0.004 0.01	18 0.44		
Heptachlor	0.29	0.12		0.017				0.002	0.0017	0.017	0.12		
Heptachlor epoxide	0.21	0.088		0.017				0.002	0.0017	0.017	0.088	<del></del>	
Methoxychlor	750	310		0.44				0.02	0.017	0.44	310		
Polycyclic Aromatic Hydrocarbons (mg/l													
Acenaphthenε	6,600 h	2,700 h						0.33	0.0035	2,700	2,700		
Acenaphthylene	13,800	5,900						0.33 0.33	0.0035 0.0035				
Anthracene Benzo(a)anthracene	13,800	5,900 0.43				308 8		0.33	0.0035	5,900 0.43	5,900 0.43	308 8	 
Benzo(a)pyrene	0.1	0.04	0.3		 	3	 	0.33	0.0035	0.04	0.04	3	
Benzo(b)fluoranthene	1	0.43				23		0.33	0.0035	0.43	0.43	23	
Benzo(g,h,i)perylene	1,400	620				5,040		0.33	0.0035	620	620	5,040	
Benzo(k)fluoranthene	1	0.43				23		0.33	0.0035	0.43	0.43	23	
Chrysene Dibenzo(a,h) anthracene	10 0.19 h	4.3 0.078 h				54		0.33 0.33	0.0035 0.0035	4.3 0.078	4.3 0.078	54	
Fluoranthene	0.19 n 1,900	0.078 n 820				316	 	0.33	0.0035	0.078 820	0.078 820	316	
Fluorene	1,800	770				60		0.33	0.0035	770	770	60	 
Indeno(1,2,3-cd)Pyrene	0.65 h	0.27 h						0.33	0.0035	0.27	0.27		
Naphthalene	1,100	480				9		0.33	0.0035	480	480	9	
Phenanthrene	1,400	600				86		0.33	0.0035	600	600	86	
Total Carcinogenic PAHs	13 1.400	5.6 620				111 241		0.33	0.0035	5.6 620	5.6 620	111 241	
Pyrene Petroleum Hydrocarbons and Constituen	,	020			-	241		0.33	0.0035	020	020	241	
TPH (as diesel)	3,200	1,380	700			115	15,000	10	0.001	700	1,380	115	15,000
TPH (as fuel oil) <sup>i</sup>	4,500	1,900	980			160	15,000	10	0.001	980	1,900	160	15,000
TPH (as gasoline)	2,400	1,030	610			100	5,000	1.0	0.001	610	1,030	100	5,000
Benzene	1.5	0.6	40			0.005	140	0.005	0.005	0.6	0.6	0.005	140
Toluene	1,200	530	270			0.005	420	0.005	0.005	270	530	0.005	420
Ethylbenzene	1,900	840	125			0.009	60	0.010	0.005	125	840	0.009	60
Total Xylenes	2,500	1,080	55			0.009	180	0.005	0.005	55	1,080	0.009	180

Notes
bgs - below ground surface
μg/kg - micrograms per kilogram
mg/kg - milligrams per kilogram
PAHs - Polycyclic aromatic hydrocarbons
TPH - Total petroleum hydrocarbons
QAPP - Quality Assurance Project Plan
-- = Cleanup level is not available.
a - Cleanup level values listed are obtained fr

- -- Eleanup level is not available.
  a Cleanup level values listed are obtained from Tables 1, 2 and 4 of Regional Water Quality Control Board, San Francisco Bay Region, Order R2-2003-0080, Revised Site Cleanup Requirements (SCRs), August 2003.
  b Although the Building 1349 Study Area is located within a planned recreational land use zone, more conservative residential cleanup levels have been used to evaluate risk, select COCs, and facilitate follow-on decisions for potential unrestricted land use of a remedial unit, post remediation.
  c Residential and ecological cleanup levels are the applicable cleanup levels for soil from 0 to 3 feet bgs. For metals, background concentrations for serpentinite soil are selected if higher.
  d Residential cleanup levels are the applicable cleanup levels for soil to maintain drinking water standards in groundwater are the applicable cleanup levels or soil to maintain drinking water standards in groundwater are the applicable cleanup levels are the applicable concentrations for metals obtained from Cleanup Levels Document (EKI, 2002).
  g Cleanup levels for petroleum-related compounds obtained from SCRs, Order No. R2-2003-080 (RWQCB, 2003).
  h Cleanup level obtained from Table 7-2 (Non-petroleum compounds) in the Cleanup Levels Document (EKI, 2002)
  i These values also apply to TPH as motor oil.

2/14/2006 00162822 Tables.xls

### Table 3-2 Summary of Groundwater Cleanup Levels Building 1349 Area Presidio of San Francisco, California

	î	1	1
Chemical	QAPP Analytical Reporting Limits (µg/L)	Laboratory Reporting Limits (µg/L)	Drinking Water Groundwater Cleanup Level <sup>a</sup> (µg/L)
Petroleum Hydrocarbons and Constitu	uents		(FB/ 2-)
TPHg (C <sub>7</sub> -C <sub>12</sub> )	50	50	770
TPHd $(C_{12}-C_{24})$	50	50	880
TPHfo $^{b}(C_{24}-C_{36})$	300	250	1,200
Benzene $(C_{24}-C_{36})$	0.01	0.5	1.0
Toluene	0.01	0.5	150
Ethylbenzene	0.03	0.5	700
Total Xylenes	0.5	0.5	1,750
Polycyclic Aromatic Hydrocarbons (P.		0.3	1,730
•	10	0.2	420°
Acenaphthene	-		
Acenapthylene	10	0.2	280°
Anthracene	10	0.5	770
Benzo(a)anthracene	10	0.1	0.1
Benzo(a)pyrene	10	0.1	0.2
Benzo(b)fluoranthene	10	0.2	0.2
Benzo(g,h,i)perylene Benzo(k)fluoranthene	10 10	0.2 0.1	150 2
Chrysene	10	0.1	20
Dibenzo(a,h)anthracene	10	0.2	0.0085 <sup>c,d</sup>
Flouranthene	10	0.4	300
Fluorene	10	1	300
Naphthalene	10	1	300
Indeno(1,2,3-cd)pyrene	10	0.14	0.029 <sup>c,d</sup>
Phenanthrene	10	0.5	230
Pyrene	10	0.2	230
<b>Volatile Organic Compounds (VOCs)</b>	I	-	
2-butanone	10	10	4,200°
Acetone	10	10	700°
Bromoform	0.5	1	100°
Carbon disulfide	5	0.5	
Dibromochloromethane	0.5	0.5	100 <sup>c</sup>
Methyl t-butyl ether (MTBE)	2	0.5	13
Metals	•	•	
Aluminum	50	50	
Antimony	2	1	6
Arsenic	2	1	10
Barium	1	1	1,000
Beryllium	1	1	4
Cadmium	1	1	5
Calcium	50	50	
Chromium	2	1	50
Chromium VI	0.5	10	21°
Cobalt	1	1	140 <sup>c</sup>
Copper	2	1	1,000
Iron	50	50	
Lead	1	1	15
Magnesium	50	50	
Manganese	1	1	

### Table 3-2 Summary of Groundwater Cleanup Levels Building 1349 Area Presidio of San Francisco, California

Chemical	QAPP Analytical Reporting Limits (µg/L)	Laboratory Reporting Limits (µg/L)	Drinking Water Groundwater Cleanup Level <sup>a</sup> (µg/L)
Metals			
Mercury	0.2	0.2	2
Nickel	2	1	100
Potassium	50	50	
Selenium	2	1	50
Silver	1	1	50
Sodium	50	50	
Thallium	1	1	2
Vanadium	10	1	15 <sup>c</sup>
Zinc	2	20	5,000
Pesticides			
Aldrin	0.05	0.05	0.002 <sup>c,d</sup>
alpha-BHC	0.05	0.05	
beta -BHC	0.05	0.05	0.3
delta-BHC	0.05	0.05	
gamma-BHC	0.05	0.05	0.2
Chlordane (alpha and gamma) <sup>e</sup>	0.5	0.05	0.1
4,4-DDD	0.1	0.01	0.15 <sup>c</sup>
4,4-DDE	0.1	0.01	0.10 <sup>c</sup>
4,4-DDT	0.1	0.01	$0.10^{c}$
Dieldrin	0.1	0.05	0.5
Endosulfan	0.1	0.01	42 <sup>c</sup>
Endosulfan sulfate	0.1	0.1	
Endrin	0.1	0.01	2
Endrin aldehyde	0.1	0.1	2
Heptachlor	0.05	0.025	0.01 <sup>d</sup>
Heptachlor epoxide	0.05	0.025	0.01 <sup>d</sup>
Methoxychlor	0.5	0.025	40

### <u>Notes</u>

 $\mu g/L$  - micrograms per liter

--- = Cleanup level is not available.

QAPP - Quality Assurance Project Plan

TPHd - total petroleum hydrocarbons as diesel

TPHg - total petroleum hydrocarbons as gasoline

TPHfo - total petroleum hydrocarbons as fuel oil

a - Development of Presidio-wide Cleanup Levels for Soil, Sediment, Groundwater and Surface Water, Presidio of San Francisco (EKI, 2002), Table 7-6, Cleanup Levels for Surface Water, Seeps, and Groundwater at the Presidio of San Francisco (Drinking Water Cleanup Level) or maximum contaminant levels (MCLs), if available.

- b These values also apply to TPH as motor oil.
- c Values are Environmental Screening Levels (ESLs) for drinking water (RWQCB, 2003b).
- d Drinking water level is lower than laboratory reporting limit. Therefore, laboratory reporting limit is selected as achievable cleanup level.
- e Cleanup level for chlordane is applied to both alpha and gamma isomers. Both isomers are reported in laboratory data.

## Table 3-3 Summary of Remedial Units and Contaminants of Concern Building 1349 Area Presidio of San Francisco, California

Remedial Units	Depth (Feet)	Estimated Surface Area (Square Feet) <sup>(1)</sup>	Estimated Thickness (Feet) <sup>(1)</sup>	Estimated Volume In-Situ (Cubic Yards) (1)	COCs (3)
SOIL					
Shallow Soil - Area 1	0 to 7-9 feet bgs	2130	7 - 9	630	TPHd, TPHfo B(a)P, D(a,h)A, chrysene
Shallow Soil - Area 2	0 to 3 feet bgs	270	3	30	B(a)P, D(a,h)A
Shallow Soil - Area 3	0 to 10 feet bgs	405	10	150	TPHd
Deep Soil	10 to 22 feet bgs	70	12	30	TPHd
Telecommunications Conduit	0 to 16 feet bgs (2)	960	16	570	TPHd, PAHs
Total				1410	
GROUNDWATER				•	
Building 1349 Area Groundwater	NA	NA	NA	NA	TPHd, TPHg, benzene, PAHs, OCPs, arsenic

### Notes

NA - Not Applicable

TPHd - TPH as diesel fuel

TPHfo - TPH as fuel oil

TPH - Total petroleum hydrocarbons

B(a)P - Benzo(a)Pyrene

D(a,h)A - Dibenz(a,h)Anthracene

OCPs - Organochlorine pesticides

PAHs - Polycyclic aromatic hydrocarbons

COCs - Contaminants of Concern

- 1 Surface area, thickness, and volume estimated using target excavation areas (Figure 5-1).
- 2 Sixteen feet bgs assumed as an estimate for approximate depth of contamination before bedrock. Actual depth and limits of excavation will be determined by post excavation confirmation sampling.
- 3 Although metals and OCPs are not COCs for the soil RUs, they will be analyzed in soil confirmation samples (see Table 5-1).

# Table 4-1 Summary of Potential Remedial Technologies Shallow Soil, Deep Soil, Telecommunications Corridor Soil and Groundwater Building 1349 Area Presidio of San Francisco, CA

Remedial Unit		Remedial Technology		
Shallow Soil	No Action			
	Excavatio	n and Offsite Disposal		
	Capping			
	Land Use	Controls		
	In Situ	Bioremediation (Bioventing and Enhanced Bioremediation)  SVE		
Deep Soil	No Action	14 . —		
	Excavatio	n and Offsite Disposal		
	Subsurfac	e Capping		
	In Situ	Bioremediation (Bioventing and Enhanced Bioremediation)		
	III Situ	SVE		
Telecommunications	No Action			
Corridor Soil	Excavation	n and Offsite Disposal		
	Capping			
	Land Use	Controls		
	In Situ	Bioremediation (Bioventing and Enhanced Bioremediation)		
	III Situ	SVE		
Groundwater	No Action			
		nter Monitoring		
	Land Use	Controls		
		Enhanced Bioremediation (ORC, hydrogen peroxide)		
	In Situ	Air Sparging		
		Chemical Oxidation (hydrogen peroxide + iron, ozone)		
	Extraction	and Treatment		

### Table 4-2 Screening of Soil Remediation Technologies Shallow Soil Remedial Unit (0 to 10 feet below ground surface) Building 1349 Presidio of San Francisco, California

<u> </u>						Screening		
Remedial Technology			Technology Description	Comments	Technical Effectiveness	Implementability	Cost	Technology Retained
No Action			Shallow soil remains in place and reduction of impacts limited to naturally-occurring biodegradation.	Not protective of human health or the environment.	Low	Low	Low	Yes
Excavation and Offsite Disposal				Removes shallow soil contamination. Protective of human health and environment. Uses readily available equipment.	High	High	High	Yes
Capping			Shallow soil capped with a low permeable soil (10-6 cm/s) or synthetic material to mitigate leaching of TPH and PAHs from the affected soil to underlying groundwater. Land use controls implemented to maintain the integrity of the cap.	Readily available, low-tech equipment. Minimizes exposure for human and ecological receptors and potential leaching to underlying groundwater, but leaves contaminated soil in place. Would require land use control and long- term O&M.	Moderate	Moderate	High	Yes
Land Use Controls			reduction of impacts limited to naturally- occurring biodegradation. Land use	Protective of human health and environment, but leaves contaminated soil in place. Impacted soil is 2 ft bgs and deeper.	Moderate	Moderate	Low	Yes
In Situ	Bioremediation	Bioventing	constituents absorbed to soils in the unsaturated zone. Air injection wells are installed by standard well-drilling methods (vertical, angled, or horizontal) used in unsaturated zones. The increased supply of oxygen (as air) serves to accelerate the rate of naturally occurring aerobic contaminant biodegradation.	is that the material is uniform and homogeneous. The shallow soil RU consists of discrete volumes of contaminated material in silty	Low	Moderate	High	No

# Table 4-2 Screening of Soil Remediation Technologies Shallow Soil Remedial Unit (0 to 10 feet below ground surface) Building 1349 Presidio of San Francisco, California

						Screening		
Remedial Technology			Technology Description	Comments	Technical Effectiveness	Implementability	Cost	Technology Retained
In Situ	Bioremediation	Enhanced Bioremediation	Uses oxygen-releasing product to time- release oxygen into the subsurface via soil borings. The increased supply of oxygen serves to accelerate the rate of naturally occurring aerobic contaminant biodegradation.	Uses standard drilling equipment. Effective at degrading TPH and PAHs. A basic assumption of in-situ treatment is that the material is uniform and homogeneous. The shallow soil RU consists of discrete volumes of contaminated material in silty clay/clayey silt (slope debris and ravine fill and weathered bedrock with evidence of secondary mineralization of fractures) which has low permeability and is heterogeneous. This lithology would likely produce preferential flow paths and thus would not be remediated uniformly. Not effective in unsaturated soil.	Low	Moderate	High	No
	Extraction	Soil Vapor Extraction (SVE)	Volatile constituents absorbed to soils in unsaturated zone are volatilized by applying a vacuum. Resulting vapors are extracted for treatment.	SVE targets VOCs and some SVOCs but not heavier hydrocarbons such as TPHd. Method is not effective to remediate shallow soil contamination in Building 1349 Study Area due to soil and weathered bedrock with low permeability. Study Area lithology would likely produce preferential paths and thus would not be remediated uniformly.	Low	Moderate	High	No

### Note: Definitions for Effectiveness, Implementability and Cost.

**Technical Effectiveness**: Technical effectiveness refers to the ability of a technology to address: 1) the estimated area or volumes of media requiring remediation to meet the RAOs; 2) the potential impacts to human health and the environment during implementation and any construction; and 3) the long-term reliability and proven history of the technology with respect to the types of chemicals and conditions at the sites.

**Implementability**: Implementability refers to both the technical and institutional feasibility of implementing a particular remedial technology, including: 1) the likelihood of obtaining permits and approvals from regulatory agencies; 2) availability of appropriate treatment, storage, and disposal facilities (TSDFs); and 3) availability of the equipment, materials and skilled workers necessary to implement the particular technology.

Cost-Effectiveness: Cost-effectiveness includes assessing the relative capital and operation and maintenance (O&M) costs associated with a particular technology. Costs are estimated using best engineering judgment at the time of the estimate. Cost-effectiveness weighs required expenditures against potential benefits, and is used to eliminate options that are substantially more expensive than other process options providing the same level of protection.

### Table 4-3 Screening of Soil Remediation Technologies Deep Soil Remedial Unit (greater than 10 feet below ground surface) Building 1349 Presidio of San Francisco, California

						Screening		
Remedial Technology			Technology Description	Comments	Technical Effectiveness	Implementability	Cost	Technology Retained
No Action			of impacts limited to naturally-occurring biodegradation.		Low	Low	Low	Yes
Excavation and Offsite Disposal			Deeper soil would be removed with conventional excavating equipment, characterized, and disposed of at an appropriate facility. Effectiveness would be verified by confirmation sampling.	Presence of competent bedrock may impede technical effectiveness.	High	Moderate	High	Yes
Subsurface Capping				Method is effective to isolate soil from surface water infiltration, therefore chemicals left in place are not readily leachable to groundwater. Would require land use control and long-term O&M.	Moderate	Moderate	High	Yes
In Situ	Bioremediation	Bioventing	used in unsaturated zones. The increased supply of oxygen (as air) serves to	Uses low-profile, low-tech equipment. Effective at degrading TPH and PAHs. Does not require handling of chemicals. A basic assumption of in-situ treatment is that the material is uniform and homogeneous. The deep soil RU consists of contaminated material in silty clay/clayey silt (slope debris and ravine fill and weathered bedrock with evidence of secondary mineralization of fractures) and weathered bedrock which has low permeability and is heterogeneous. This lithology would likely produce preferential flow paths and thus soil would not be remediated uniformly.	Low	Moderate	High	No

# Table 4-3 Screening of Soil Remediation Technologies Deep Soil Remedial Unit (greater than 10 feet below ground surface) Building 1349 Presidio of San Francisco, California

						Screening				
Remedial Technology			Technology Description	Comments	Technical Effectiveness	Implementability	Cost	Technology Retained		
In Situ	Bioremediation	hanced	release oxygen into the subsurface via soil borings. The increased supply of oxygen serves to accelerate the rate of naturally occurring aerobic contaminant biodegradation	Method is not effective due to the low permeable soils and bedrock which would decrease the effectiveness of this technology. (See comments for Uses standard drilling equipment. Effective at degrading TPH and PAHs.	Low	Moderate	High	No		
	Soil Vapor Extraction	Soil Vapor Extraction (SVE)	applying a vacuum. Resulting vapors are extracted for treatment.	Method is not effective due to absence of lighter (more volatile) petroleum hydrocarbons; method is not effective for heavier TPH fractions. In addition, low permeabilty of soil and bedrock will impede volatilization.	Low	Moderate	High	No		

### Note: Definitions for Effectiveness, Implementability and Cost.

**Technical Effectiveness**: Technical effectiveness refers to the ability of a technology to address: 1) the estimated area or volumes of media requiring remediation to meet the RAOs; 2) the potential impacts to human health and the environment during implementation and any construction; and 3) the long-term reliability and proven history of the technology with respect to the types of chemicals and conditions at the sites.

**Implementability**: Implementability refers to both the technical and institutional feasibility of implementing a particular remedial technology, including: 1) the likelihood of obtaining permits and approvals from regulatory agencies; 2) availability of appropriate treatment, storage, and disposal facilities (TSDFs); and 3) availability of the equipment, materials and skilled workers necessary to implement the particular technology.

Cost-Effectiveness: Cost-effectiveness includes assessing the relative capital and operation and maintenance (O&M) costs associated with a particular technology. Costs are estimated using best engineering judgment at the time of the estimate. Cost-effectiveness weighs required expenditures against potential benefits, and is used to eliminate options that are substantially more expensive than other process options providing the same level of protection.

# Table 4-4 Screening of Soil Remediation Technologies Telecommunications Corridor Soil Remedial Unit Building 1349 Presidio of San Francisco, California

				Effectiveness in Telecommunications		Screening		
Remedial Technology			Technology Description	Conduit	Technical Effectiveness	Implementability	Cost	Technology Retained
No Action			Soil beneath the telecommunications conduit would remain in place and reduction of impacts limited to naturally-occurring biodegradation.	Not protective of human health or the environment	Low	Low	Low	Yes
Excavation and Offsite Disposal			8 1 1	Telecommunication conduit would need to be rerouted. Well 1349MW100 would need to be abandoned and replaced. Presence of competent bedrock may impede technical effectiveness.	High	Moderate to High	High	Yes
Capping			Soil would be capped with a low permeable soil or synthetic material to mitigate leaching of TPH and PAHs from the affected soil to the underlying groundwater. Land use controls would	Telecommunication conduit may provide pathway for water to move below cap and infiltrate through impacted area to groundwater, but expected to be minor.  Readily available, low-tech equipment.  Would require land use control and long term O&M.  Minimizes exposure to human and ecological receptors.	Moderate	Moderate	High	Yes
Land Use Controls			Soil would remain in place and reduction of impacts limited to naturally-occurring biodegradation. Land use controls implemented to restrict access in the vicinity of impacted soil and maintain integrity of surface soil.		Moderate	Moderate	Low	Yes
In Situ	Bioremediation	Enhanced Bioremediation	Uses oxygen-releasing product to time- release oxygen into the subsurface via soil borings. The increased supply of oxygen serves to accelerate the rate of naturally occurring aerobic contaminant biodegradation.	Method is not effective due to low permeable bedrock and soil (see comments for bioventing). Not effective in unsaturated soil.	Low	Moderate	High	No

# Table 4-4 Screening of Soil Remediation Technologies Telecommunications Corridor Soil Remedial Unit Building 1349 Presidio of San Francisco, California

				Effectiveness in Telecommunications		Screening		
Remedial Technology			Technology Description	Conduit	Technical Effectiveness	Implementability	Cost	Technology Retained
In Situ	Bioremediation	Bioventing	constituents absorbed to soils in the unsaturated zone. Air injection wells are installed by standard well-drilling methods (vertical, angled, or horizontal) used in unsaturated zones. The increased supply of oxygen (as air) serves to accelerate the rate of naturally occurring aerobic contaminant biodegradation.	is that the material is uniform and homogeneous. The deep soil RU consists of contaminated material in silty clay/clayey silt (slope debris and ravine	Low	Moderate	High	No
	Soil Vapor Extraction	Soil Vapor Extraction (SVE)	applying a vacuum. Resulting vapors	Method is not effective due to absence of lighter (more volatile) petroleum hydrocarbons; method is not effective for heavier TPH fractions. In addition, low permeabilty of soil and bedrock will impede volatilization.	Low	Moderate	High	No

### Note: Definitions for Effectiveness, Implementability and Cost.

**Technical Effectiveness**: Technical effectiveness refers to the ability of a technology to address: 1) the estimated area or volumes of media requiring remediation to meet the RAOs; 2) the potential impacts to human health and the environment during implementation and any construction; and 3) the long-term reliability and proven history of the technology with respect to the types of chemicals and conditions at the sites.

**Implementability**: Implementability refers to both the technical and institutional feasibility of implementing a particular remedial technology, including: 1) the likelihood of obtaining permits and approvals from regulatory agencies; 2) availability of appropriate treatment, storage, and disposal facilities (TSDFs); and 3) availability of the equipment, materials and skilled workers necessary to implement the particular technology.

Cost-Effectiveness: Cost-effectiveness includes assessing the relative capital and operation and maintenance (O&M) costs associated with a particular technology. Costs are estimated using best engineering judgment at the time of the estimate. Cost-effectiveness weighs required expenditures against potential benefits, and is used to eliminate options that are substantially more expensive than other process options providing the same level of protection.

# Table 4-5 Screening of Groundwater Remediation Technologies Groundwater Remedial Unit Building 1349 Presidio of San Francisco, California

				Screening				
Remedial Technology		Technology Description	Comments	Technical Effectiveness	Implementability	Cost	Technology Retained	
No Action		and reduction of impacts limited to naturally-occurring biodegradation.  Existing groundwater wells would be	Method is not effective in monitoring chemical distribution over time or evaluating the downgradient extent of impacts. Not in compliance with RWOCB Basin Plan, RWOCB Order No.	Low	Low	Low	Yes	
Groundwater Monitoring		Impacted groundwater would remain in place.  Existing groundwater wells would monitored for a period of up to 5 years.	Method is effective in monitoring chemical distribution as well as monitoring natural degradation processes over time and assessing attainment of cleanup levels.  By installing new groundwater monitoring wells near 1349MW100, the extent of impacts may be further evaluated.	High	High	High	Yes	
Land Use Controls		place and use would be restricted.	Would require RWQCB changes in beneficial use restrictions. Not in compliance with RWQCB Basin Plan, RWQCB Order No. R2-2003-0080, or SWRCB Resolution 92-49.	Moderate	Moderate	Low	Yes	
In-Situ	Enhanced Bioremediation	involves enhancing growth of naturally occurring microorganisms in order to promote aerobic degradation of contaminants. This can be done by using products such as ORC® or hydrogen peroxide to release oxygen into the groundwater.	ORC® can be applied actively (injecting a slurry, straight powder application in excavation, or mixture of water and powder in excavation) or passively (filter sock placed in wells). However, technology has constraints due to site lithology. Anisotropic fracture flow network with secondary mineralization limits the effective delivery of ORC® through injection or passive methods. Contact time with COCs may be limited and difficult to control.	Low	Moderate	High	No	

# Table 4-5 Screening of Groundwater Remediation Technologies Groundwater Remedial Unit Building 1349 Presidio of San Francisco, California

					Screening		
Remedial Technology		Technology Description	Comments	Technical Effectiveness	Implementability	Cost	Technology Retained
In-Situ	Air Sparging	aquifer by compressed air pumped through injection wells. Air bubbles volatilize contaminants in saturated zone and are extracted from the unsaturated zone.	Saturated zone is not uniform which can result in uncontrolled movement of potentially hazardous vapors. Soil heterogeneity may cause some zones to be unaffected by treatment. Impacted zones likely would not be uniformly treated.	Low	Moderate	High	No
	Chemical Oxidation	introduction of an oxidant into the subsurface through the existing impacted monitoring well (1349MW100) and additional locations. Upon contact,	Oxidant contact with contaminant is limited by diffusion in soils and weathered bedrock with low permeability like clays and silts. Other limitations include handling large quantities of chemicals and the potential for naturally occuring metals solubility.	Low	Moderate	High	No
	Pump and Treat	the vicinity of the groundwater impacts	Method is not effective due to low and intermittent permeability of aquifer and low and variable specific yields of aquifer rates.	Low	Moderate	High	No

### Note: Definitions for Effectiveness, Implementability and Cost.

**Technical Effectiveness**: Technical effectiveness refers to the ability of a technology to address: 1) the estimated area or volumes of media requiring remediation to meet the RAOs; 2) the potential impacts to human health and the environment during implementation and any construction; and 3) the long-term reliability and proven history of the technology with respect to the types of chemicals and conditions at the sites.

**Implementability**: Implementability refers to both the technical and institutional feasibility of implementing a particular remedial technology, including: 1) the likelihood of obtaining permits and approvals from regulatory agencies; 2) availability of appropriate treatment, storage, and disposal facilities (TSDFs); and 3) availability of the equipment, materials and skilled workers necessary to implement the particular technology.

Cost-Effectiveness: Cost-effectiveness includes assessing the relative capital and operation and maintenance (O&M) costs associated with a particular technology. Costs are estimated using best engineering judgment at the time of the estimate. Cost-effectiveness weighs required expenditures against potential benefits, and is used to eliminate options that are substantially more expensive than other process options providing the same level of protection.

			Shallow Soil Remed	lial Unit Alternatives	
		No Action	Excavation and Off-Site Disposal	Capping	Land-Use Controls
Remedial Units	CAP Evaluation Criteria	is to provide no additional control or protection to human health or the environment for contamination that exists in	Objective. The objective of this alternative is to remove soil contamination and dispose of waste materials off-site at a permitted recycling and/or disposal facility, as appropriate.	Objective. The objective of this alternative is to install a cap at the surface. Land Use Controls will be put in place to restrict access to the impacted areas.	<b>Objective.</b> The objective of this alternative is to maintain existing ground cover and prevent exposure to contamination.
	1) Technical Effectiveness	volumes of impacted soil requiring remediation and contaminant mass reduction would be limited to natural degradation.  This alternative does not protect human health and the environment.	volume of impacted soil requiring	Soil is impacted 2 feet bgs and deeper. This alternative would be effective in minimizing future infiltration of surface water through the impacted soil to groundwater and limiting exposure of humans and ecological receptors to contamination. Contamination would remain in-place in soil.	Soil is impacted 2 feet bgs and deeper. This alternative would be effective in minimizing exposure of humans and ecological receptors to contamination but would not be effective in minimizing future infiltration of surface water through the impacted soil to groundwater. Contamination would remain in-place in soil.
Shallow Soil	2) Implementability	technology does not require any treatment,	This alternative is easily implementable and would require on-going groundwater monitoring and maintenance of the LUC. Two wells would be installed to the north and west of well 1349MW100.	This alternative is technically feasible. Soil will be excavated 2-3 feet and properly disposed before construction of the cap. Contaminant mass reduction would be limited to the biodegradation rate, which may be affected by the lack of recharge of nutrients and moisture. This alternative would require long-term maintenance of the cap and land use controls.	This alternative is readily implementable. Contaminant mass reduction would be limited to the biodegradation rate. This alternative would require long-term maintenance of the land use controls.
	3) Cost-Effectiveness		This alternative has a higher cost to implement but provides a greater level of protection of human health and the environment than the no action alternative.	This alternative has moderate capital costs associated with the capping of the surface soil but would require long-term O&M costs making it a higher cost alternative.	This alternative is relatively low in capital costs and provides a moderate level of protection for human health and the environment. This alternative would require O&M annual costs.
			lar a to	Liver of the second	Liver of the Control
Summary of Evaluation Criteria for Shallow Soil		Concentrations in soil are greater than applicable cleanup levels and may pose an unacceptable risk to human health and the environment.	Alternative is Recommended as the Preferred Remedy for the Shallow Soil RU. This alternative would provide a permanent solution and removes the impacted soil to levels below applicable cleanup standards.	Alternative is Not Recommended. Concentrations in soil are greater than applicable cleanup levels and protection of human health and ecological receptors relies on long-term O&M of cap and land use controls. Contamination remains in-place in soil.	Alternative is Not Recommended. Concentrations in soil are greater than applicable cleanup levels and protection of human health and ecological receptors relies on long-term maintenance of land use controls. Contamination remains in-place in soil.

			Deep Soil Remedial Unit Alternatives	
		No Action	Excavation and Offsite Disposal	Subsurface Capping
	CAP Evaluation	<b>Objective.</b> The objective of this alternative is to provide	<b>Objective.</b> The objective of this alternative is to remove	<b>Objective.</b> The objective of this alternative is to install a
Remedial Units	Criteria	no additional control for contamination that exists in the	soil contamination and dispose of waste materials off-site	cap at approximately 10 feet bgs (assuming that the
	Criteria	soil at the Building 1349 Area beyond naturally-occurring	at a permitted recycling and/or disposal facility, as	Shallow Soil RU is excavated to 10 feet bgs). Land Use
		degradation.	appropriate.	Controls will be put in place to restrict access to the
				impacted deep soil.
	1) Technical	This alternative will not be able to address the area or	J 1	This alternative would be effective in minimizing future
	Effectiveness	volumes of impacted soil requiring remediation and	on-going groundwater monitoring and maintenance of the	infiltration of surface water through the impacted soil to
		contaminant mass reduction would be limited to natural	LUC. Two wells would be installed to the north and west	groundwater. Contamination would remain in-place in
		degradation. This alternative would not be effective in	of well 1349MW100.	soil.
		reducing chemical concentrations to levels protective of		
	2) Implementability	groundwater.  This alternative is unlikely to obtain approvals from	This alternative would likely obtain approvals from	This alternative is technically feasible if the shallow soils
	2) implementability	regulatory agencies. This technology does not require any	regulatory agencies. Appropriate TSDFs for off-site	are excavated as part of the remediation of the Shallow
		treatment, storage, and disposal facilities of material	disposal of excavated soil are available. The equipment,	Soil RU (preferred alternative is excavation). Before the
		areament, storage, and disposal racinates of material	materials, and skilled workers for excavation and off-site	excavation is backfilled an impermeable cap will be
D 0.1			disposal of impacted soil are readily available. There is a	constructed at approximately 10 feet bgs. Contaminant
Deep Soil			possibility that excavation will not be feasible due to	mass reduction would be limited to the biodegradation
			presence of bedrock or slope stability.	rate, which may be affected by the lack of recharge of
				nutrients and moisture. This alternative would require
				long-term maintenance of the cap and land use controls.
				This alternative would require long-term maintenance of
				the cap and land use controls to safeguard the integrity of
	2) G ( F99 (1			the cap.
	3) Cost-Effectiveness	Although relatively low to no cost, this remedy provides	This alternative has a moderate capital cost to implement	This alternative has a high cost associated with the
		very little protection to groundwater resources.	but provides a greater level of protection for groundwater resources than the no action alternative.	capping of the deep soil at a depth below ground surface and would require long-term O&M costs.
			resources than the no action alternative.	and would require long-term O&W costs.
		I.	L	
		Alternative is Not Recommended. Concentrations in soil		Alternative is Not Recommended. Concentrations in soil
		are greater than applicable cleanup levels and may pose an	for the Deep Soil RU. This alternative would provide a	are greater than applicable cleanup levels and protection of
		unacceptable risk to groundwater resources.	permanent solution and removes the impacted soil to	groundwater relies on long-term O&M of cap and land use
			levels below applicable cleanup standards. If bedrock	controls. Contamination remains in-place in soil.
Summary of Evaluation Criteria for Deep Soil			conditions preclude excavation of all impacted soil, the	
			contamination will be left in-place and groundwater	
			monitoring will be conducted to confirm that groundwater	
			is not impacted by soil COCs. Current and historical groundwater data from well 1349MW103 demonstrate that	
			groundwater data from well 1349MW 103 demonstrate that soil has not impacted groundwater in the area.	
			son has not impacted groundwater in the area.	

	Telecommunications Corridor Remedial Unit Alternatives									
		No Action	Excavation and Offsite Disposal	Capping	Land Use Controls					
Remedial Units	CAP Evaluation Criteria	Objective. The objective of this alternative is to provide no additional control or protection to human health or the environment for contamination that exists in the soil at the Building 1349 Area beyond naturally-occurring degradation.	Objective. The objective of this alternative is to remove soil contamination and dispose of waste materials off-site at a permitted recycling and/or disposal facility, as appropriate.	Objective. The objective of this alternative is to install a cap at the surface. Land Use Controls will be put in place to restrict access to the impacted areas.	Objective. The objective of this alternative is to maintain existing ground cover and prevent exposure to contamination.					
	1) Technical Effectiveness	This alternative will not address the area or volumes of impacted soil requiring remediation and contaminant mass reduction would be limited to natural degradation. This alternative does not protect human health and the environment.	This alternative is able to address the entire area and volume of impacted soil requiring remediation. Potential adverse impacts to human health and the environment during implementation can be readily mitigated using standard construction practices (e.g., dust control during excavation). Excavation and off-site disposal has a proven history with respect to the constituents of concern at the site.	This alternative would be effective minimizing infiltration of surface water through the impacted soil to groundwater, except for minor infiltration from water within the conduit, and limiting exposure of humans and ecological receptors to	Soil is impacted 3 feet bgs and deeper. This alternative would be effective in minimizing exposure of humans and ecological receptors to contamination but would not be effective in minimizing future infiltration of surface water through the impacted soil to groundwater.  Contamination would remain in-place in soil.					
Telecommunications Conduit Soil	2) Implementability	This alternative is unlikely to obtain approvals from regulatory agencies. This technology does not require any treatment, storage, and disposal of materials.	This alternative is easily implementable and would require on-going groundwater monitoring and maintenance of the LUC. Two wells would be installed to the north and west of well 1349MW100.	This alternative is technically feasible. Soil will be excavated 2-3 feet and properly disposed before construction of the cap. Contaminant mass reduction would be limited to the biodegradation rate, which may be affected by the lack of recharge of nutrients and moisture. This alternative would require long-term maintenance of the cap and land use controls.	This alternative is readily implementable. Contaminant mass reduction would be limited to the biodegradation rate. This alternative would require long-term maintenance of the land use controls.					
	3) Cost-Effectiveness	Although relatively low to no cost, this remedy provides no protection to human health and the environment.	This alternative has a higher cost to implement but provides a greater level of protection of human health and the environment than the no action alternative.	soil and would require long-term O&M	This alternative is relatively low in cost and provides a moderate level of protection for human health and the environment. This alternative would require O&M costs.					
Summary of Evaluation Criteria for Telecommunications Conduit Soil		Alternative is Not Recommended.  Concentrations in soil are greater than applicable cleanup levels and may pose an unacceptable risk to human health and the environment.	Alternative is Recommended as the Preferred Remedy for the Telecommunications Soil RU. This alternative would provide a permanent solution and removes the impacted soil to levels below applicable cleanup standards. If bedrock conditions preclude excavation of all impacted soil, the contamination will be left in-place and groundwater monitoring will be conducted to address groundwater impacts in the vicinity of well 1349MW100.	human health and ecological receptors	Alternative is Not Recommended.  Concentrations in soil are greater than applicable cleanup levels and protection of human health and ecological receptors relies on long-term maintenance of land use controls. Contamination remains in-place in soil.					

			Groundwater Remedial Unit Alternatives	
		No Action	Groundwater Monitoring	Land Use Controls
Remedial Units	CAP Evaluation Criteria	<b>Objective.</b> The objective of this alternative is to provide no additional control or protection to human health or the environment for contamination that exists in groundwater at the Building 1349 Area. It includes abandoning the current groundwater monitoring network and terminating groundwater monitoring.	Objective. The objective of this alternative is to monitor groundwater to assess attainment of cleanup levels, confirm the extent of the plume, and assess if selected soil remedies have a positive effect on the dissolved-phase concentrations. A Land Use Control (LUC) would be implemented to restrict use of groundwater as a drinking water supply until cleanup levels are attained.	Objective. The objective of this alternative is to restrict usage of groundwater.
	1) Technical Effectiveness	This alternative will not address the dissolved-phase concentrations exceeding the cleanup levels. Although use of groundwater is unlikely, this alternative is not effective in maintaining beneficial use of groundwater as a drinking water supply. This alternative will not confirm if natural degradation of COCs is occurring.	This alternative is effective in adequately monitoring the spatial distribution and COC concentrations over time of the dissolved-phase plume and confirm if natural degradation is occurring. By installing two new groundwater wells to the north and west of well 1349MW100, the extent of impacts can be evaluated. The Five-Year Status Report will demonstrate effectiveness of remedy to achieve cleanup levels.	This alternative will not address the dissolved-phase concentrations exceeding the cleanup levels. Although use of groundwater is unlikely, this alternative is not effective in maintaining beneficial use of groundwater as a drinking water supply.
Groundwater	2) Implementability	This alternative is unlikely to obtain approvals from regulatory agencies and is not in accordance with the RWQCB plans and policies. This technology does not require any treatment, storage, and disposal of material.	This alternative is easily implementable and would require on-going groundwater monitoring and maintenance of the LUC. Two wells would be installed to the north and west of well 1349MW100.	This alternative is unlikely to obtain approvals from regulatory agencies and is not in accordance with the RWQCB plans and policies. This technology does not require any treatment, storage, and disposal of material. This alternative requires long-term maintenance of the land use controls.
	3) Cost-Effectiveness	Although relatively low to no cost, this remedy provides very little protection of groundwater as a domestic supply.	This alternative has a high cost.	Although relatively low cost, this remedy provides very little protection of groundwater as a domestic supply.
Summary of Evaluation Criteria for Groundwater		Alternative is Not Recommended. Concentrations in groundwater are greater than applicable cleanup levels. This alternative is not in accordance with RWQCB plans and policies.	Alternative is Recommended as the Preferred Remedy for the Groundwater RU. Based on the localized nature of the groundwater impacts and the concentrations of TPH and OCPs, this alternative is reasonable and the additional groundwater monitoring would be conducted to confirm attainment of cleanup levels or demonstration of decreasing COC trends. Monitoring will also determine if natural degradation processes are occurring. The Five-Year Status Report will demonstrate the effectiveness of the remedy. An LUC will be implemented in conjuction with monitoring during the initial 5-year period to restrict localized use of groundwater. Applicability of continued need for LUCs will be evaluated as part of the Five-Year Status Report pending results of groundwater monitoring.	Alternative is Not Recommended. Concentrations in groundwater are greater than applicable cleanup levels. This alternative is not in accordance with RWQCB plans and policies.

### Table 5-1 Proposed Soil Confirmation Sampling and Analysis Summary Building 1349

### Presidio of San Francisco, California

	Depth	Estimated	Estimated	Estimated Volume			nfirmation Soil Samples <sup>(1,2)</sup> Total Number of		Chemical Analyses (3)			
Remedial Units	(Feet)	Surface Area (Square Feet)	Thickness (Feet)	In-Situ (Cubic Yards)	COCs	Bottom	Sidewall	Confirmation Soil Samples	TPHg, TPHd, TPHfo	PAHs	Metals	OCPs
Shallow Soil (Area 1)	0 to 7 - 9 feet bgs	2130	7 - 9	630	TPHd, TPHfo B(A)P D(a,h)A, Chrysene	3	15	18 + 2 duplicates	20	20	20	20
Shallow Soil (Area 2)	0 to 3 feet bgs	270	3	30	B(a)P, D(a,h)A	2	8	10 + 1 duplicate	11	11	11	11
Shallow Soil (Area 3)	0 to 10 feet bgs	405	10	150	TPHd	1	8	9 + 1 duplicate	10	10	10	10
Deep Soil	10 to 22 feet bgs	70	12	30	TPHd	1	4	5 + 1 duplicate	6	6	6	6
Telecommunications Corridor Soil	0 to 16 feet bgs	960	16	570	TPHd, PAHs	2	24	26 + 3 duplicates	29	29	29	29

### Notes

- 1 Confirmation soil samples may change based on observations and actual size of excavation during field activities. Minimum frequency as follows:
  - Sidewall confirmation samples will be collected at a frequency of 1 sample per every 50 linear feet or one sample per sidewall assuming four sidewalls.
  - Bottom confirmation samples will be collected at a frequency of 1 sample per 625 square feet.
- 2 Proposed excavation depths may span more than one cleanup level zone. Sidewall confirmation samples will be collected from the approximate mid-point of each potential cleanup level zone at each excavation area. Potential zones are as follows:
  - Shallow Soil (Area 1): 1 sample per 0-3 feet bgs; 2 samples per 3-10 feet bgs for excavations extending deeper than 8 feet bgs or 1 sample per 3-8 feet bgs for excavations extending to 8 feet bgs or less.
  - Shallow Soil (Area 2): 1 sample per 0-3 feet bgs.
  - Shallow Soil (Area 3): 1 sample per 0-3 feet bgs and 1 sample per 5-10 feet bgs.
  - Deep Soil: 1 sample per >10 feet bgs and bottom of excavation
  - Telecommunications Corridor: 1 sample per 0-3 feet bgs; 1 sample per 3-10 feet bgs; 1 sample per >10 feet bgs and >5 feet above groundwater; and 1 sample within 5 feet of groundwater.
- 3 Chemical analyses will be conducted as follows:
- TPHd/fo/g total petroleum hydrocarbons as diesel, fuel oil, and gasoline USEPA Method 8015 modified and USEPA Method 3630A Silica Gel Cleanup
- PAHs polycylcic aromatic hydrocarbons EPA Method 8270C
- Metals 16 Metals Sb, As, Ba, Be, Cr, Cd, Co, Cu, Fe, Pb, Mn, Ni, Se, Tl, V, and Zn EPA Method 6000/7000 series
- OCPs organochlorine pesticides EPA Method 8081
- B(a)P Benzo(a)Pyrene
- D(a,h)A Dibenzo(a,h)Anthracene
- bgs Below ground surface

### Table 5-2 Proposed Groundwater Sampling Program Building 1349 Presidio of San Francisco, California

Monitoring Well	Well Status	Remedial Unit	Sampling Frequency	General Chemistry (1) (various methods)	Total Petroleum Hydrocarbons by EPA Method 8015 Modified	Polycyclic Aromatic Hydrocarbons by EPA Method 8270C	Volatile Organic Compounds by EPA Method 8260B	Dissolved Metals by EPA Method Series 6000/7000 (2)	Organochlorine Pesticides by EPA Method 8081
1349MW01	Existing Well	Telecommunications Corridor RU and Groundwater RU	Q	x	x	x	x	x	x
1349MW02	Existing Well	Telecommunications Corridor RU and Groundwater RU	Q	x	x	x	X	x	x
1349MW03R	Existing Well	Groundwater RU	Q	X	X	X	x	X	X
1349MW100R	New Well (Replacement for 1349MW100)	Deep Soil RU, Telecommunications Corridor RU, and Groundwater RU	Q	x	x	x	x	x	x
1349MW101	Existing Well	Groundwater RU	Q	X	X	X	X	X	X
1349MW102	Existing Well	Telecommunications Corridor RU and Groundwater RU	Q	x	x	x	x	x	x
1349MW103R	New Well (Replacement for 1349MW103)	Deep Soil RU and Groundwater RU	Q	x	x	x	x	x	x
1349MW104	Existing Well	Deep Soil RU and Groundwater RU	Q	x	x	x	x	x	x
1349MW105	Existing Well	Deep Soil RU and Groundwater RU	Q	x	x	x	x	x	х
1349MW106	New Well	Telecommunications Corridor RU and Groundwater RU	Q	x	x	x	x	x	x
1349MW107	New Well	Telecommunications Corridor RU and Groundwater RU	Q	x	x	x	X	x	x

### Notes

Q - Sampling will occur on a quarterly basis for a minimum of one year. Sampling frequency for all wells will be evaluated and adjusted accordingly for the remainder of the five-year monitoring period based on recommendations listed in Section 5.3.

<sup>(1):</sup> Samples will be analyzed for general chemistry parameters including alkalinity (total), bicarbonate, carbonate, chloride, fluoride, nitrate as N, and sulfate (by various analytical methods); sulfide (EPA 376.2/SW9030); total dissolved solids (EPA 160.1); total organic carbon (TOC; SW 9060); and field parameters pH, DO, conductivity, temperature and turbidity.

<sup>(2): 22</sup> Metals - Al, Sb, As, Ba, Be, Cr, Cd, Ca, Co, Cu, Fe, Pb, Mg, Mn, Ni, K, Ag, Na, Se, Tl, V, and Zn.

### **Figures**







### NOTES:

- 1. DRAWING NOT TO SCALE.
- 2. DATA OBTAINED FROM: DRAFT SITE INVESTIGATION REPORT, TREADWELL AND ROLLO, OCTOBER 2003.


THE PRESIDIO TRUST SAN FRANCISCO, CALIFORNIA


FINAL CORRECTIVE ACTION PLAN BUILDING 1349 STUDY AREA


SITE LOCATION AND SITE STUDY AREA







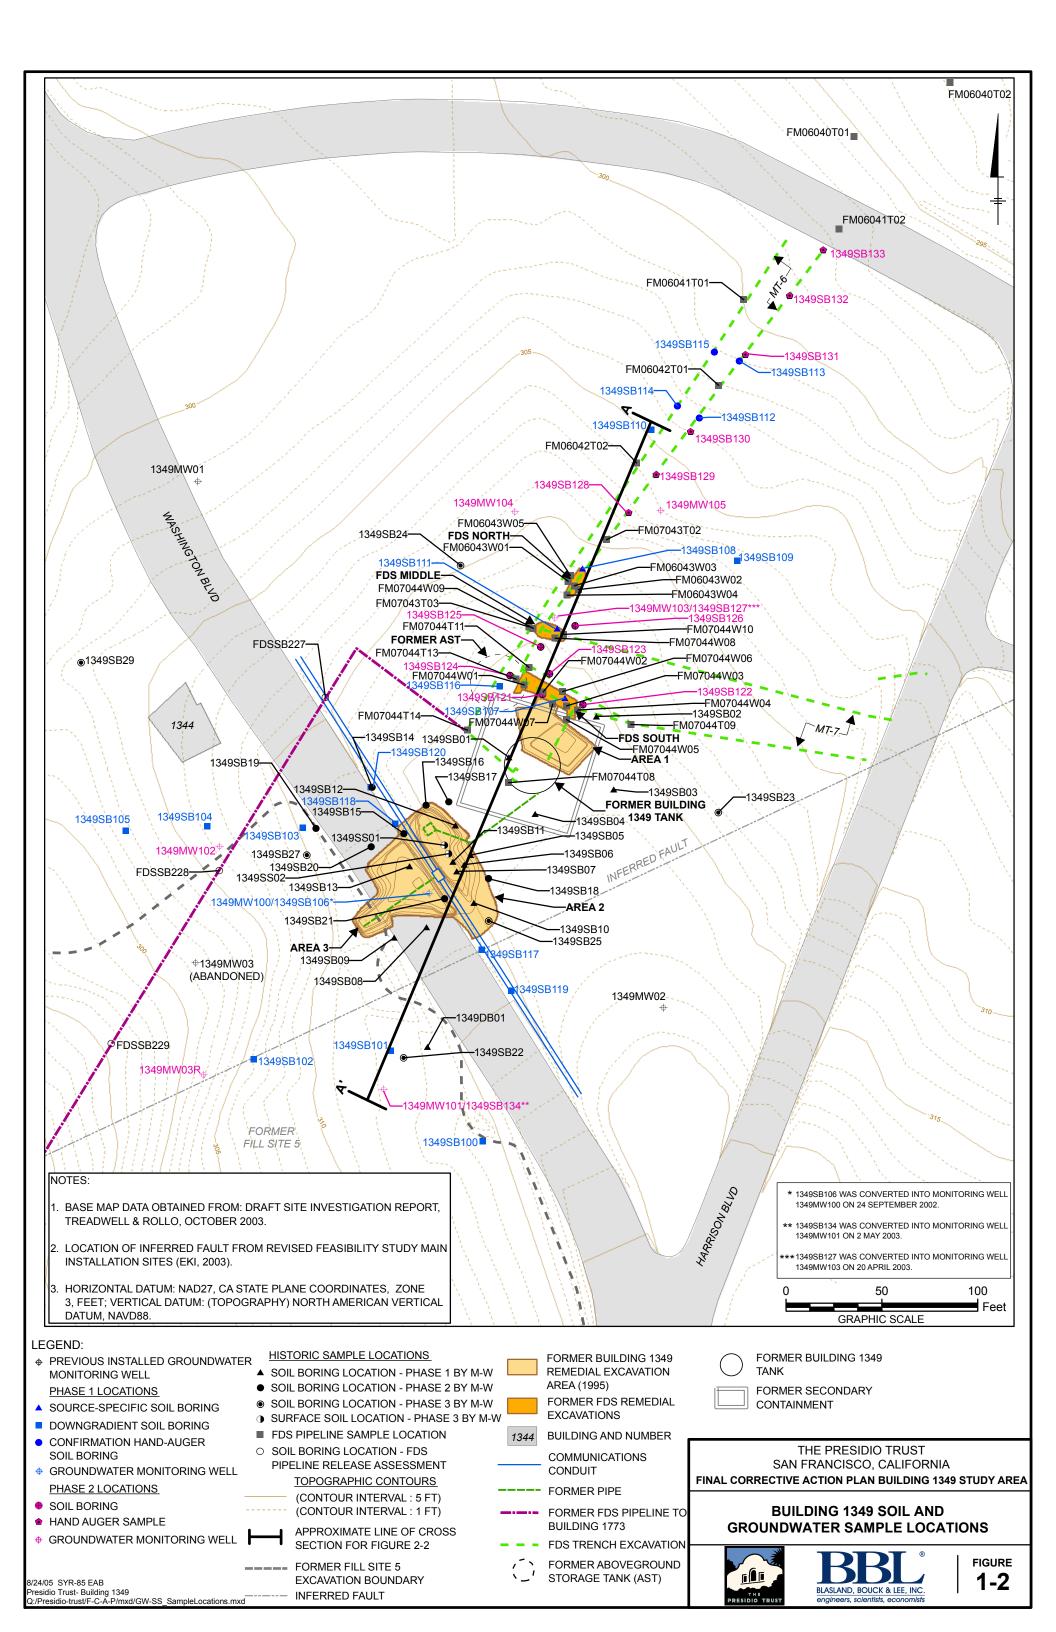


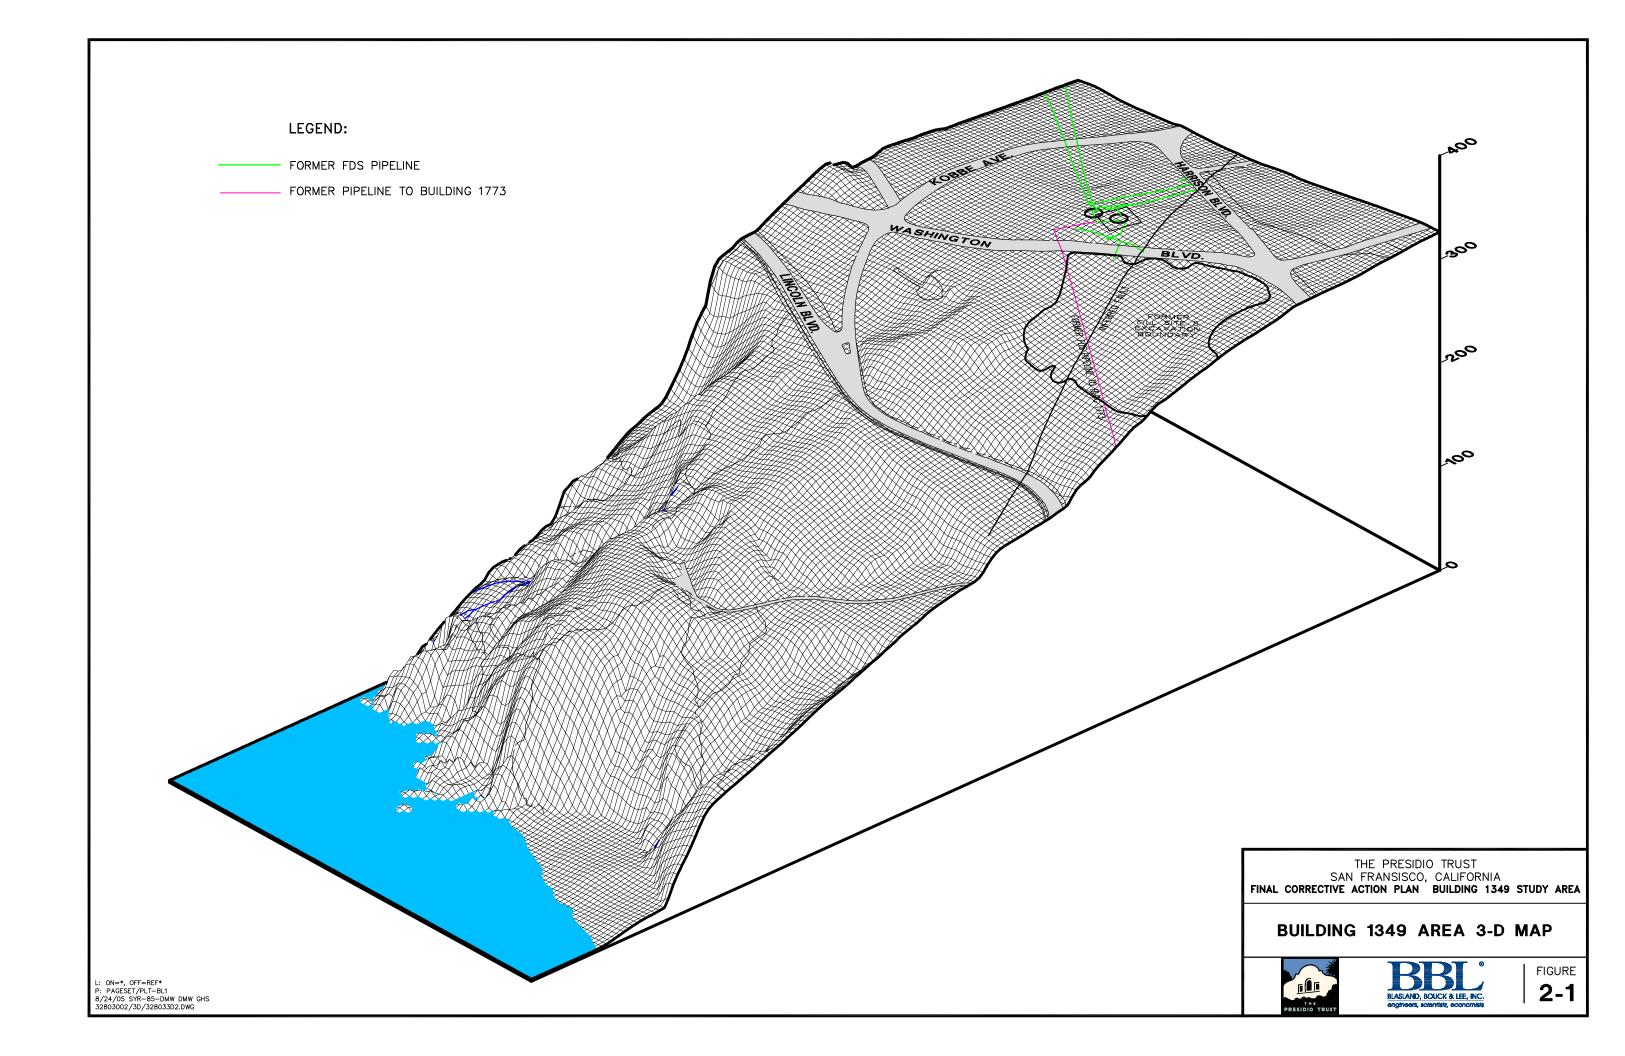


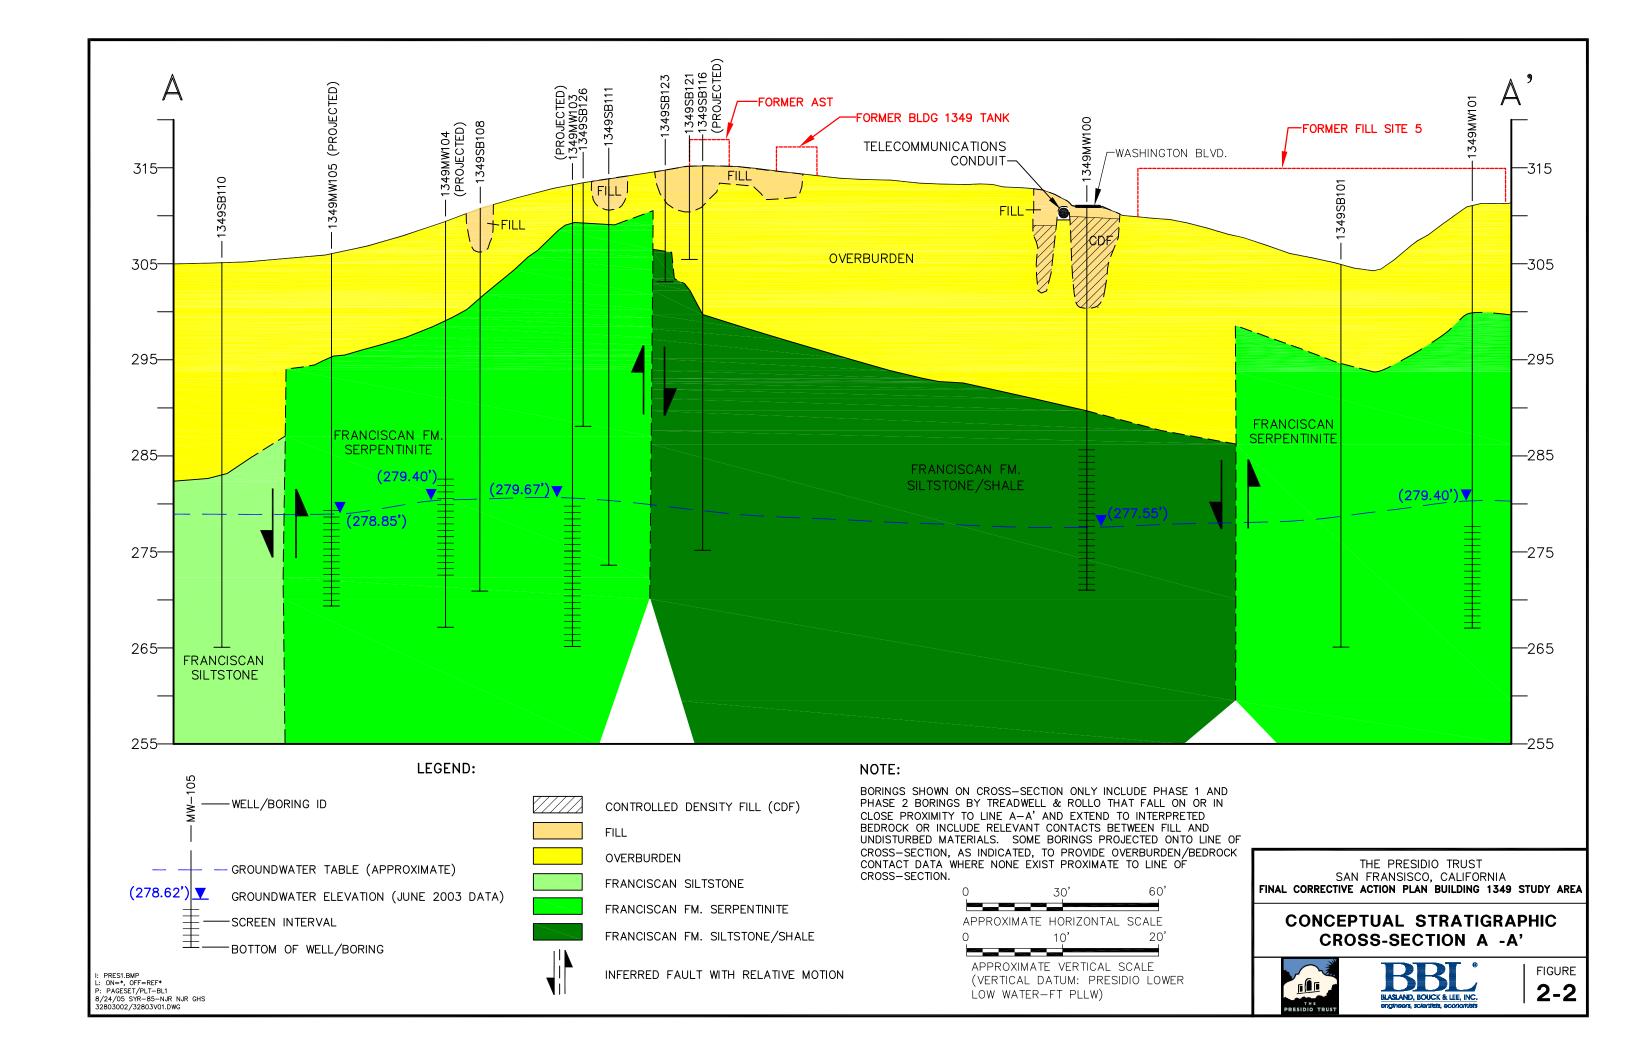


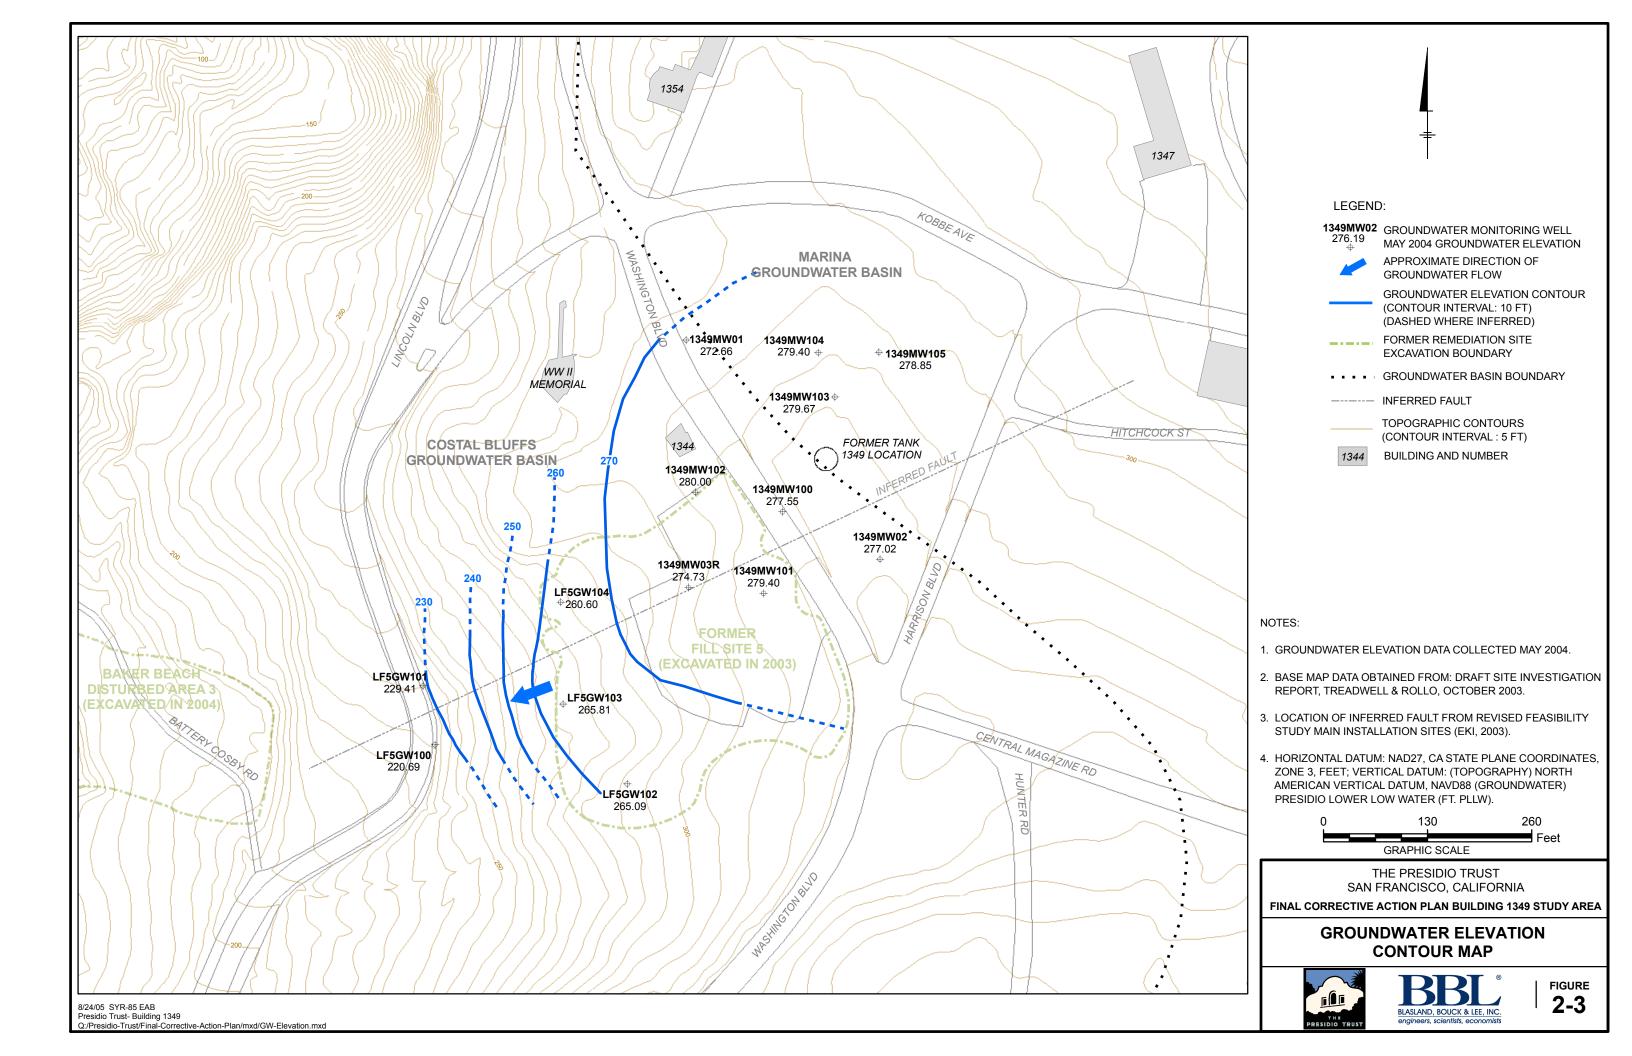


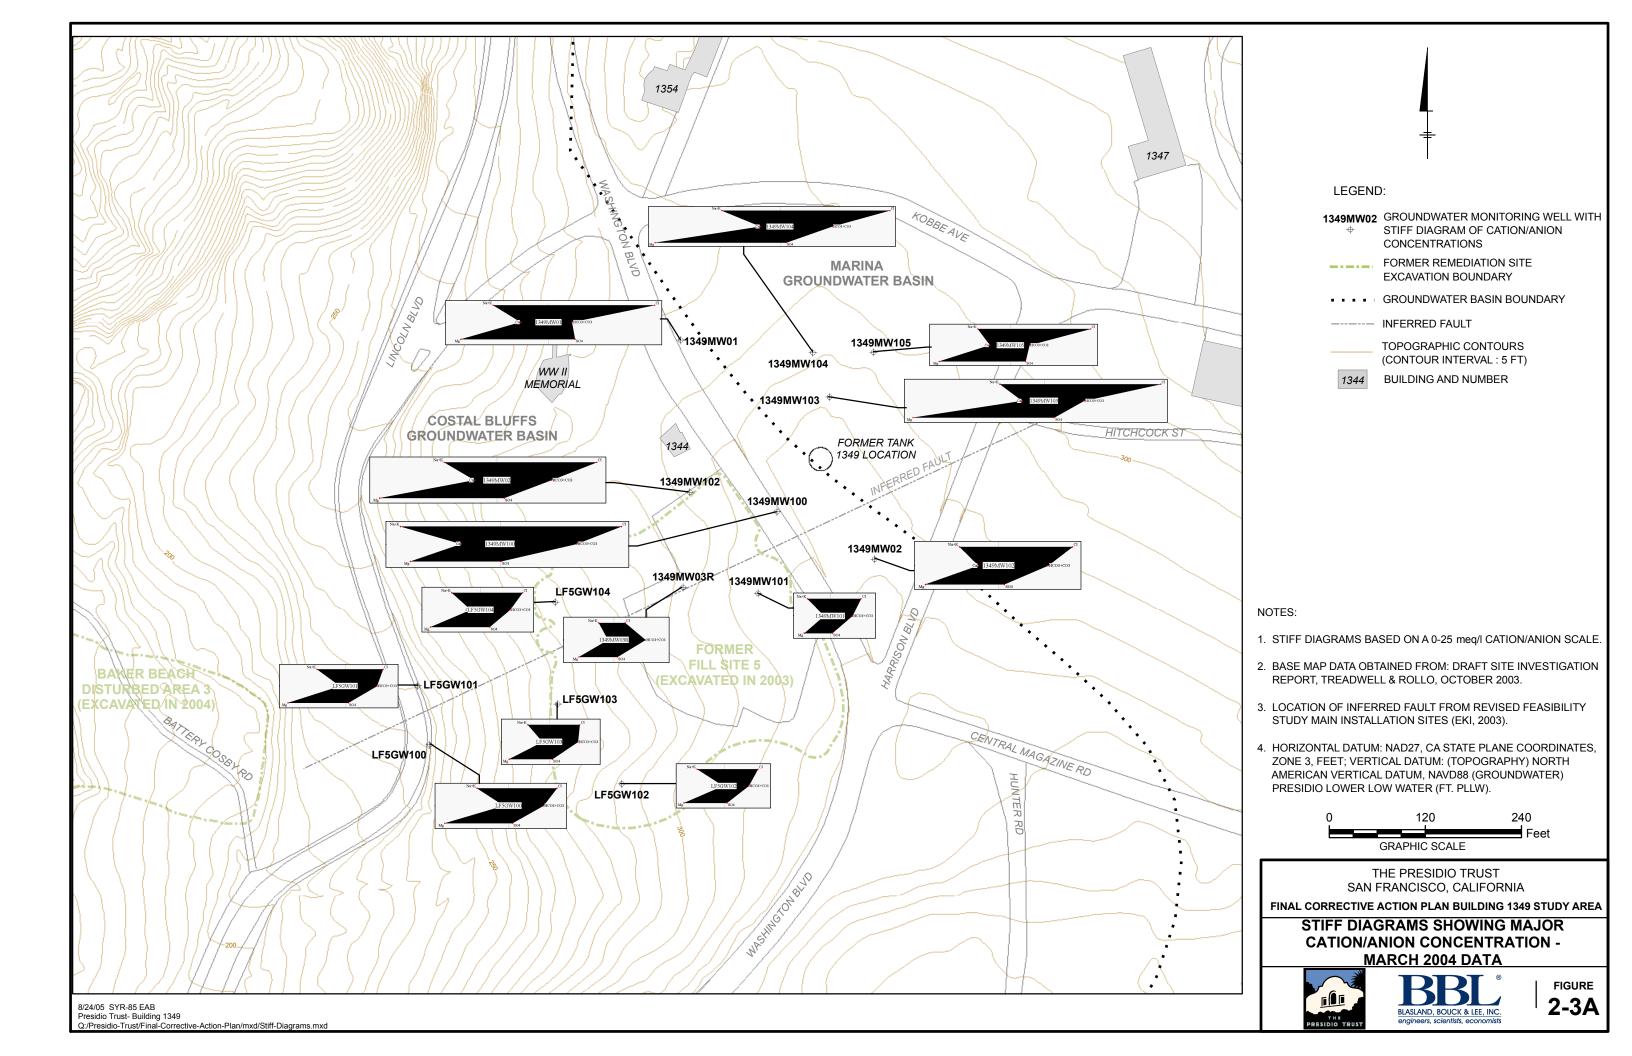

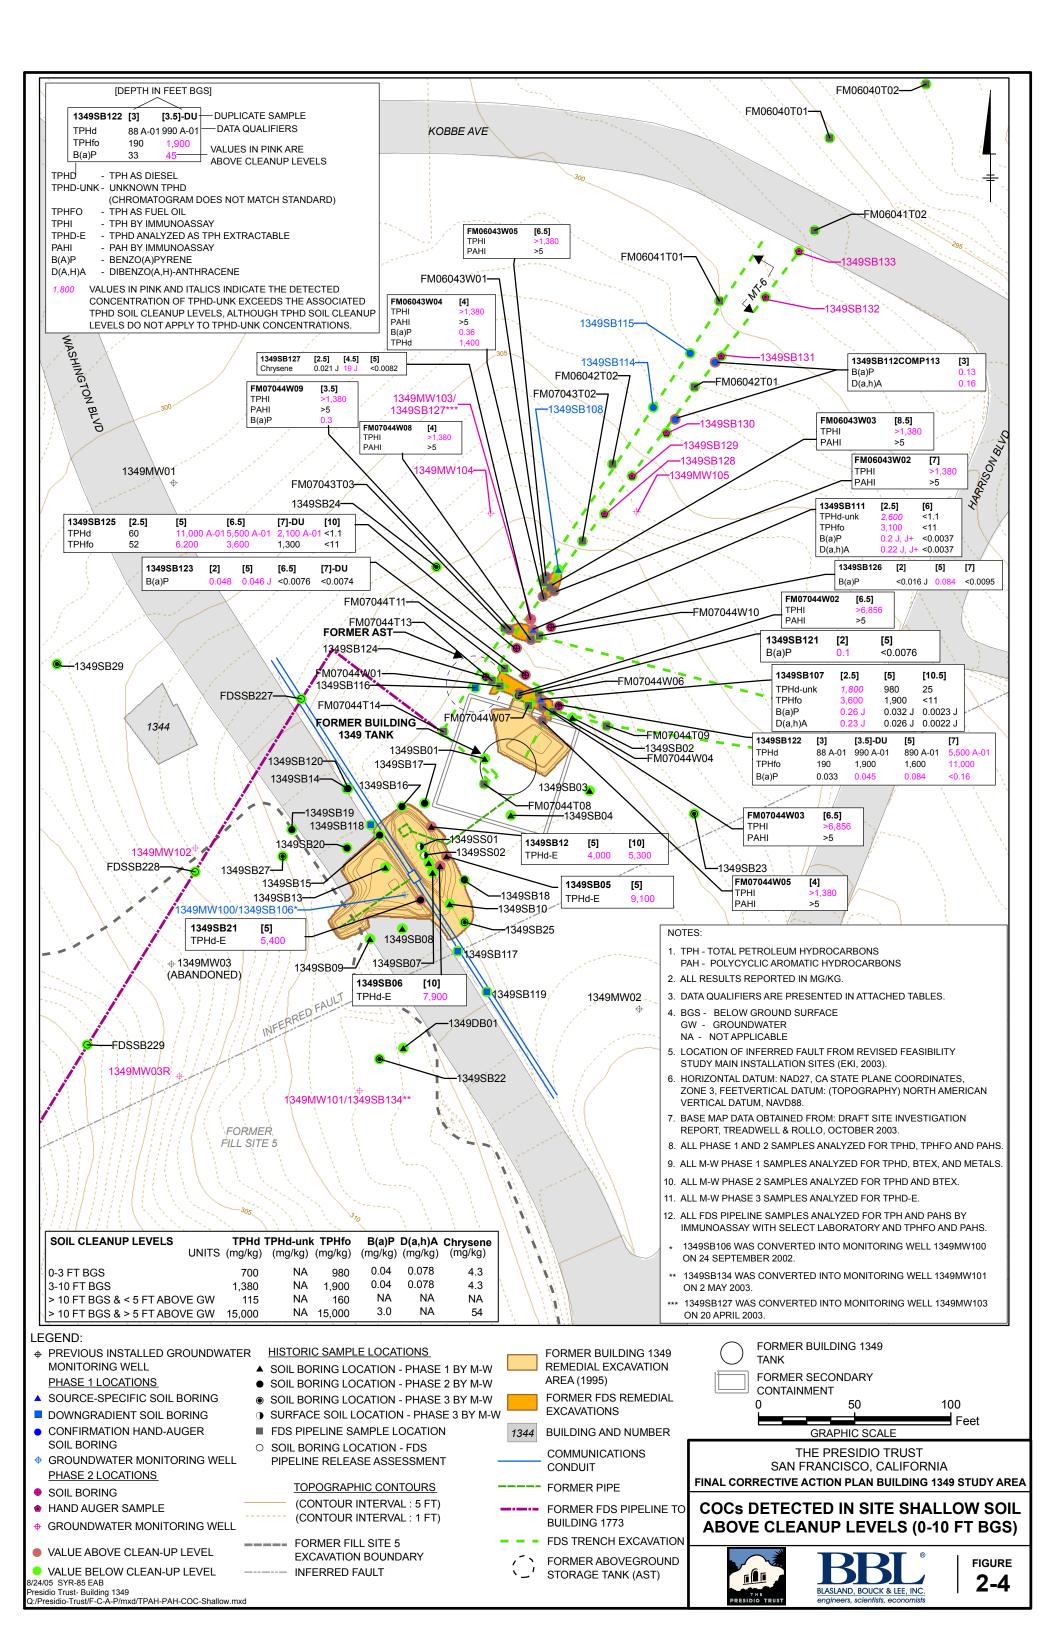


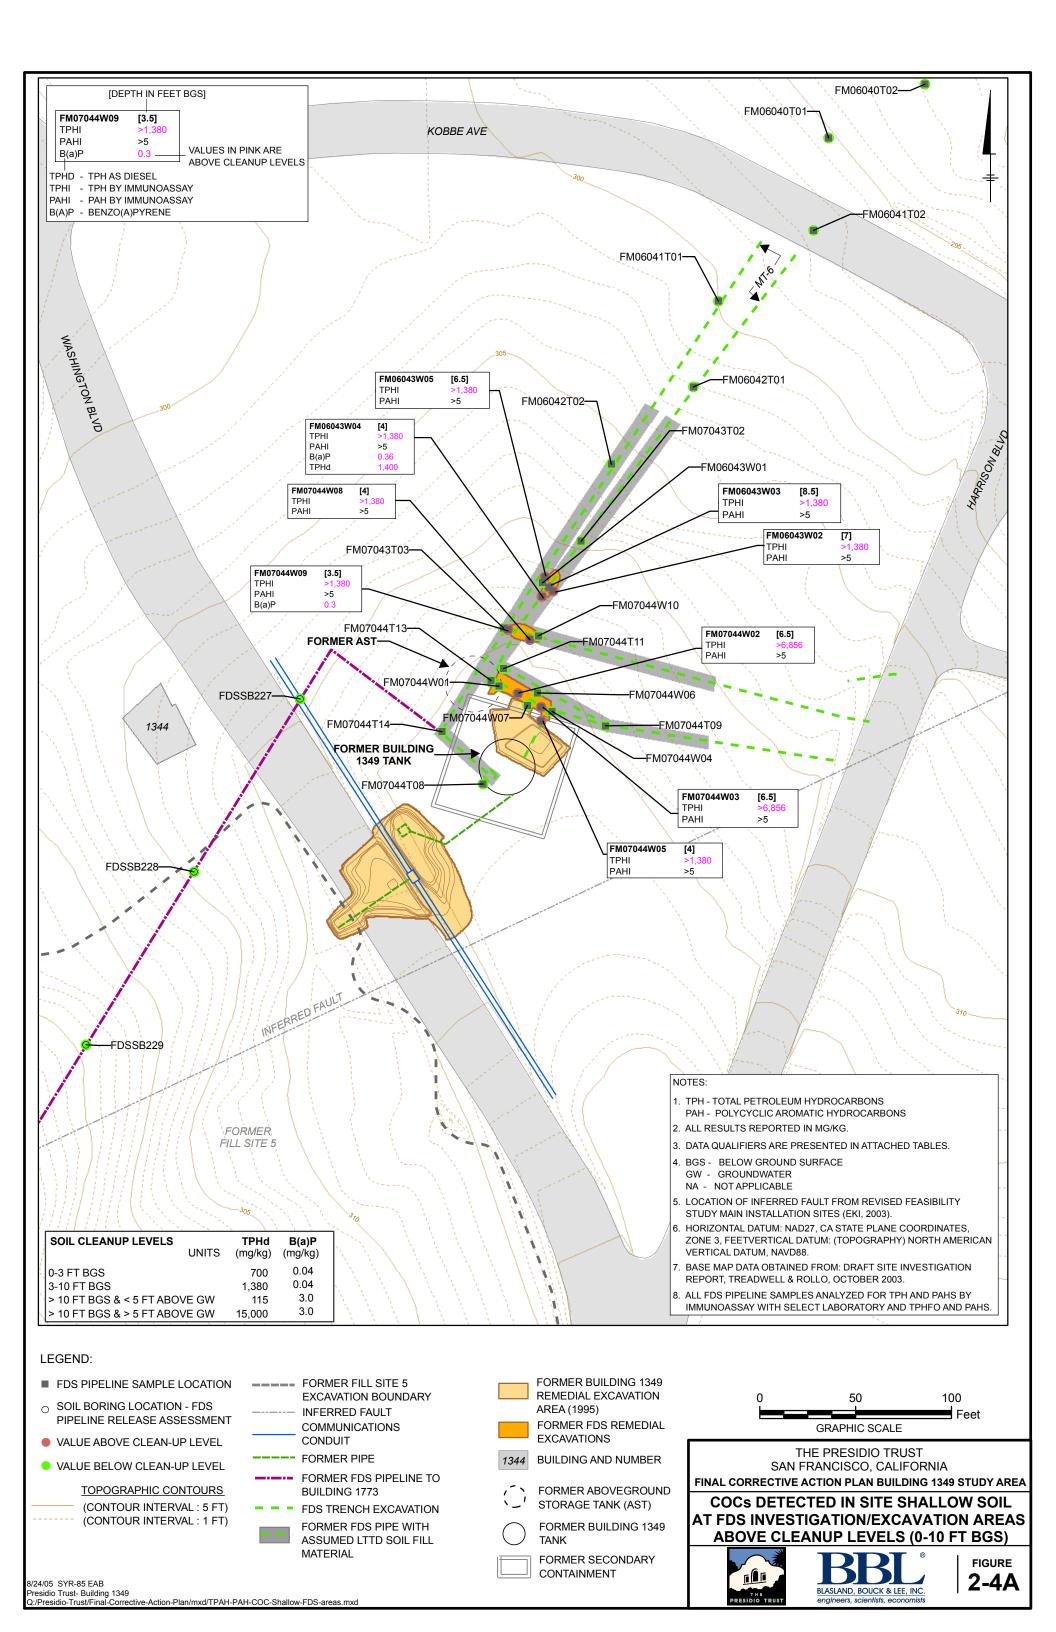


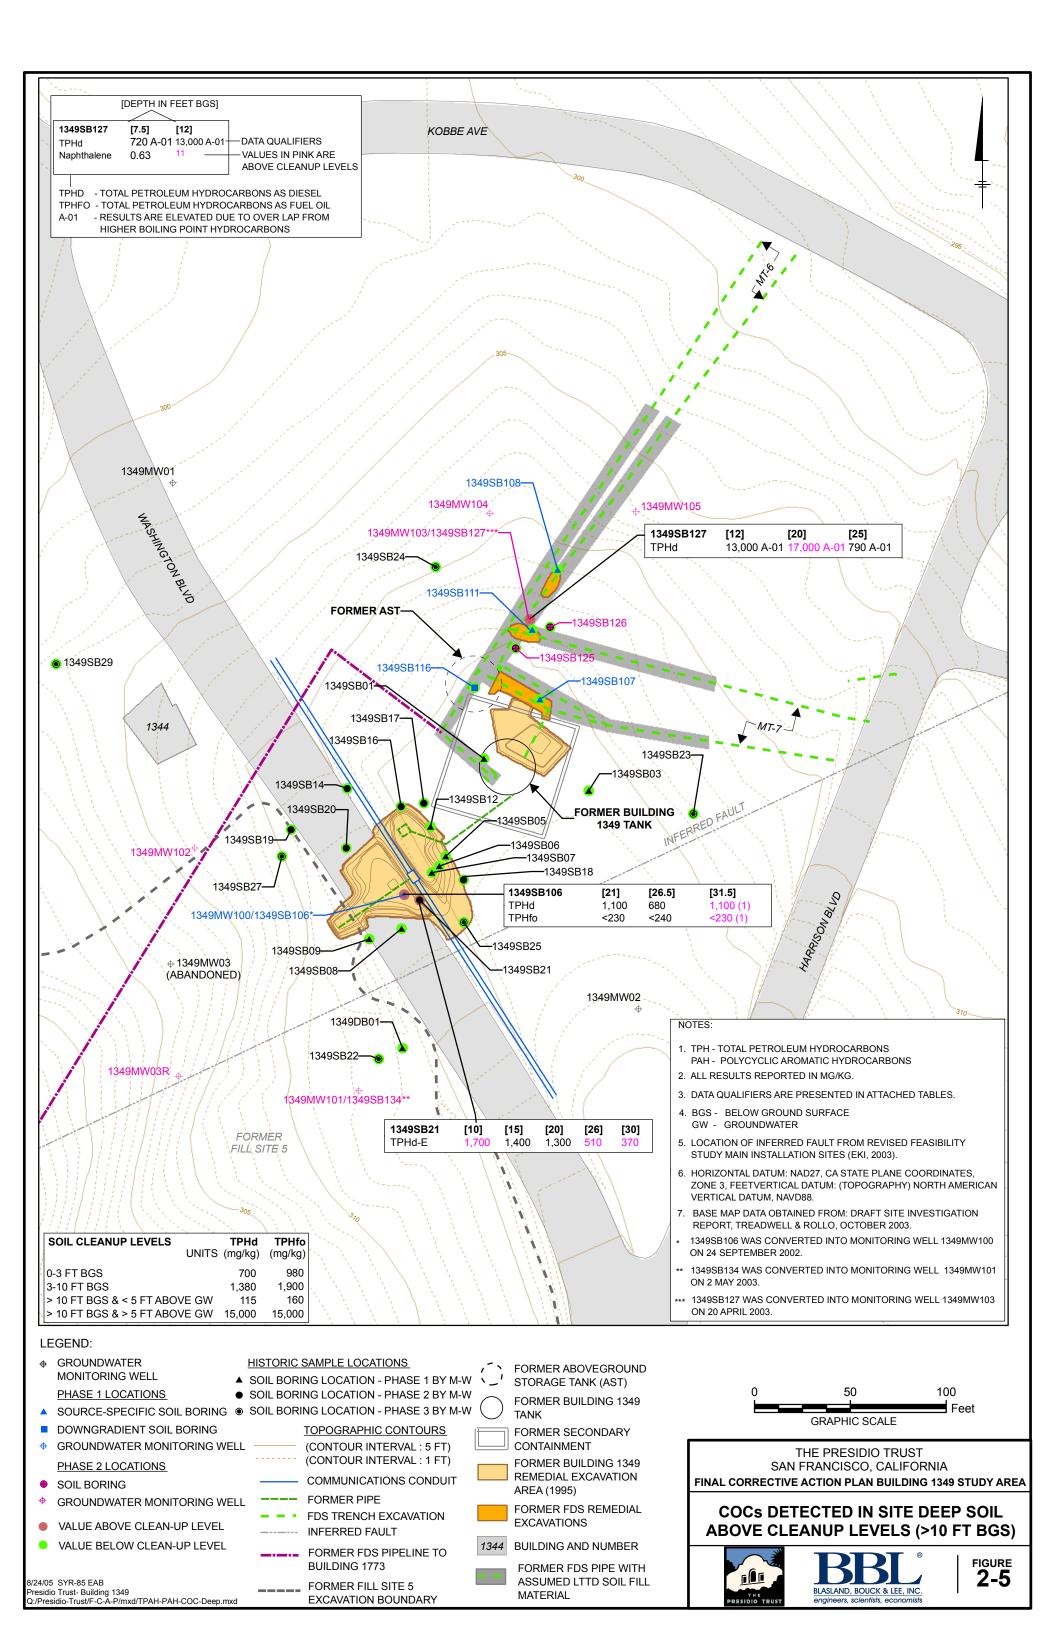

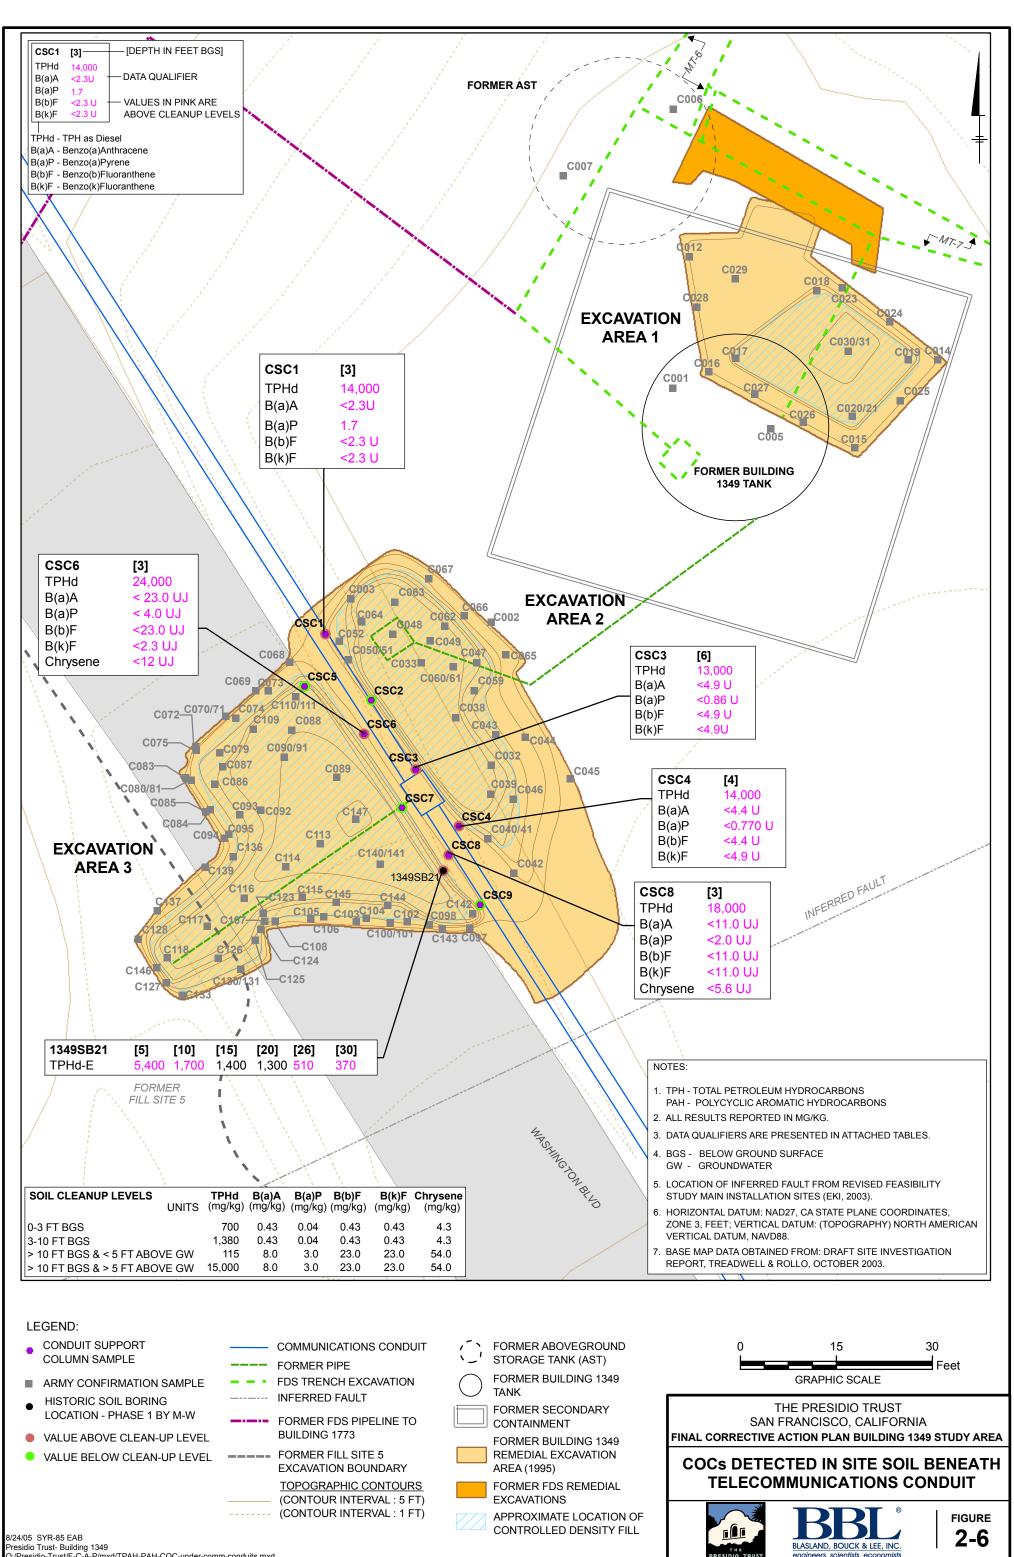



Presidio Trust- Building 1349 Q:/Presidio-Trust/F-C-A-P/mxd/TPAH-PAH-COC-under-comm-conduits.mxd

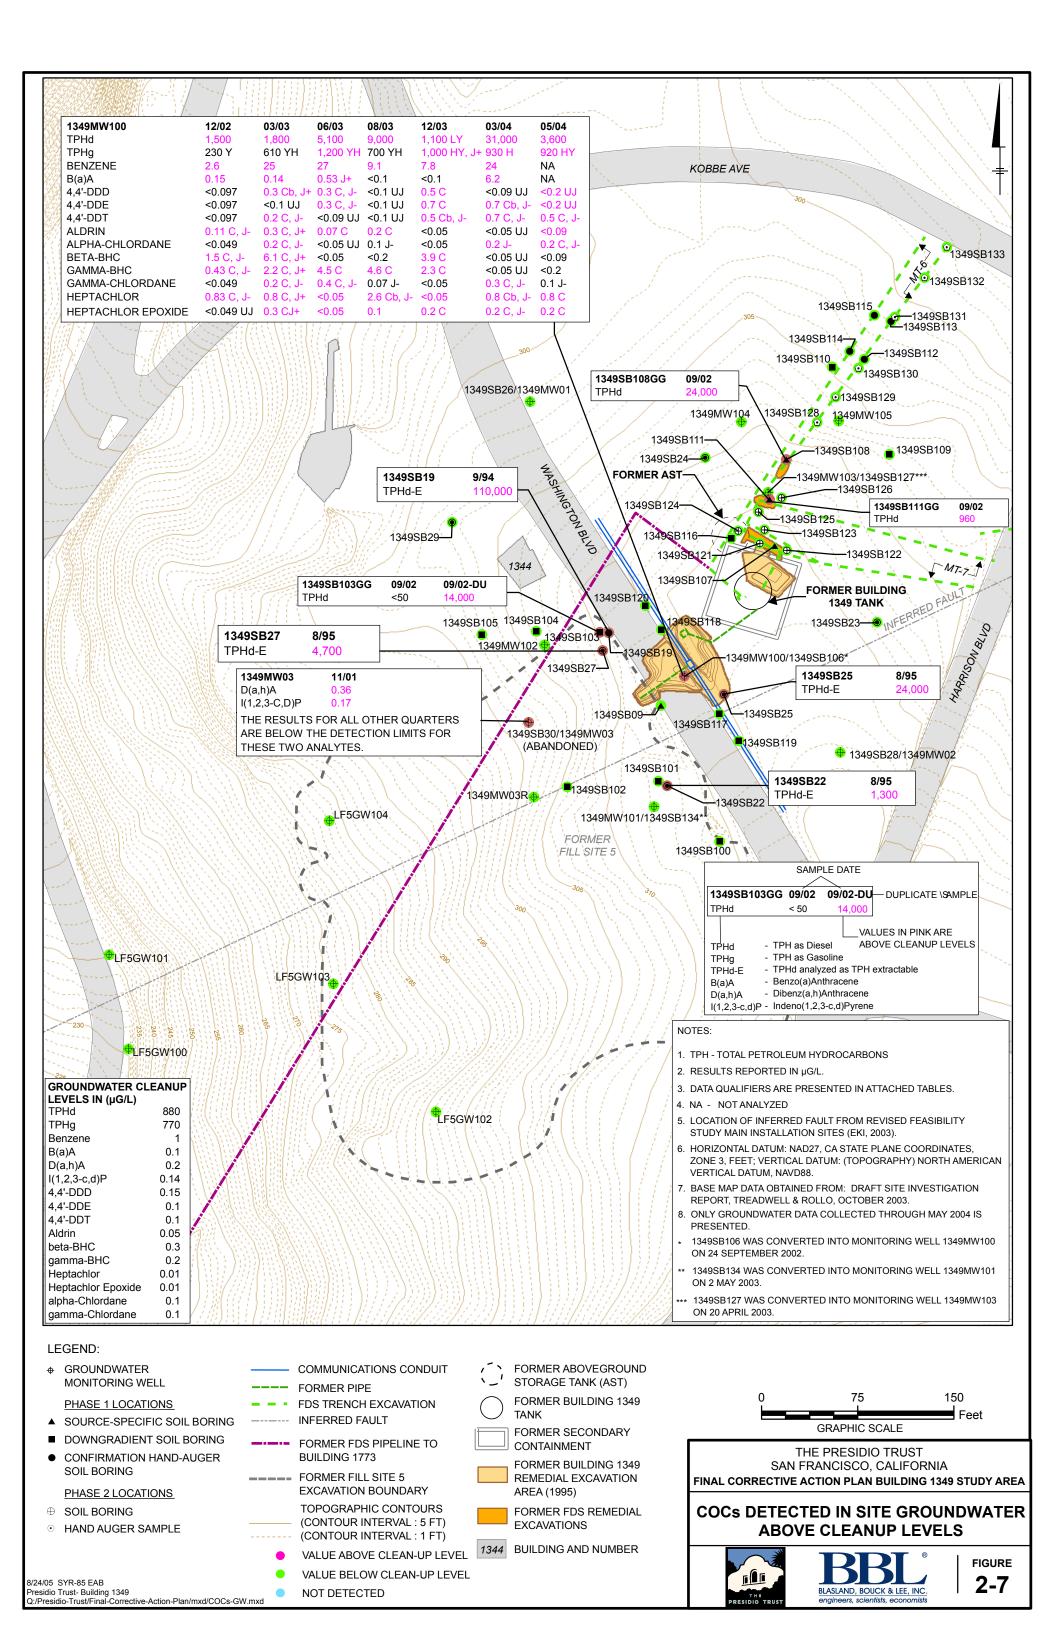


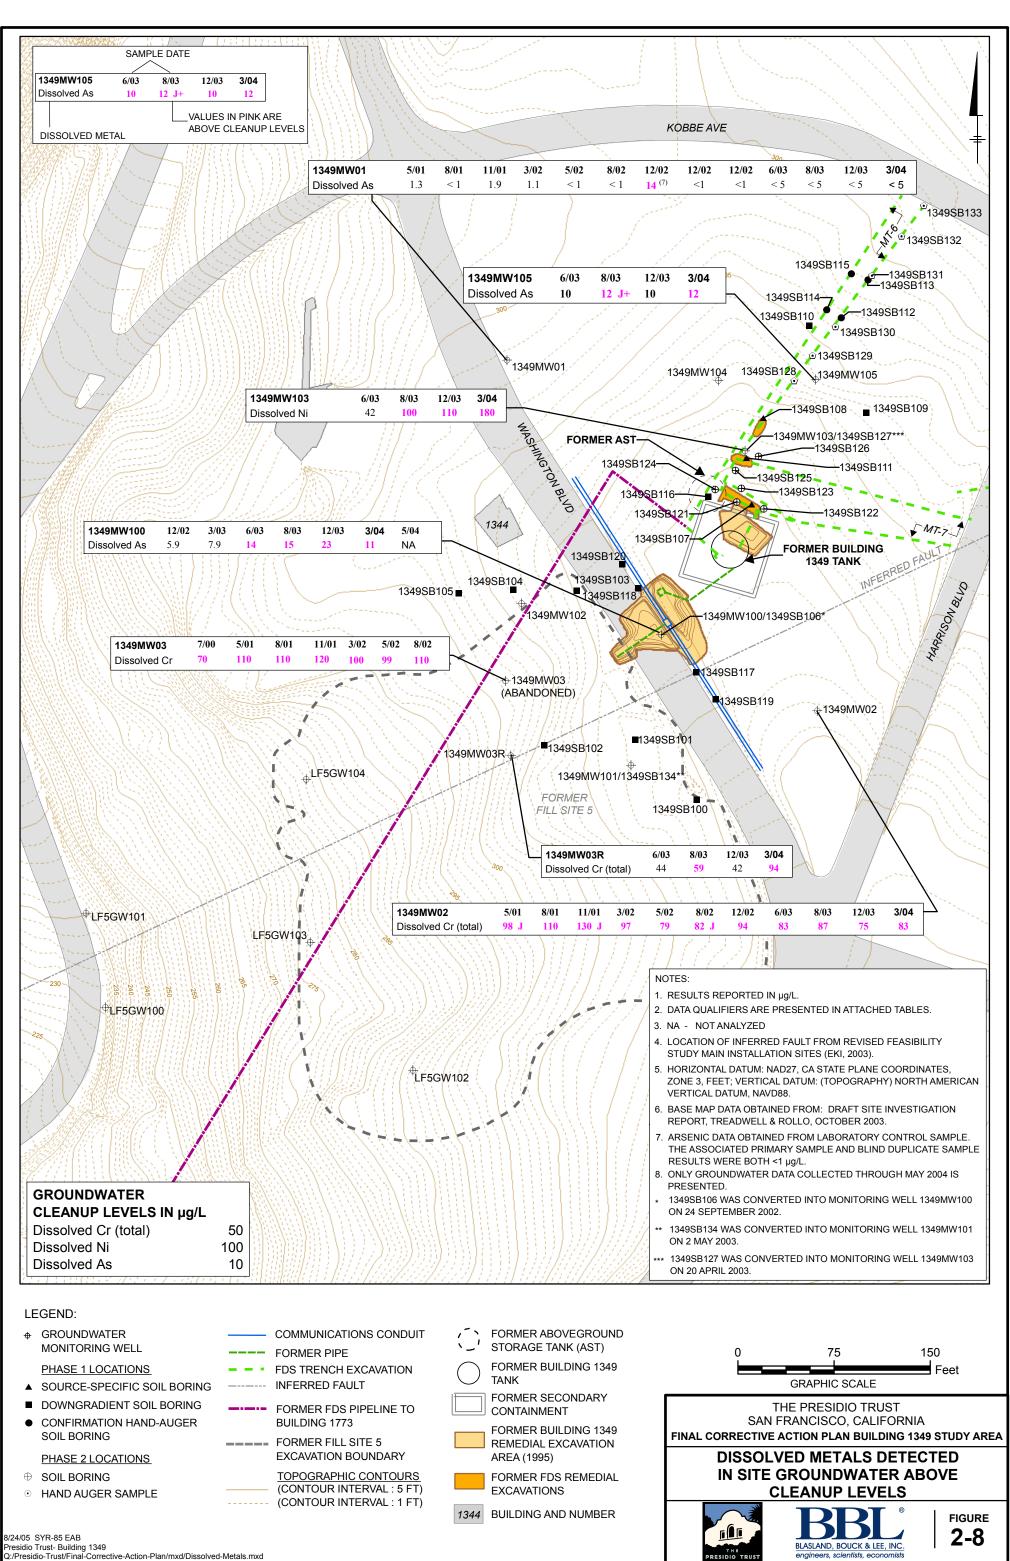

Q:/Presidio-Trust/Final-Corrective-Action-Plan/mxd/Dissolved-Metals.mxd

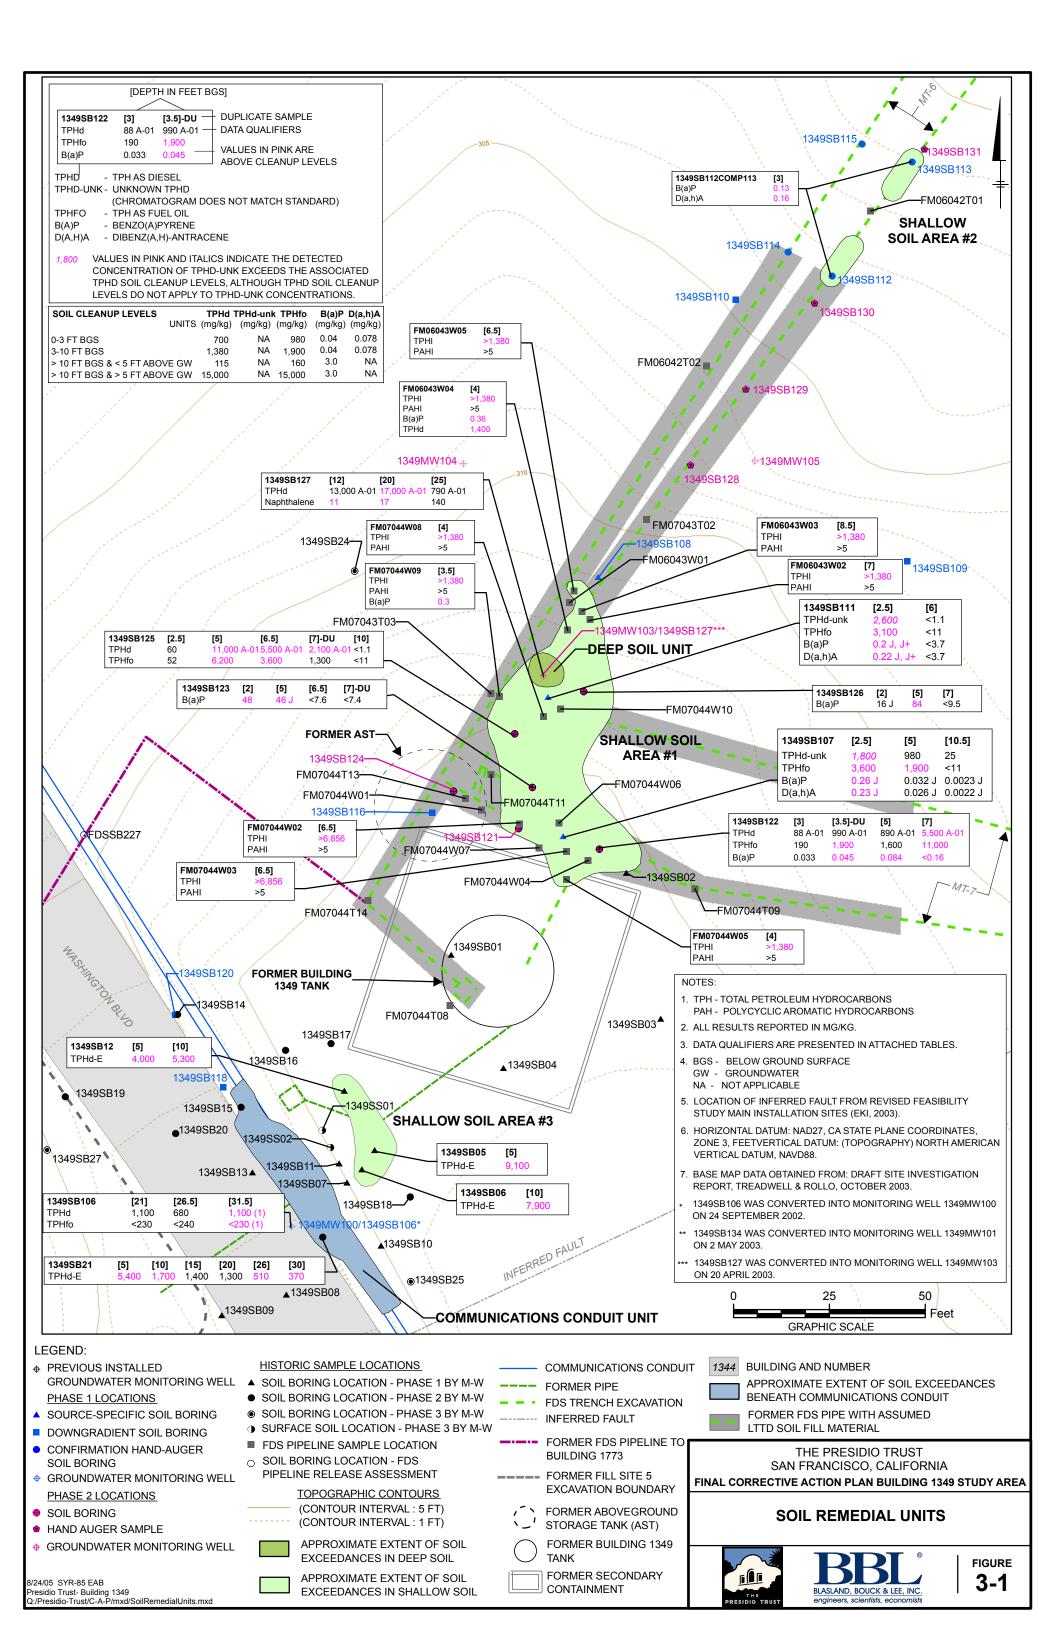

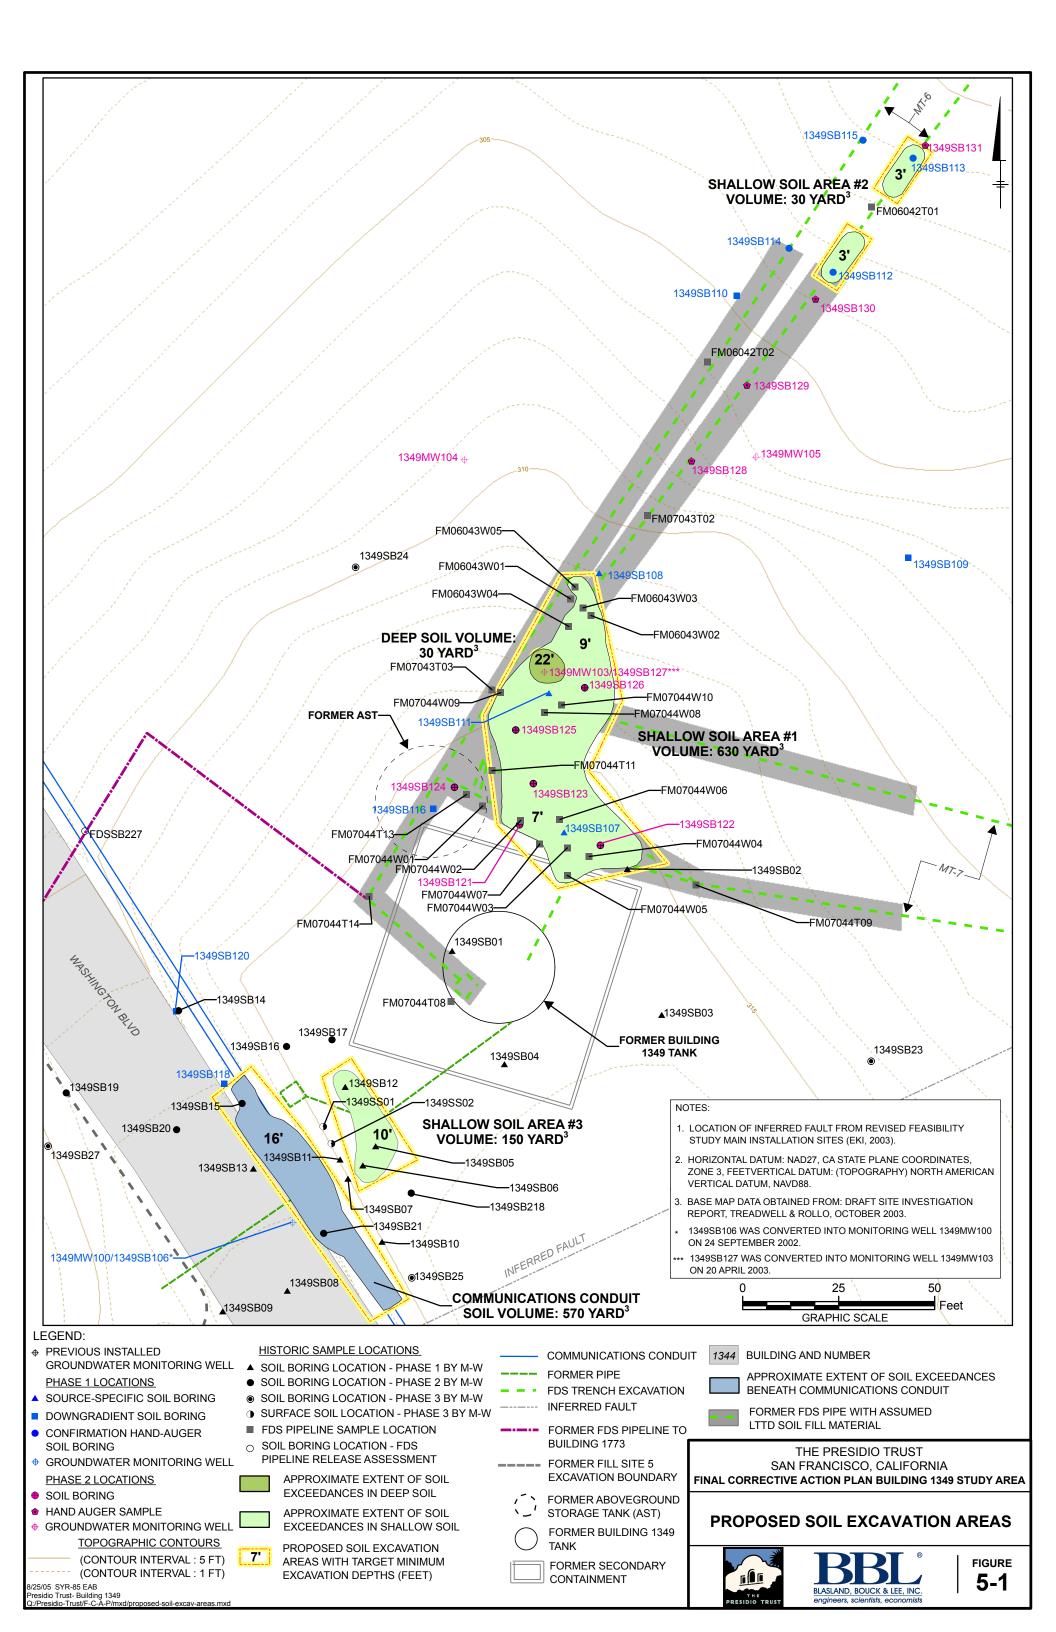

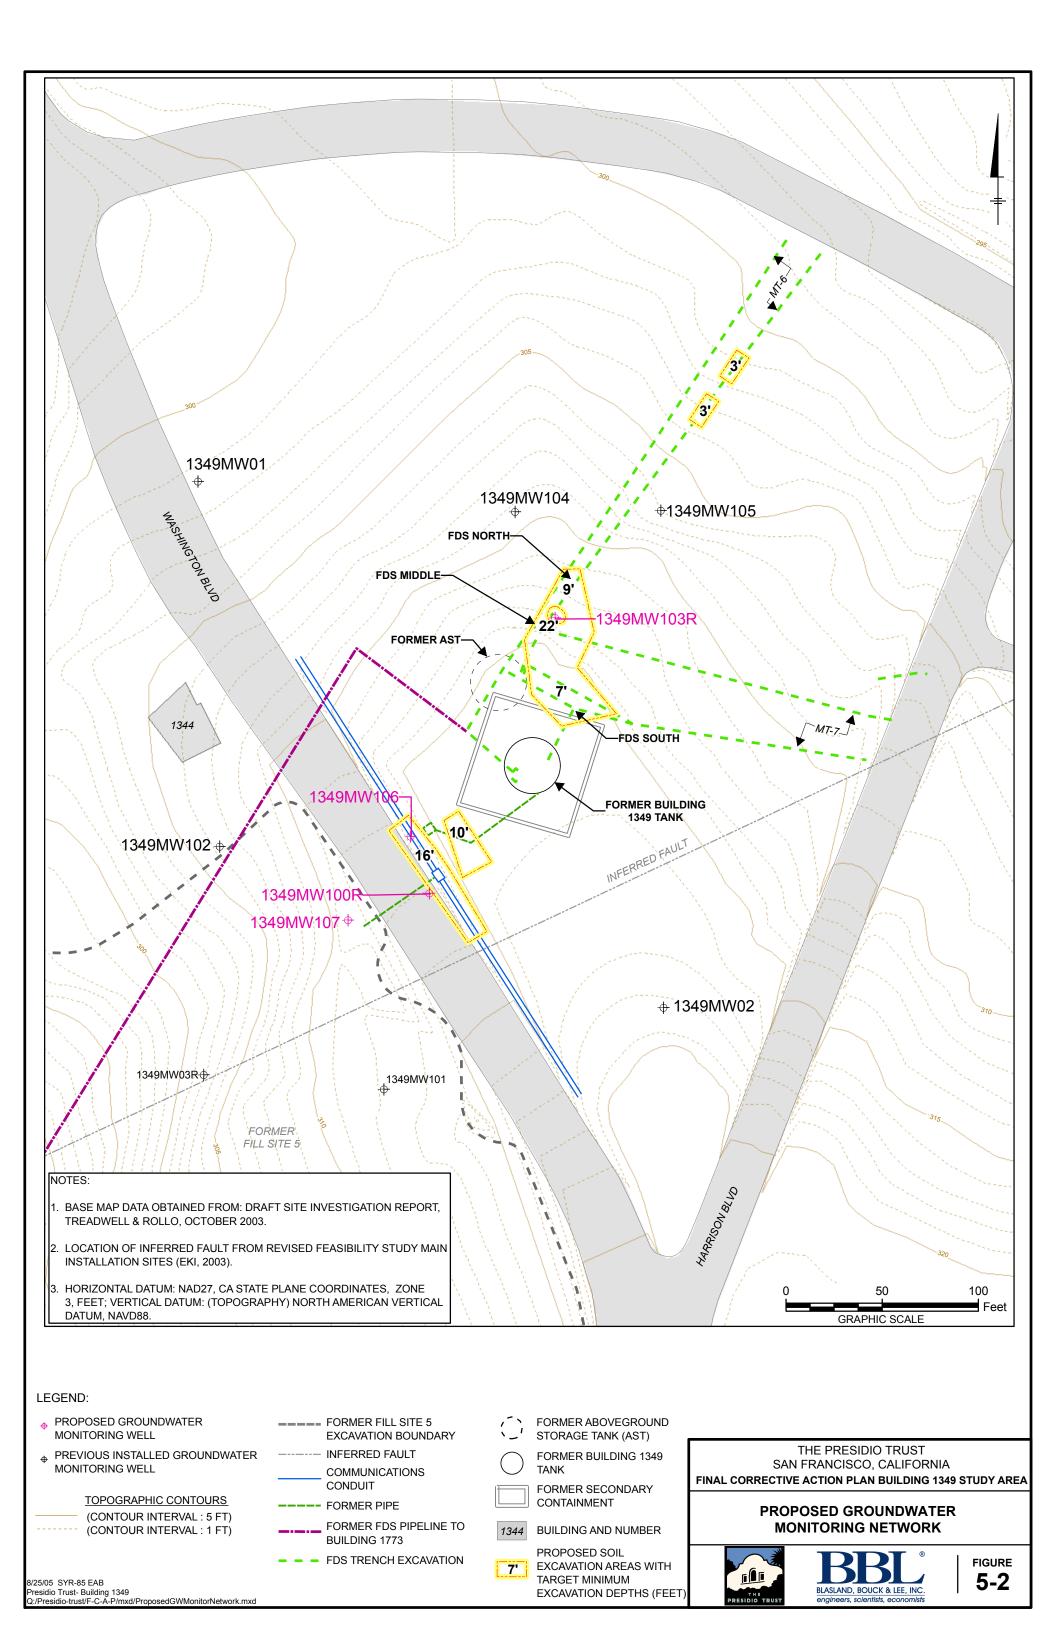

### **Appendices**



### Appendix A

# Response to Comments Summary



#### APPENDIX A

#### Response to Comments on the Draft Corrective Action Plan Building 1349 Study Area Presidio of San Francisco, California

This response to comments provides a written response to all comments received on the *Draft Corrective Action Plan (Draft CAP) for the Building 1349 Study Area, Presidio of San Francisco, California*, dated March 2005, prepared by Blasland, Bouck, and Lee, Inc. (BBL). The Presidio Trust (the Trust) submitted the Draft CAP to stakeholders, including the Presidio Restoration Advisory Board (RAB), National Park Service (NPS), the San Francisco Bay Regional Water Quality Control Board (RWQCB), and Department of Toxic Substances Control (DTSC) on 2 March 2005. Comment was invited through 30 April 2005.

The only comments received on the Draft CAP were from James Ponton, Associate Engineering Geologist, RWQCB, in a letter dated 14 April 2005. Each RWQCB comment is reproduced below in bold text, followed by the Trust's response to each comment.

This Appendix also presents revisions to the CAP that were made by the Trust upon internal review of the Draft CAP. The internal Trust revisions are described following responses to RWQCB comments.

**Comments:** James Ponton

Associate Engineering Geologist RWQCB, Oakland, California

14 April 2005

#### **GENERAL COMMENT:**

<u>Comment No. 1, Recommended Corrective Action for Soil and Groundwater</u>: Water Board Staff agrees with the recommended corrective action of excavation for petroleum impacted soil and monitoring for groundwater.

Response to Comment No. 1: The Trust is pleased that the RWQCB concurs with the selected corrective action of *Excavation and Off-site Disposal* for petroleum-impacted soil and *Groundwater Monitoring* for groundwater for the Building 1349 Study Area.

#### **SPECIFIC COMMENTS:**

Comment No. 1, Reported Detections of Organochlorine Pesticides (OCPs) in Groundwater: Soil samples collected from the study area (Building 1349) have not been analyzed for OCPs. Based on the results of groundwater monitoring, OCPs appear to be limited in groundwater to the area around well 1349MW100, located immediately downgradient of the proposed telecommunications conduit excavation. Site soils may be the source for the OCPs reported in groundwater.

Please revise all appropriate sections, including Table 3-3 of the draft CAP, to include the analysis for OCPs in confirmation samples collected from the sidewalls and floor of the Building 1349 proposed excavations.

2/14/2006 Page 1 of 8

Response to Comment No. 1: Soil samples previously collected at the Building 1349 Study Area have not been analyzed for the presence of OCPs; whereas, OCPs have been detected in groundwater samples at the Study Area, primarily in the vicinity of monitoring well 1349MW100. The Draft CAP indicated that OCPs will be analyzed in soil excavation confirmation samples from the Shallow Soil Remedial Unit (RU) Area 3 and the Telecommunications Corridor RU (as noted in Section 5.2 and Table 5-1). The Draft CAP has been revised to include OCP analysis using USEPA Method 8081 at the remaining three soil RUs (Shallow Soil RU Areas 1 and 2 and the Deep Soil RU). Applicable sections of the CAP have been updated to reflect these changes, including Section 5.2, Table 5-1, and Appendix F tables (cost estimates).

Comment No. 2, Metals Reported in Soil and Groundwater: Study area soil is characterized as slope debris and ravine fill deposits derived from the underlying bedrock including serpentinite, shale/siltstone and sandstone and interbedded weathered clay and silt. Both study area soil and the underlying bedrock area are understood to contain naturally occurring arsenic based on your stated statistical evaluation of arsenic concentrations in the study area.

Please amend the appropriate sections of the draft CAP to include the laboratory analysis for metals in all confirmation samples collected from the proposed excavations. Please evaluate these metals data in an effort to confirm the hypothesis that the concentrations and distributions of metals reported in groundwater area naturally occurring and do not represent soil impacts associated with past site operational activities.

**Response to Comment No. 2:** As discussed in Section 2.4.1 of the CAP, metals were previously analyzed in soil samples from the Phase 1 Site Investigation. The analysis conducted in Section 2.5.1 of the CAP shows that metals exceeding cleanup levels and background concentrations in soil (i.e., arsenic and vanadium) are believed to be naturally occurring in Study Area soils. Therefore, metals were not selected as soil COCs in the CAP. However, in response to this comment, metals have been added to the analytical program for all proposed soil excavation confirmation samples. Soil confirmation samples will be analyzed for metals by USEPA Method 6010/6020 (listed in Table 5-1). Metals analytical results from the soil confirmation samples will be compared with the cleanup levels and background concentrations for serpentinite soil listed in Table 3-1 to assess metals impacts in soil at the Study Area. Consistent with the approach used at other Presidio sites, other tools may be used (such as calculation of 95 percent upper confidence limit [95% UCL] concentrations, assessment of more appropriate geologic conditions/formations, and scatter plots) to support the hypothesis that metals in Study Area soils are naturally occurring and do not represent soil impacts associated with past Study Area operational activities. Applicable sections of the CAP have been updated to reflect these changes, including Section 5.2, Table 5-1, and Appendix F tables (cost estimates).

Comment No. 3, Land Use Controls for the Groundwater Remedial Unit: Land Use Controls (LUCs) proposed in the draft CAP appear limited to restrictions placed on the land because of soil contamination that is left in place (inaccessible, etc). The goals of the LUC for soils, among other things, include the protection of human health and the environment through tracking of residual contamination and preventing land use of the property that is incompatible with the agreed to cleanup goals. LUCs adopted for the Presidio will be made available to the public and tracked/managed through the LUC Maser Reference Report (LUCMRR).

2/14/2006 Page 2 of 8

Staff recommends that the Presidio Trust further evaluate whether sites impacted by contaminated groundwater plumes will be made available to the public and tracked through the existing LUCMRR. Staff recognizes that although the long-term beneficial use designation for the area is municipal and domestic supply (as per SF Bay Basin Plan, 1995), Staff believes that the groundwater use should be restricted until the appropriate cleanup goals are reached.

Response to Comment No. 3: The selected corrective action for the Groundwater RU has been updated to include an LUC for the Groundwater RU at the Study Area during the first five years of the proposed groundwater corrective action. The applicability for continued use of the LUC will be evaluated as part of the Five-Year Status Report based on whether or not cleanup goals have been achieved within that period. Applicable sections of the CAP have been updated to reflect these changes, including Sections 4.6.4, 5.3, and 5.4, in addition to Appendix F tables (cost estimates).

<u>Comment No. 4, Applicable State and Federal Laws and Regulatory Requirements</u>
(<u>ARARs</u>): California stormwater ARARs for construction activities are missing from the Draft CAP.

Please revise the Draft CAP to include the missing ARARs.

**Response to Comment No. 4:** California stormwater ARARs have been added to Section 5.7 of the Draft CAP.

Comment No. 5, Proposed Soil Confirmation Sampling Program: The Draft CAP proposes an excavation floor sample density of one sample per 25- by 25-foot grid and one sample per 50-foot lateral extent, and for depth, at the midpoint of the 0 to 3 feet bgs interval, one sample at the midpoint of the 3 to 10 feet bgs interval and one sample at the midpoint of the greater than 10 feet bgs interval.

#### Please amend the Draft CAP to include:

- a. A minimum of one sidewall sample per exposed excavation sidewall (i.e., for each of the four walls) for sidewalls that are less than 50-foot lateral distance;
- b. An additional sample or samples that specifically target and test soil intervals where there is field evidence of soil staining and discoloration, elevated PID readings, etc.; and.
- c. An additional sample within the 3- to 10-foot vertical interval, possibly within 3- to 6- feet bgs. We can further refine and discuss the confirmation soil sampling program prior to issuance of the Building 1349 Work Plan.

Response to Comment 5a: The soil excavation confirmation soil sampling program includes a minimum of one sidewall sample per 50 lateral feet or a minimum of four sidewalls (per depth interval targeted) as indicated in Section 5.2. Text has been added to Section 5.2 to indicate a minimum of one sample per sidewall (assuming four sidewalls per excavation).

**Response to Comment 5b:** Text has been added to Section 5.2 and a note added to Table 5-1 to indicate that additional sidewall or bottom samples will be collected if field observations indicate the presence of soil staining or other evidence of residual COC impacts (e.g., elevated PID readings).

2/14/2006 Page 3 of 8

**Response to Comment 5c:** The Trust has considered the RWQCB's request for an additional sidewall sample within the 3 to 10 feet bgs depth interval for each soil RU proposed in the CAP. Based on the extent of impacts at each individual soil RU, the following approach for further sidewall sampling within the 3 to 10 feet bgs depth interval is proposed in the Final CAP:

- Shallow Soil RU Area 1: Area 1 encompasses the Former FDS Remedial Excavation areas. In the southern half of Area 1, the COC impacts extend from approximately 2 to 7 feet bgs. In the northern half of Area 1, the COC impacts extend from approximately 2.5 to 9 feet bgs (and to 20 feet bgs in the vicinity of boring 1349SB127 [deep soil RU]). Thus, initial excavation within Area 1 will proceed to a minimum of 7 feet bgs in the southern portion of the RU and 9 feet bgs in the northern portion of the RU. The Trust considers one sidewall sample for the 3 to 8 feet bgs interval (i.e., one sample per 5 feet of sidewall) to be sufficient, as well as collecting additional samples if field evidence of contamination is present (see Response to Comment 5b). Thus, for this shallow soil RU, an additional sidewall sample will be collected within the 3 to 10 feet bgs depth interval only for excavation areas extending over 8 feet bgs. For these areas, the two sidewall samples within the 3 to 10 feet bgs depth interval will be collected at approximately 1/3 and 2/3 vertical intervals.
- Shallow Soil RU Area 2: Area 2 encompasses two small areas along the northern end of the former FDS pipeline. The vertical extent of the COC exceedances in Area 2 is estimated to be approximately 3 feet bgs, because only the trench backfill material is suspected of containing COCs above the cleanup levels. Excavation over 3 feet bgs will only be conducted in 1-foot increments in this area if cleanup level exceedances are found in the initial soil confirmation samples. Thus, an additional sample within the 3 to 10 feet bgs depth interval for this shallow soil RU is not warranted.
- Shallow Soil RU Area 3: Area 3 encompasses an area directly northeast of the telecommunications conduit. This area includes residual soil contamination that was left in-place underneath the previous AST removal excavation. COC impacts in Area 3 are estimated to extend from approximately 5 to 10 feet bgs. Clean backfill soils are present in this area over the impacted soils. Because contamination is expected to be concentrated in this 5-foot depth interval (from 5 to 10 feet bgs) and is covered by clean soils, one sidewall sample collected from this interval would target the area of greatest contamination. Thus, for this shallow soil RU, the sidewall sample collection approach has been revised to one sidewall sample between 5 and 10 feet bgs (rather than one sample between 3 and 10 feet bgs).
- Telecommunications Corridor RU: The telecommunications soil RU is a wedge-shaped mass of impacted soil beneath the telecommunications line adjacent to Washington Boulevard. This soil was left in place after previous remedial excavations on the east and west sides of the telecommunications conduit that runs along the east side of Washington Boulevard. The conduit is 2- to 2.5-feet wide and 2.5-feet deep and the top of the conduit occurs at approximately 1-foot below grade. The vertical extent of this RU is assumed to extend deeper than 12 feet bgs, which is the maximum depth of the previous soil excavations in the area. The purpose of excavation in this area is to remove the impacted soil left in place below the conduit. Sidewall samples collected from between 0 and 10 feet bgs from this narrow excavation are not expected to show cleanup level exceedances because the area surrounding the conduit has been backfilled with clean soils to approximately 12 feet bgs. Thus, one sidewall sample at the midpoint of the 3 to 10 feet

Page 4 of 8

bgs depth interval at this RU is considered to be conservative and an additional sample is not warranted.

In summary, in response to RWQCB's comment #5c, the Trust has revised the Soil Confirmation Sampling program as follows: (1) for Shallow Soil RU – Area 1, two sidewall samples will be collected within the 3 to 10 feet bgs depth interval (collected at approximately 1/3 and 2/3 vertical intervals) for excavations extending over 8 feet bgs and (2) for Shallow Soil RU – Area 3, one sidewall sample will be collected between 5 and 10 feet bgs (rather than one sample between 3 and 10 feet bgs). Section 5.1 of the Final CAP has been revised to include the information presented in this comment response.

#### Presidio Trust Revisions Final Building 1349 Area CAP

This section presents revisions to the CAP that were made by the Trust upon internal review of the Draft CAP. General revisions are presented first, followed by revisions to specific sections of the CAP. Minor editorial changes made to the CAP (e.g., typos, grammatical corrections, etc.) are not described in this section.

#### **GENERAL REVISIONS**

<u>Cost Estimates and Assumptions for Corrective Action Alternatives (Appendix F):</u> The Trust has made several changes to the cost estimates from the Draft CAP to reflect revisions made for the Final CAP and to be consistent with costing approaches for other Presidio sites.

General updates to cost estimate tables include the following:

- Rounding: The total estimated costs have been rounded to the 4<sup>th</sup> decimal place.
- Land Use Controls: Since the date that Draft CAP was submitted (March 2005), the Trust has developed a standardized process for costing LUC remedies at Presidio sites. The capital costs are assumed to include an allocated share of the LUCMRR of \$5,000 and a LUCMRR site-specific Addendum of \$10,000. Annual costs to administer the LUCMRR at a specific site are assumed to be \$1,000 per year for 30 years.
- *Soil Volumes*: Soil volumes assumed for removal have been updated in the cost tables to reflect re-calculated soil volumes (discussed below).
- Soil Confirmation Sampling: The quantities of soil confirmation samples and analyses have been updated in accordance with updates to Table 5-1, Proposed Soil Confirmation Sampling and Analysis Summary. The updates were necessary based on: (1) recalculated soil volumes; (2) inclusion of QA/QC samples; and (3) additional metals and OCP analyses requested by RWOCB Comments Nos. 1 and 2 above.

Specific updates to Groundwater Monitoring costs (Table F-5b) have been made as follows:

- Groundwater Monitoring of Replacement Wells (Tables F-2b, F-4b, and F-5b): The costs for the first round of groundwater monitoring of replacement well 1349MW103R (Table F-2b, Shallow Soil RU) and replacement well 1349MW100R (Table F-4b, Telecommunications Corridor RU) have been moved to Table F-5b (Groundwater RU) so that all groundwater monitoring costs would be reflected in the costs for the Groundwater RU instead of the soil RUs.
- Groundwater Land Use Control: Costs to implement and maintain a groundwater LUC to restrict use of groundwater for 5 years have been added, in accordance with RWQCB Comment No. 3 above.

2/14/2006 Page 5 of 8

- *Five-Year Status Report*: The capital cost of \$10,000 to prepare the Five-Year Status Report has been removed and the costs for Five-Year Review have been reflected in the Annual Costs.
- Annual Reduction in Costs: The costs for groundwater monitoring have been reduced to reflect the anticipated reduction in sampling costs each year. Instead of assuming quarterly sampling over a period of 5 years (resulting in Groundwater Monitoring costs of approximately \$575,000 in the Draft CAP, which is likely an over-estimate), the costs have been reduced to be consistent with the planned groundwater monitoring outlined in Section 5.3 of the Final CAP as follows: quarterly sampling for Years 1 and 2, and semi-annual sampling for Year 3. This reduction in sampling frequency, together with the other Groundwater Monitoring cost changes listed above, result in a lower estimated cost of \$363,000 for Groundwater Monitoring.

Table F-1, Summary of Estimated Costs for Corrective Action, has also been updated and reformatted to be consistent with costing tables for other Presidio remediation sites. Specifically, annual operation and maintenance (O&M) costs are now listed on an annual cost basis, the O&M period for LUCs and Groundwater Monitoring are listed in a separate column, and the Total Estimated Costs (NPV) column lists the total costs for each alternative (including capital and cumulative annual costs).

The table below summarizes the total cost difference between estimates from the Draft and Final CAPs.

Preferred Alternatives	Draft CAP	Final CAP
All Soil RUs – Excavation and Disposal	\$654,953	\$737,000
Groundwater RU – Groundwater Monitoring	\$574,588	\$363,000
All Soil RUs (Excavation and Disposal) + Groundwater	\$1,229,541	\$1,190,000 *
RU (Groundwater Monitoring)		

<sup>\*</sup> The total cost for implementation of the preferred alternatives for All Soil RUs and Groundwater RU does not equal the total of the individual line costs because one 30-year Land Use Control (LUC) cost is assumed for implementation of both soil and groundwater RU alternatives. See Table F-1 in the Final CAP for details.

<u>Soil Volumes for Soil Remedial Units:</u> Volumes of impacted soil within each soil RU have been re-calculated based on the following:

- Figure 5-1, Proposed Soil Excavation Areas, has been revised to show the targeted
  excavation areas around the soil RUs to consider more likely field implementation
  conditions. The volumes of impacted soil within each RU stated in the text and listed in
  the cost tables have been updated to reflect the re-calculated volumes using the targeted
  excavation areas based on field implementation, rather than the contours reflecting extent
  of cleanup level exceedances.
- Shallow Soil Area 2: The volume of impacted soil within Shallow Soil Area 2 has been corrected to 30 cubic yards (cy), based on an assumed vertical extent of 3 feet bgs. In the Draft CAP, a volume of 60 cy was calculated, based on an assumed (and unlikely) vertical extent of 10 feet bgs.

Page 6 of 8

#### SPECIFIC REVISIONS

- <u>Section 1.4, Public Participation:</u> This section has been updated to reflect the public review and comment period for the Draft RAP and revisions that were made for the Final CAP to address RWQCB comments and Trust internal review.
- <u>Section 2.1.2.2, Groundwater Occurrence and Flow, 3<sup>rd</sup> Paragraph:</u> This paragraph has been updated to include a discussion on groundwater elevation data from a more recent Semiannual Groundwater Monitoring Report, Third and Fourth Quarters 2004 (Treadwell and Rollo, 2005).
- <u>Section 2.1.2.3, Summary of Hydrogeologic Conditions:</u> This section has been slightly revised to indicate that temporal variations in apparent groundwater flow direction, while minor, may be observed based on local recharge conditions. Also, a sentence has been added at the end of the section indicating that the existing groundwater monitoring well network is sufficient for monitoring groundwater hydrogeologic conditions to the east of the apparent groundwater basin divide as well as to the west, north, and south of Washington Boulevard.
- Section 2.4.6, Groundwater and Section 2.5.2, Nature and Extent of Contamination in Groundwater: These sections have been updated to reflect data collected through the Fourth Quarter 2004 (Treadwell and Rollo, 2005), as well as draft data from the First and Second Quarters 2005 (Groundwater Monitoring Report pending), if the more recent results indicated potential significant changes to the groundwater evaluation in the Final CAP. In summary, the only significant change is as follows: In well 1349MW100, several PAHs were detected above cleanup levels in March 2005 (in addition to benzo[a]anthracene which was previously the only PAH detected above cleanup levels in this well).
- <u>Section 3.2.4, Groundwater COCs:</u> This section has been updated to select PAHs (instead of solely benzo[a]anthracene) as groundwater COCs, due to the recent detections of PAHs in groundwater in well 1349MW100.
- Section 4.5, Development and Evaluation of Proposed Corrective Action Alternatives: The costs for each alternative have been updated to reflect the revised cost estimates (as described above). Also, the annual costs (per year) are now presented in the text (to be consistent with costs provided in Table F-1), rather than the cumulative annual costs over the entire O&M period.
- <u>Section 4.5.4, Groundwater RU and Section 4.6.4, Groundwater RU:</u> The two newly proposed wells for the Groundwater Monitoring Alternative have been given sample location IDs: 1349MW106 and 1349MW107.
- Section 5.3, Groundwater Monitoring: To be consistent with groundwater monitoring programs at other Presidio sites, the following analyses have been added to the Groundwater Monitoring Program to evaluate ongoing redox conditions: general chemistry parameters, sulfide, total dissolved solids, total organic carbon (TOC), and other field parameters. The text of this section has also been slightly modified to indicate that decisions for reduction in analytes and sampling frequencies will be made on a sitewide basis.
- <u>Section 5.7, Applicable State and Federal Laws and Regulatory Requirements, 7<sup>th</sup> paragraph:</u> Stormwater discharge requirements under the Basin Plan have been added.

Page 7 of 8

- <u>Table 3-1, Summary of Soil Cleanup Levels:</u> Cleanup levels for antimony, barium, cobalt, and thallium have been added to this table because they have been added to the soil confirmation sampling program.
- <u>Table 3-3, Summary of Remedial Units and Contaminants of Concern:</u> The estimated surface area, thickness, and volume for each soil RU have been updated based on general volume updates (described above). Also, for the Groundwater RU, benzo(a)anthracene has been replaced with PAHs as a COC.
- Table 5-1, Proposed Soil Confirmation Sampling and Analysis Summary: The estimated surface area, thickness, and volume for each soil RU have been updated based on general volume updates (described above). The number of confirmation samples for each soil RU has been recalculated based on the updated volumes and addition of QA/QC samples. Also, metals and OCPs have been added to the sampling program for all soil RUs, based on RWQCB Comment Nos. 1 and 2 above, and the revised soil confirmation sampling program in accordance with RWQCB Comment No. 5 has been included in Footnote 2.
- <u>Table 5-2, Proposed Groundwater Sampling Program:</u> A column identifying 'Well Status' has been added and the two proposed wells have been labeled 1349MW106 and 1349MW107. Also, the footnotes have been updated based on the revised Groundwater Sampling Program discussed in Section 5.3.
- **Figure 3-1, Soil Remedial Units:** Postings of COCs and cleanup level exceedances have been added to the figure and soil volumes removed from the figure.
- **Figure 5-1, Proposed Soil Excavation Areas:** Postings of COCs and cleanup level exceedances have been removed from the figure. Proposed soil excavation areas with target minimum excavation depths around the soil RUs have been added to the figure, based on more likely field implementation conditions. The soil volumes have been re-calculated and presented on the figure.
- <u>Figure 5-2, Proposed Groundwater Monitoring Network:</u> Figure 5-2 has been added to the CAP to present the locations proposed for the groundwater monitoring program.

Appendix H, Groundwater Elevation Maps from Semiannual Groundwater Monitoring

Report, Third and Fourth Quarters 2004: Appendix H has been added to the CAP to present more recent groundwater elevation maps.

Page 8 of 8

### Appendix B

Previous Investigation Summary (From Treadwell & Rollo SI, 2003)



Boring Location	Sample Depth	Soil Screening Interval	Sample ID	Sample Date	TPH As Diesel (Carbon Range C12-C24) (mg/kg)	Unknown TPH As Diesel (Carbon Range C12-C24) <sup>1</sup> (mg/kg)	TPH As Fuel Oil (Carbon Range C24-C36) (mg/kg)
Soil Cleanup Lev	vels (2)						
0 - 3 feet bgs					700	NE	980
3 - 10 feet bgs					1,380	NE	1,900
>10 feet bgs and <					115	NE NE	160
>10 feet bgs and	> 5 feet above				15,000	NE	15,000
1349SB106	21	>10 feet bgs and > 5 feet above groundwater	1349SB106[21]	09/24/02	1,100	< 23	< 230
	26.5	>10 feet bgs and > 5 feet above groundwater	1349SB106[26.5]	09/24/02	680	< 24	< 240
	31.5	>10 feet bgs and < 5 feet above groundwater	1349SB106[31.5]	09/24/02	1,100	< 23	< 230
1349SB107	2.5	0 - 3	1349SB107[2.5]	09/20/02	< 11	1,800	3,600
	5.5	3 - 10	1349SB107[5.5]	09/20/02	< 57	980	1,900
	10.5	>10 feet bgs and > 5 feet above groundwater	1349SB107[10.5]	09/20/02	< 1.1	25	< 11
	15.5	>10 feet bgs and > 5 feet above groundwater	1349SB107[15.5]	09/20/02	< 1.1	1.8	< 11
	20.5	>10 feet bgs and > 5 feet above groundwater	1349SB107[20.5]	09/20/02	< 1	1.9	< 10
	25.5	>10 feet bgs and > 5 feet above groundwater	1349SB107[25.5]	09/20/02	< 1	2.1	< 10
	30.5	>10 feet bgs and > 5 feet above groundwater	1349SB107[30.5]	09/20/02	< 1.1	4.7	< 11
1349SB108	2.5	0 - 3	1349SB108[2.5]	09/20/02	< 1.1	58	86
	5.5	3 - 10	1349SB108[5.5]	09/20/02	< 1.1	5	< 11
	11	>10 feet bgs and > 5 feet above groundwater	1349SB108[11]	09/20/02	< 1.6	< 1.6	< 16
	16	>10 feet bgs and > 5 feet above groundwater	1349SB108[16]	09/20/02	< 1.6	< 1.6	< 16
	>10 feet bgs and > 5 feet above groundw		1349SB108[21]	09/20/02	< 1.2	1.5	< 12
	26 > 5 feet above groundy >10 feet bgs and > 5 feet above groundy		1349SB108[26]	09/20/02	< 1.3	< 1.3	< 13
	26.5	>10 feet bgs and > 5 feet above groundwater	DUP092002B	09/20/02	< 1.2	< 1.2	< 12

Boring Location	Sample Depth	Soil Screening Interval	Sample ID	Sample Date	TPH As Diesel (Carbon Range C12-C24) (mg/kg)	Unknown TPH As Diesel (Carbon Range C12-C24) <sup>1</sup> (mg/kg)	TPH As Fuel Oil (Carbon Range C24-C36) (mg/kg)
Soil Cleanup Lev	vels (2)						
0 - 3 feet bgs					700	NE	980
3 - 10 feet bgs					1,380	NE	1,900
>10 feet bgs and <					115	NE	160
>10 feet bgs and	> 5 feet above				15,000	NE	15,000
	31	>10 feet bgs and < 5 feet above groundwater	1349SB108[31]	09/20/02	< 1.2	< 1.2	< 12
1349SB111	2.5	0 - 3	1349SB111[2.5]	09/20/02	< 11	2,600	3,100
	6	3 - 10	1349SB111[6]	09/20/02	< 1.1	< 1.1	< 11
	10.5	>10 feet bgs and > 5 feet above groundwater	1349SB111[10.5]	09/20/02	< 1.1	< 1.1	< 11
	16	>10 feet bgs and > 5 feet above groundwater	1349SB111[16]	09/20/02	5.8	< 1.1	< 11
	21	>10 feet bgs and > 5 feet above groundwater	1349SB111[21]	09/20/02	680	< 22	300
	26	>10 feet bgs and > 5 feet above groundwater	1349SB111[26]	09/20/02	1,800	< 44	850
	26.5	>10 feet bgs and > 5 feet above groundwater	DUP092002A	09/20/02	840	< 11	420
	31	>10 feet bgs and > 5 feet above groundwater	1349SB111[31]	09/20/02	1,300	< 45	690
1349SB112/ 1349SB113	3	0 - 3	1349SB112- COMP113[3]	09/20/02	< 1.1	25	47
1349SB114/ 1349SB115	3	0 - 3	1349SB114- COMP115[3]	09/20/02	< 1.1	3.3	< 11
1349SB116	36	>10 feet bgs and > 5 feet above groundwater	1349SB116[36]	09/23/02	82	< 1	< 10
1349SB117	3	0 - 3	1349SB117[3]	09/24/02	< 1.1	< 1.1	< 11
	5	3 - 10	1349SB117[6]	09/24/02	< 1.2	< 1.2	< 12
1349SB118	3	0 - 3	1349SB118[3]	09/24/02	< 1.1	6.9	< 11
	3.5	3 - 10	DUP092402B	09/24/02	< 1.2	1.3	< 12
	6	3 - 10	1349SB118[6]	09/24/02	< 1.2	< 1.2	< 12
1349SB119	3	0 - 3	1349SB119[3]	09/24/02	< 1.1	6	11
	6	3 - 10	1349SB119[6]	09/24/02	< 1.1	< 1.1	< 11
1349SB120	3	0 - 3	1349SB120[3]	09/24/02	1.2	< 1.2	< 12
	6	3 - 10	1349SB120[6]	09/24/02	< 1.1	31	< 11

Boring Location	Sample Depth	Soil Screening Interval	Sample ID	Sample Date	TPH As Diesel (Carbon Range C12-C24) (mg/kg)	Unknown TPH As Diesel (Carbon Range C12-C24) <sup>1</sup> (mg/kg)	TPH As Fuel Oil (Carbon Range C24-C36) (mg/kg)
Soil Cleanup Lev	vels (2)						
0 - 3 feet bgs					700	NE	980
3 - 10 feet bgs					1,380	NE	1,900
>10 feet bgs and					115	NE	160
>10 feet bgs and	> 5 feet above	groundwater			15,000	NE	15,000
1349SB121	2	0 - 3	1349SB121[2.0]	04/24/03	170 A-01	< 5.8	390
	5	3 - 10	1349SB121[5.0]	04/24/03	< 1.2	4.8	< 12
	7	3 - 10	1349SB121[7.0]	04/24/03	5.5 A-01	< 1.1	< 11
1349SB122	3	0 - 3	1349SB122[3.0]	04/24/03	88 A-01	< 5.6	190
	3.5	3 - 10	DUP042403A	04/24/03	990 A-01	< 11	1,900
	5	3 - 10	1349SB122[5.0]	04/24/03	890 A-01	< 6	1,600
	7	3 - 10	1349SB122[7.0]	04/24/03	5,500 A-01	< 12	11,000
1349SB123	2	0 - 3	1349SB123[2.0]	04/24/03	140 A-01	< 5.6	200
	5	3 - 10	1349SB123[5.0]	04/24/03	1,000 A-01	< 13	1,800
	6.5	3 - 10	1349SB123[6.5]	04/24/03	4.7 A-01	< 1.1	< 11
	7	3 - 10	DUP042403B	04/24/03	3.6 A-01	< 1.1	< 11
1349SB124	2	0 - 3	1349SB124[2.0]	04/24/03	< 1.1	14	28
	5	3 - 10	1349SB124[5.0]	04/24/03	< 1.1	1.7	< 11
	7	3 - 10	1349SB124[7.0]	04/24/03	< 1.1	3.7	< 11
1349SB125	2	0 - 3	1349SB125[2.0]	04/24/03	60	< 1.1	52
	5	3 - 10	1349SB125[5.0]	04/24/03	11,000 A-01	< 22	6,200
	6.5	3 - 10	1349SB125[6.5]	04/24/03	5,500 A-01	< 55	3,600
	7	3 - 10	DUP042403C	04/24/03	2,100 A-01	< 11	1,300
	10	3 - 10	1349SB125[10.0]	04/24/03	< 1.1	< 1.1	< 11
	20	>10 feet bgs and > 5 feet above groundwater	1349SB125[20.0]	04/24/03	1.4 A-01	< 1	< 10
	25	>10 feet bgs and > 5 feet above groundwater	1349SB125[25.0]	04/24/03	1.1 A-01	< 1	< 10
1349SB126	2	0 - 3	1349SB126[2.0]	04/25/03	29 A-01	< 1.1	43
	5	3 - 10	1349SB126[5.0]	04/25/03	460 A-01	< 5.5	600
	7	3 - 10	1349SB126[7.0]	04/25/03	95 A-01	< 1.4	44
	20	>10 feet bgs and > 5 feet above groundwater	1349SB126[20.0]	04/25/03	< 1.3	< 1.3	< 13
	25	>10 feet bgs and > 5 feet above groundwater	1349SB126[25.0]	04/25/03	< 1.3	< 1.3	< 13
1349SB127	2.5	0 - 3	1349SB127[2.5]	04/25/03	120 A-01	< 1.2	180

Boring Location	Sample Depth	Soil Screening Interval	Sample ID	Sample Date	TPH As Diesel (Carbon Range C12-C24) (mg/kg)	Unknown TPH As Diesel (Carbon Range C12-C24) <sup>1</sup> (mg/kg)	TPH As Fuel Oil (Carbon Range C24-C36) (mg/kg)
Soil Cleanup Lev	els (2)						
0 - 3 feet bgs				700	NE	980	
3 - 10 feet bgs					1,380	NE	1,900
>10 feet bgs and <	5 feet above	groundwater			115	NE	160
>10 feet bgs and >	5 feet above	groundwater			15,000	NE	15,000
	4.5	3 - 10	1349SB127[4.5]	04/25/03	72 A-01	< 1.2	80
	5 3 - 10		DUP042503A	04/25/03	< 1.2	1.8	< 12
	7.5 3 - 10		1349SB127[7.5]	04/25/03	720 A-01	< 1.1	290

#### Presidio of San Francisco, California

Boring Location	Sample Depth	Soil Screening Interval	Sample ID	Sample Date	TPH As Diesel (Carbon Range C12-C24) (mg/kg)	Unknown TPH As Diesel (Carbon Range C12-C24) <sup>1</sup> (mg/kg)	TPH As Fuel Oil (Carbon Range C24-C36) (mg/kg)
Soil Cleanup Lev	els (2)	•					
0 - 3 feet bgs					700	NE	980
3 - 10 feet bgs					1,380	NE	1,900
>10 feet bgs and <	5 feet above	groundwater			115	NE	160
>10 feet bgs and >	5 feet above	groundwater			15,000	NE	15,000
1349SB127	12	>10 feet bgs and > 5 feet above groundwater	1349SB127[12.0]	04/25/03	13,000 A-01	< 14	5,900
	20 >10 feet bgs and >5 feet above groundwater		1349SB127[20.0]	04/25/03	17,000 A-01	< 13	6,400
	25	>10 feet bgs and > 5 feet above groundwater	1349SB127[25.0]	04/25/03	790 A-01	< 1.1	300

#### Notes

bgs - below ground surface

mg/kg - milligrams per kilogram

TPH - Total Petroleum Hydrocarbons

Detected concentrations in **Bold** indicate an exceedance of applicable soil screening levels.

Detected concentrations in *Bold and Italics* indicate the detected concentration of TPHd-unk exceeds the associated TPHd soil screening levels, although TPHd soil screening levels do not apply to TPHd-unk concentrations.

- 1 Total petroleum hydrocarbons were detected within the diesel range but the observed patterns did not match the standard.
- 2 Cleanup level values listed are obtained from Tables 1, 2 and 4 of California Environmental Protection Agency, Regional Water Quality Control Board, San Francisco Bay Region. Order R2-2003-0080, Revised Site Cleanup Requirements (SCRs) and Recession of Order No. 91-082 and Order No. 96-070, August, 2003.

<sup>&</sup>quot;A-01" - Results are elevated due to overlap from higher boiling point hydrocarbons.

Boring Location	Sample Depth	Soil Cleanup Interval (feet bgs)	Sample ID	Sample Date	Acenaphthene (mg/kg)	Acenaphthylene (mg/kg)	Anthracene (mg/kg)	Benzo(a)- Anthracene (mg/kg)	Benzo(a)- Pyrene (mg/kg)	Benzo(b)- Fluoranthene (mg/kg)	Benzo(g,h,i)- Perylene (mg/kg)	Benzo(k)- Fluoranthene (mg/kg)
Soil Cleanup Lev	vels 1											
0 - 3 feet bgs					2,700		5,900	0.43	0.04	0.43	620	0.43
3 - 10 feet bgs					2,700		5,900	0.43	0.04	0.43	620	0.43
>10 feet bgs and <					NE		308	8	3	23	5,040	23
>10 feet bgs and >	1	<del></del>	10100710710 51	00/00/00	NE		308	8	3	23	5,040	23
1349SB107	2.5	0 - 3	1349SB107[2.5]	09/20/02	< 0.37	< 0.37	< 0.37	< 0.37	0.260 J	< 0.37	0.240 J	< 0.37
	5.5	3 - 10	1349SB107[5.5]	09/20/02	< 0.038	< 0.038	0.019 J	< 0.038	0.032 J	0.028 J	0.034 J	< 0.038
	10.5	> 10	1349SB107[10.5]	09/20/02	< 0.0036	< 0.0036	< 0.0036	< 0.0036	0.0023 J	0.0023 J	0.003 J	< 0.0036
	15.5	> 10	1349SB107[15.5]	09/20/02	< 0.0038	< 0.0038	< 0.0038	< 0.0038	< 0.0038	< 0.0038	< 0.0038	< 0.0038
	20.5	> 10	1349SB107[20.5]	09/20/02	< 0.0041	< 0.0041	< 0.0041	< 0.0041	0.0021 J	0.0035 J	0.0025 J	< 0.0041
	25.5 30.5	> 10	1349SB107[25.5]	09/20/02	< 0.0035 < 0.0035	< 0.0035 0.0039	< 0.0035 0.084	< 0.0035 0.0021 J	< 0.0035 0.0021 J	0.002 J	0.0019 J	< 0.0035
1349SB108	2.5	> 10 0 - 3	1349SB107[30.5] 1349SB108[2.5]	09/20/02 09/20/02			0.0021 J	0.0021 J 0.0054 J+		0.0097	0.0067 0.0042 J+	< 0.0035
134930108	5.5	3 - 10	1349SB108[2.5]	09/20/02	< 0.0036 < 0.0037	0.0019 J < 0.0037	< 0.0021 3	< 0.0034 3+	0.0043 J+ < 0.0037	0.0063 J+ < 0.0037	< 0.0042 J+ < 0.0037	0.002 J,J+ < 0.0037
	11	> 10	1349SB108[3.3]	09/20/02	< 0.0057	< 0.0057	< 0.0053	< 0.0057	< 0.0057	< 0.0057	< 0.0057	< 0.0057
	16	> 10	1349SB108[11] 1349SB108[16]	09/20/02	< 0.0052	< 0.0053	< 0.0052	< 0.0052	< 0.0053	< 0.0053	< 0.0053	< 0.0053
	21	> 10	1349SB108[10]	09/20/02	< 0.0032	< 0.0032	< 0.0032	< 0.0032	0.0032 0.002 J	< 0.0032	0.0032 0.0021 J	< 0.0032
	26	> 10	1349SB108[21]	09/20/02	< 0.0052	< 0.0052	< 0.0052	< 0.0052	< 0.0023	< 0.0052	< 0.0052	< 0.0052
	26.5	> 10	DUP092002B	09/20/02	< 0.0032	< 0.0032	< 0.0032	< 0.0032	< 0.0032	< 0.0032	< 0.0032	< 0.0032
	31	> 10	1349SB108[31]	09/20/02	< 0.004	< 0.004	< 0.004	< 0.004	< 0.004	< 0.004	< 0.004	< 0.004
1349SB111	2.5	0 - 3	1349SB111[2.5]	09/20/02	< 360	< 360	180 J	< 360	200 J,J+	< 0.360	0.230 J,J+	< 0.360
134755111	6	3 - 10	1349SB111[6]	09/20/02	< 0.0037	< 0.0037	< 0.0037	< 0.0037	< 0.0037	< 0.0037	< 0.0037	< 0.0037
	10.5	> 10	1349SB111[10.5]	09/20/02	< 0.0036	< 0.0036	< 0.0036	< 0.0036	< 0.0036	< 0.0036	< 0.0036	< 0.0036
	16	> 10	1349SB111[16]	09/20/02	< 0.0035	0.0019 J	0.002 J	< 0.0035	0.0019 J	< 0.0035	0.0019 J	< 0.0035
	21	> 10	1349SB111[21]	09/20/02	0.64	0.3	0.2	0.13	0.078	0.064 J	0.045 J	0.040 J
	26	> 10	1349SB111[26]	09/20/02	0.98	0.44	0.360 J-	0.31	0.140 J	0.100 J	0.100 J	< 0.150 UJ
	26.5	> 10	DUP092002A	09/20/02	0.19	0.077	0.09	0.057	0.036 J	0.026 J	0.027 J	< 0.038
	31	> 10	1349SB111[31]	09/20/02	0.41	0.18	0.017	0.11	0.070 J	0.053 J	0.047 J	< 0.074
1349SB112/ 1349SB113	3	0 - 3	1349SB112- COMP113[3]	09/20/02	0.14	0.15	0.13	0.18	0.13	0.15	0.15	0.14
1349SB114/	3	0 - 3	1349SB114-	09/20/02	< 0.0037	< 0.0037	< 0.0037	< 0.0037	0.0019 J	< 0.0037	0.0021 J	< 0.0037
1349SB115			COMP115[3]									
1349SB116	36	> 10	1349SB116[36]	09/23/02	0.022	0.0072	0.013 J+	0.0055 J+	0.0025 J,J+	0.005 J+	0.006 J+	< 0.0034
1349SB117	3	0 - 3	1349SB117[3]	09/24/02	< 0.0038	< 0.0038	< 0.0038	< 0.0038	< 0.0038	< 0.0038	0.002 J	< 0.0038
	5	3 - 10	1349SB117[6]	09/24/02	< 0.0038	< 0.0038	< 0.0038	< 0.0038	0.0019 J	< 0.0038	0.002 J	< 0.0038
1349SB118	3	0 - 3	1349SB118[3]	09/24/02	< 0.0072	< 0.0072	< 0.0072 Q-28a,UJ	< 0.0072	< 0.0072	< 0.0072	< 0.0072	< 0.0072 UJ
	3.5	3 - 10	DUP092402B	09/24/02	< 0.0078	< 0.0078	< 0.0078 Q-28a,UJ	< 0.0078	< 0.0078	< 0.0078	< 0.0078	< 0.0078 UJ
	6	3 - 10	1349SB118[6]	09/24/02	< 0.0076	< 0.0076	< 0.0076 Q-28a,UJ	< 0.0076	< 0.0076	< 0.0076	< 0.0076	< 0.0076 UJ
1349SB119	3	0 - 3	1349SB119[3]	09/24/02	< 0.0037	< 0.0037	< 0.0037	< 0.0037	0.002 J	< 0.0037	0.0024 J	< 0.0037
101007170	6	3 - 10	1349SB119[6]	09/24/02	< 0.0037	< 0.0037	< 0.0037	< 0.0037	< 0.0037	< 0.0037	< 0.0037	< 0.0037
1349SB120	3	0 - 3	1349SB120[3]	09/24/02	< 0.0079	< 0.0079	< 0.0079 Q-28a,UJ	< 0.0079	< 0.0079	< 0.0079	0.0041 J	< 0.0079 UJ
	6	3 - 10	1349SB120[6]	09/24/02	NA <sup>1</sup>	NA <sup>1</sup>	NA <sup>1</sup>	NA <sup>1</sup>	NA <sup>1</sup>	NA <sup>1</sup>	NA <sup>1</sup>	NA <sup>1</sup>
1349SB121	2	0 - 3	1349SB121[2.0]	04/24/03	0.010 J	0.023	0.059	0.12	0.1	0.11	0.053	0.036
	5	3 - 10	1349SB121[5.0]	04/24/03	< 0.0076	< 0.0076	< 0.0076	< 0.0076	< 0.0076	< 0.0076	< 0.0076	< 0.0076
	7	3 - 10	1349SB121[7.0]	04/24/03	< 0.0075	< 0.0075	< 0.0075	< 0.0075	< 0.0075	< 0.0075	< 0.0075	< 0.0075
1349SB122	3	0 - 3	1349SB122[3.0]	04/24/03	< 0.015	< 0.015	0.051 J	0.026	0.033	0.051	0.06	0.012 J
	3.5	3 - 10	DUP042403A	04/24/03	< 0.015	< 0.015	0.055 J	0.03	0.045	0.063	0.057	0.015 J
	5	3 - 10	1349SB122[5.0]	04/24/03	0.0053 J	0.0063 J	0.024	0.042	0.084	0.11	0.1	0.012 J
	7	3 - 10	1349SB122[7.0]	04/24/03	< 0.081	< 0.081	< 0.081	< 0.081	< 0.160	0.120 J	0.088 J	< 0.160

Boring Location	Sample Depth	Soil Cleanup Interval (feet bgs)	Sample ID	Sample Date	Chrysene (mg/kg)	Dibenz(a,h)- Anthracene (mg/kg)	Fluoranthene (mg/kg)	Fluorene (mg/kg)	Indeno(1,2,3-c,d)- Pyrene (mg/kg)	Naphthalene (mg/kg)	Phenanthrene (mg/kg)	<b>Pyrene</b> (mg/kg)
Soil Cleanup Lev	els 1											
0 - 3 feet bgs					4	0.078	820	770	0.27	480	600	620
3 - 10 feet bgs					4	0.078	820	770	0.27	480	600	620
>10 feet bgs and <	< 5 feet above	groundwater			54		316	60		9	86	241
>10 feet bgs and >		groundwater			54		316	60		9	86	241
1349SB107	2.5	0 - 3	1349SB107[2.5]	09/20/02	< 0.37	0.230 J	0.210 J	< 0.37	0.220 J,J+	< 0.37	< 0.37	< 0.37
	5.5	3 - 10	1349SB107[5.5]	09/20/02	< 0.038	0.026 J	0.024 J	< 0.038	0.026 J	< 0.038	< 0.038	0.023 J
	10.5	> 10	1349SB107[10.5]	09/20/02	< 0.0036	0.0022 J	0.0024 J	< 0.0036	0.0024 J	< 0.0036	< 0.0036	0.0021 J
	15.5	> 10	1349SB107[15.5]	09/20/02	< 0.0038	< 0.0038	< 0.0038	< 0.0038	< 0.0038	< 0.0038	< 0.0038	< 0.0038
	20.5	> 10	1349SB107[20.5]	09/20/02	< 0.0041	0.0026 J	0.0027 J	< 0.0041	0.0023 J	< 0.0041	0.0034 J	< 0.0041
	25.5	> 10	1349SB107[25.5]	09/20/02	< 0.0035	0.0021 J	0.0019 J	< 0.0035	0.0019 J	0.0033 J	0.0019 J	< 0.0035
	30.5	> 10	1349SB107[30.5]	09/20/02	0.017	0.0039	0.0098	0.0037	0.0029 J	0.0023 J	0.082	0.011
1349SB108	2.5	0 - 3	1349SB108[2.5]	09/20/02	0.0048 J+	0.0027 J,J+	0.0063	< 0.0036	0.0044 J+	< 0.0036	0.0026 J	0.0075 J+
	5.5	3 - 10	1349SB108[5.5]	09/20/02	< 0.0037	< 0.0037	< 0.0037	< 0.0037	< 0.0037	< 0.0037	< 0.0037	< 0.0037
	11	> 10	1349SB108[11]	09/20/02	< 0.0053	< 0.0053	< 0.0053	< 0.0053	< 0.0053	< 0.0053	< 0.0053	< 0.0053
	16	> 10	1349SB108[16]	09/20/02	< 0.0052	< 0.0052	< 0.0052	< 0.0052	< 0.0052	< 0.0052	< 0.0052	< 0.0052
	21	> 10	1349SB108[21]	09/20/02	< 0.004	< 0.004	0.0021 J	< 0.004	0.0022 J	< 0.004	< 0.004	< 0.004
	26	> 10	1349SB108[26]	09/20/02	< 0.0052	< 0.0052	< 0.0052	< 0.0052	< 0.0052	< 0.0052	< 0.0052	< 0.0052
	26.5	> 10	DUP092002B	09/20/02	< 0.004	< 0.004	< 0.004	< 0.004	< 0.004	< 0.004	< 0.004	< 0.004
	31	> 10	1349SB108[31]	09/20/02	< 0.004	< 0.004	< 0.004	< 0.004	< 0.004	< 0.004	< 0.004	< 0.004
1349SB111	2.5	0 - 3	1349SB111[2.5]	09/20/02	< 0.360	0.220 J,J+	0.190 J	< 0.360	0.210 J	< 0.360	< 0.360	0.290 J
	6	3 - 10	1349SB111[6]	09/20/02	< 0.0037	< 0.0037	< 0.0037	< 0.0037	< 0.0037	< 0.0037	< 0.0037	< 0.0037
	10.5	> 10	1349SB111[10.5]	09/20/02	< 0.0036	< 0.0036	< 0.0036	< 0.0036	< 0.0036	< 0.0036	< 0.0036	< 0.0036
	16	> 10	1349SB111[16]	09/20/02	< 0.0035	0.0021 J	0.0021 J	0.0032 J	0.002 J	< 0.0035	0.0065	0.002 J
	21	> 10	1349SB111[21]	09/20/02	0.18	0.047 J	0.1	0.78	0.043 J	2	1.4	0.22
	26	> 10	1349SB111[26]	09/20/02	0.250 Q-28a,J-	0.097 J	0.18	1.2	0.082 J	0.130 J	2.3	0.440 Q-28,J-
	26.5	> 10	DUP092002A	09/20/02	0.097	0.025 J	0.047	0.19	0.024 J	< 0.038	0.54	0.12
	31	> 10	1349SB111[31]	09/20/02	0.18	0.047 J	0.099	0.47	0.041 J	0.088	1.1	0.21
1349SB112/ 1349SB113	3	0 - 3	1349SB112- COMP113[3]	09/20/02	0.17	0.16	0.13	0.16	0.19	0.13	0.15	0.17
1349SB114/	3	0 - 3	1349SB114-	09/20/02	< 0.0037	0.0022 J	0.002 J	< 0.0037	0.0022 J	< 0.0037	< 0.0037	< 0.0037
1349SB115	3	0 - 3	COMP115[3]				0.002 J	< 0.0037	0.0022 3	< 0.0037	< 0.0037	< 0.0037
1349SB116	36	> 10	1349SB116[36]	09/23/02	0.012 J+	0.0032 J,J+	0.009 J+	0.036	0.0026 J,J+	0.0039 J-	0.047 J+	0.047 J+
1349SB117	3	0 - 3	1349SB117[3]	09/24/02	< 0.0038	0.0022 J	< 0.0038	< 0.0038	< 0.0038	< 0.0038	< 0.0038	< 0.0038
	5	3 - 10	1349SB117[6]	09/24/02	< 0.0038	0.0022 J	< 0.0038	< 0.0038	< 0.0038	< 0.0038	< 0.0038	< 0.0038
1349SB118	3	0 - 3	1349SB118[3]	09/24/02	< 0.0072 Q-28b,UJ	< 0.0072	< 0.0072	< 0.0072	< 0.0072	< 0.0072	< 0.0072	< 0.0072 Q-28,UJ
	3.5	3 - 10	DUP092402B	09/24/02	< 0.0078 Q-28b,UJ	< 0.0078	< 0.0078	< 0.0078	< 0.0078	< 0.0078	< 0.0078	< 0.0078 Q-28,UJ
	6	3 - 10	1349SB118[6]	09/24/02	< 0.0076 Q-28b,UJ	< 0.0076	< 0.0076	< 0.0076	< 0.0076	< 0.0076	< 0.0076	< 0.0076 Q-28,UJ
1349SB119	3	0 - 3	1349SB119[3]	09/24/02	< 0.0037	0.0022 J	0.0021 J	< 0.0037	0.0022 J	< 0.0037	< 0.0037	< 0.0037 U
	6	3 - 10	1349SB119[6]	09/24/02	< 0.0037	< 0.0037	< 0.0037	< 0.0037	< 0.0037	< 0.0037	< 0.0037	< 0.0037 U
1349SB120	3	0 - 3	1349SB120[3]	09/24/02	< 0.0079 Q-28b,UJ	0.0046 J	< 0.0079	< 0.0079	0.0042 J	< 0.0079	< 0.0079	< 0.0079 Q-28,UJ
	6	3 - 10	1349SB120[6]	09/24/02	NA <sup>1</sup>	NA <sup>1</sup>	NA <sup>1</sup>	NA <sup>1</sup>	NA <sup>1</sup>	NA <sup>1</sup>	NA <sup>1</sup>	NA <sup>1</sup>
1349SB121	2	0 - 3	1349SB121[2.0]	04/24/03	0.15	0.014 J	0.18	0.028	0.034	0.0077 J	0.24	0.38
	5	3 - 10	1349SB121[5.0]	04/24/03	< 0.0076	< 0.0076	< 0.0076	< 0.0076	< 0.0076	< 0.0076	< 0.0076	< 0.0076
	7	3 - 10	1349SB121[7.0]	04/24/03	< 0.0075	< 0.0075	< 0.0075	< 0.0075	< 0.0075	< 0.0075	< 0.0075	< 0.0075
1349SB122	3	0 - 3	1349SB122[3.0]	04/24/03	0.032	0.0096 J	0.048	< 0.015	0.022 J	0.0062 J	0.031	0.094
	3.5	3 - 10	DUP042403A	04/24/03	0.042	0.011 J	0.046	< 0.015	0.023 J	0.0054 J	0.034	0.098
	5	3 - 10	1349SB122[5.0]	04/24/03	0.24	0.025 J	0.046	0.042	0.047	0.0069 J	0.052	0.2
	7	3 - 10	1349SB122[7.0]	04/24/03	0.4	0.044 J	< 0.081	0.14	< 0.160	< 0.081	0.11	0.098

Boring Location	Sample Depth	Soil Cleanup Interval (feet bgs)	Sample ID	Sample Date	Acenaphthene (mg/kg)	Acenaphthylene (mg/kg)	Anthracene (mg/kg)	Benzo(a)- Anthracene (mg/kg)	Benzo(a)- Pyrene (mg/kg)	Benzo(b)- Fluoranthene (mg/kg)	Benzo(g,h,i)- Perylene (mg/kg)	Benzo(k)- Fluoranthene (mg/kg)
Soil Cleanup Lev	els 1											
0 - 3 feet bgs					2,700		5,900	0.43	0.04	0.43	620	0.43
3 - 10 feet bgs					2,700		5,900	0.43	0.04	0.43	620	0.43
>10 feet bgs and <	5 feet above	groundwater			NE		308	8	3	23	5,040	23
>10 feet bgs and >					NE		308	8	3	23	5,040	23
1349SB123	2	0 - 3	1349SB123[2.0]	04/24/03	< 0.015	< 0.015	0.065 J	0.029	0.048	0.073	0.043	0.015 J
	5	3 - 10	1349SB123[5.0]	04/24/03	< 0.034	< 0.034	< 0.034	< 0.085	0.046 J	0.1	0.087	< 0.085
	6.5	3 - 10	1349SB123[6.5]	04/24/03	< 0.0076	< 0.0076	< 0.0076	< 0.0076	< 0.0076	< 0.0076	< 0.0076	< 0.0076
	7	3 - 10	DUP042403B	04/24/03	< 0.0074	< 0.0074	< 0.0074	< 0.0074	< 0.0074	< 0.0074	< 0.0074	< 0.0074
1349SB124	2	0 - 3	1349SB124[2.0]	04/24/03	< 0.0073	< 0.0073	< 0.0073	0.0014 J	< 0.0073	< 0.0073	< 0.0073	< 0.0073
	5	3 - 10	1349SB124[5.0]	04/24/03	< 0.0074	< 0.0074	< 0.0074	< 0.0074	< 0.0074	< 0.0074	< 0.0074	< 0.0074
	7	3 - 10	1349SB124[7.0]	04/24/03	< 0.0075	< 0.0075	< 0.0075	< 0.0075	< 0.0075	< 0.0075	< 0.0075 UJ	< 0.0075
1349SB125	2	0 - 3	1349SB125[2.0]	04/24/03	< 0.0071	< 0.0071	0.0017 J	0.012	0.017	0.031	0.021	0.087
	5	3 - 10	1349SB125[5.0]	04/24/03	0.0061 J	0.0055 J	0.053 J	0.049	0.037	0.12	0.022 J	< 0.029
	6.5	3 - 10	1349SB125[6.5]	04/24/03	0.2	0.017	< 0.014	0.064	0.021 J	0.084	0.013 J	< 0.029
	7	3 - 10	DUP042403C	04/24/03	0.068	0.035	0.011 J	0.041	< 0.028	0.051	0.0076 J	< 0.028
	10	3 - 10	1349SB125[10.0]	04/24/03	< 0.007	< 0.007	< 0.007	< 0.007	< 0.007	< 0.007	< 0.007 UJ	< 0.007
	20	> 10	1349SB125[20.0]	04/24/03	< 0.0068	< 0.0068	< 0.0068	< 0.0068	< 0.0068	< 0.0068	< 0.0068 UJ	< 0.0068
	25	> 10	1349SB125[25.0]	04/24/03	< 0.0069	< 0.0069	< 0.0069	< 0.0069	< 0.0069	< 0.0069	< 0.0069 UJ	< 0.0069
1349SB126	2	0 - 3	1349SB126[2.0]	04/25/03	< 0.030	< 0.030	0.0061 J	0.024 J	0.016 J	0.033	0.018 J	0.011 J
	5	3 - 10	1349SB126[5.0]	04/25/03	< 0.054	< 0.054	< 0.054	0.028 J	0.084	0.085	0.062	< 0.054
	7	3 - 10	1349SB126[7.0]	04/25/03	0.0034 J	< 0.0095	0.004 J	0.0028 J	< 0.0095	< 0.0095	< 0.0095	< 0.0095
	20	> 10	1349SB126[20.0]	04/25/03	< 0.0086	< 0.0086	< 0.0086	< 0.0086	< 0.0086	< 0.0086	< 0.0086	< 0.0086
	25	> 10	1349SB126[25.0]	04/25/03	< 0.0085	< 0.0085	< 0.0085	< 0.0085	< 0.0085	< 0.0085	< 0.0085	< 0.0085
1349SB127	2.5	0 - 3	1349SB127[2.5]	04/25/03	< 0.031	< 0.031	< 0.031	0.021 J	0.033	0.045	0.041	0.012 J
	4.5	3 - 10	1349SB127[4.5]	04/25/03	< 0.032	< 0.032	< 0.032	< 0.032	< 0.032	< 0.032	< 0.032	< 0.032
	5	3 - 10	DUP042503A	04/25/03	< 0.0082	< 0.0082	< 0.0082	< 0.0082	< 0.0082	< 0.0082	< 0.0082	< 0.0082
	7.5	3 - 10	1349SB127[7.5]	04/25/03	0.017	0.061	0.082	0.049	0.015 J	0.019 J	0.0067 J	< 0.029
	12	> 10	1349SB127[12.0]	04/25/03	2.1	0.83	1.2	0.73	0.27	0.28	0.081 J	< 0.095
	20	> 10	1349SB127[20.0]	04/25/03	4.2	1.8	2	1.3	0.42	0.45	0.120 J	< 0.130
	25	> 10	1349SB127[25.0]	04/25/03	0.1	0.033	0.058	0.044	< 0.030	0.015 J	< 0.030	< 0.030
1349SB128	3	0 - 3	1349SB128[3.0]	04/24/03	< 0.0078	< 0.0078	< 0.0078	< 0.0078	< 0.0078	< 0.0078	< 0.0078	< 0.0078
	6	3 - 10	1349SB128[6.0]	04/24/03	< 0.0076	< 0.0076	< 0.0076	< 0.0076	< 0.0076	< 0.0076	0.0021 J	< 0.0076
1349SB129	3	0 - 3	1349SB129[3.0]	04/24/03	< 0.0079	< 0.0079	< 0.0079	< 0.0079	< 0.0079	< 0.0079	< 0.0079	< 0.0079
	6	3 - 10	1349SB129[6.0]	04/24/03	< 0.0076	< 0.0076	< 0.0076	< 0.0076	< 0.0076	< 0.0076	< 0.0076	< 0.0076
1349SB130	3	0 - 3	1349SB130[3.0]	04/24/03	< 0.015	< 0.015	< 0.015	< 0.015	< 0.015	0.0089 J	< 0.0077 J	< 0.015
	6	3 - 10	1349SB130[6.0]	04/24/03	< 0.0077	< 0.0077	< 0.0077	< 0.0077	< 0.015	< 0.015	< 0.015	< 0.015
1349SB131	2.5	0 - 3	1349SB131[2.5]	04/24/03	< 0.0082	< 0.0082	< 0.0082	< 0.0082	< 0.016	< 0.016	0.0032 J	< 0.016
	6	3 - 10	1349SB131[6.0]	04/24/03	< 0.0077	< 0.0077	< 0.0077	< 0.0077	< 0.0077	< 0.0077	< 0.0077	< 0.0077
1349SB132	2.5	0 - 3	1349SB132[2.5]	04/24/03	< 0.0079	< 0.0079	< 0.0079	< 0.0079	< 0.016	< 0.016	< 0.016	< 0.016
	5	3 - 10	1349SB132[5.0]	04/24/03	< 0.0077	< 0.0077	< 0.0077	< 0.0077	< 0.0077	< 0.0077	< 0.0077	< 0.0077
1349SB133	2.5	0 - 3	1349SB133[2.5]	04/24/03	< 0.017	< 0.017	< 0.017	0.015 J	0.016 J	0.027	0.010 J	0.0076 J
	5	3 - 10	1349SB133[5.0]	04/24/03	< 0.0077	< 0.0077	< 0.0077	< 0.0077	< 0.0077	< 0.0077	< 0.0077	< 0.0077

1349SB124 1349SB125	feet above		1349SB123[2.0] 1349SB123[5.0] 1349SB123[6.5]	04/24/03	4 4 54 54	0.078 0.078	820	770				
- 10 feet bgs - 10 feet bgs and < 5 feet logs and > 5 feet logs an	feet above 2 5 6.5 7 2 5 5	groundwater 0 - 3 3 - 10 3 - 10 3 - 10	1349SB123[5.0]		4 54	0.078		770				
10 feet bgs and < 5 fe 10 feet bgs and > 5 fe 1349SB123 1349SB124 1349SB125	feet above 2 5 6.5 7 2 5 5	groundwater 0 - 3 3 - 10 3 - 10 3 - 10	1349SB123[5.0]		54		020		0.27	480	600	620
10 feet bgs and > 5 fe 1349SB123 1349SB124 1349SB125	feet above 2 5 6.5 7 2 5 5	groundwater 0 - 3 3 - 10 3 - 10 3 - 10	1349SB123[5.0]				820	770	0.27	480	600	620
1349SB123 1349SB124 1349SB125	2 5 6.5 7 2 5	0 - 3 3 - 10 3 - 10 3 - 10	1349SB123[5.0]		54		316	60		9	86	241
1349SB124 1349SB125	5 6.5 7 2 5	3 - 10 3 - 10 3 - 10	1349SB123[5.0]				316	60		9	86	241
1349SB124 1349SB125	6.5 7 2 5	3 - 10 3 - 10		0.4/0.1/0.5	0.031	0.0099 J	0.029	< 0.015	0.024 J	< 0.015	0.03	0.11
1349SB124 1349SB125	7 2 5	3 - 10	1349SB123[6.5]	04/24/03	0.23	0.025 J	0.014 J	< 0.034	0.042 J	< 0.034	0.028 J	0.039 J
1349SB125	2 5			04/24/03	< 0.0076	< 0.0076	< 0.0076	< 0.0076	< 0.0076	< 0.0076	< 0.0076	< 0.0076
1349SB125	5	0 2	DUP042403B	04/24/03	< 0.0074	< 0.0074	< 0.0074	< 0.0074	< 0.0074	< 0.0074	< 0.0074	< 0.0074
			1349SB124[2.0]	04/24/03	< 0.0073	< 0.0073	< 0.0073	< 0.0073	< 0.0073	< 0.0073	< 0.0073	< 0.0073
	7	3 - 10	1349SB124[5.0]	04/24/03	< 0.0074	< 0.0074	< 0.0074	< 0.0074	< 0.0074	< 0.0074	< 0.0074	< 0.0074
		3 - 10	1349SB124[7.0]	04/24/03	< 0.0075	< 0.0075	< 0.0075	< 0.0075	< 0.0075	< 0.0075	< 0.0075	< 0.0075
	2	0 - 3	1349SB125[2.0]	04/24/03	0.0016	0.0035 J	0.01	< 0.0071	0.011	< 0.0071	0.0086	0.025
	5	3 - 10	1349SB125[5.0]	04/24/03	0.16	0.015 J	0.051	0.0052 J	0.010 J	< 0.015	0.064	0.32
	6.5	3 - 10	1349SB125[6.5]	04/24/03	0.21	0.0098 J	0.19	0.54	0.0057 J	0.17	2.4	0.25
	7	3 - 10	DUP042403C	04/24/03	0.15	0.0057 J	0.065	0.045	< 0.028	0.048	1.6	0.17
	10	3 - 10	1349SB125[10.0]	04/24/03	< 0.007	< 0.007	< 0.007	< 0.007	< 0.007	< 0.007	< 0.007	< 0.007
	20	> 10	1349SB125[20.0]	04/24/03	< 0.0068	< 0.0068	< 0.0068	< 0.0068	< 0.0068	< 0.0068	< 0.0068	< 0.0068
	25	> 10	1349SB125[25.0]	04/24/03	0.0018 J	< 0.0069	< 0.0069	< 0.0069	< 0.0069	< 0.0069	0.0063 J	< 0.0069
1349SB126	2	0 - 3	1349SB126[2.0]	04/25/03	0.046	< 0.030	0.032	< 0.0 30	0.011 J	< 0.030	0.043	0.043
	5	3 - 10	1349SB126[5.0]	04/25/03	0.063	0.016 J	0.010 J	< 0.054	0.25 J	< 0.054	0.035 J	0.14
	7	3 - 10	1349SB126[7.0]	04/25/03	0.004 J	< 0.0095	< 0.0095	< 0.0095	< 0.0095	< 0.0095	0.023	0.0043 J
	20	> 10	1349SB126[20.0]	04/25/03	< 0.0086	< 0.0086	< 0.0086	< 0.0086	< 0.0086	0.0038 J	< 0.0086	< 0.0086
	25	> 10	1349SB126[25.0]	04/25/03	< 0.0085	< 0.0085	< 0.0085	< 0.0085	< 0.0085	< 0.0085	< 0.0085	< 0.0085
1349SB127	2.5	0 - 3	1349SB127[2.5]	04/25/03	0.021 J	0.0069 J	0.028 J	< 0.031	0.019 J	< 0.031	0.023 J	0.041
	4.5	3 - 10	1349SB127[4.5]	04/25/03	19 J	< 0.032	< 0.032	< 0.032	< 0.032	< 0.032	< 0.032	0.039
	5	3 - 10	DUP042503A	04/25/03	< 0.0082	< 0.0082	< 0.0082	< 0.0082	< 0.0082	< 0.0082	< 0.0082	< 0.0082
	7.5	3 - 10	1349SB127[7.5]	04/25/03	0.085	< 0.029	0.026 J	0.35	< 0.029	0.63	0.56	0.087
	12	> 10	1349SB127[12.0]	04/25/03	1.3	0.035 J	0.37	4.8	0.040 J	11	7.5	1.5
	20	> 10	1349SB127[20.0]	04/25/03	2.1	0.063 J	0.63	1.3	0.068 J	17	12	2.4
1240CD 120	25	> 10	1349SB127[25.0]	04/25/03	0.072	< 0.030	0.018 J	0.075	< 0.030	0.14	0.39	0.84
1349SB128	3	0 - 3	1349SB128[3.0]	04/24/03	< 0.0078	< 0.0078	< 0.0078	< 0.0078	< 0.0078	< 0.0078	< 0.0078	< 0.0078
1240CD 120	6	3 - 10	1349SB128[6.0]	04/24/03	< 0.0076	< 0.0076	< 0.0076	< 0.0076	< 0.0076	< 0.0076	< 0.0076	< 0.0076
1349SB129	3	0 - 3	1349SB129[3.0]	04/24/03	< 0.0079	< 0.0079	< 0.0079	< 0.0079	< 0.0079	< 0.0079	< 0.0079	< 0.0079
1349SB130	3	3 - 10 0 - 3	1349SB129[6.0] 1349SB130[3.0]	04/24/03 04/24/03	< 0.0076 < 0.015	< 0.0076 0.0029 J	< 0.0076 < 0.015	< 0.0076 < 0.015	< 0.0076 < 0.015	< 0.0076 < 0.015	< 0.0076 < 0.015	< 0.0076 < 0.015
134930130	6				< 0.015					< 0.015	< 0.015	
1349SB131	2.5	3 - 10 0 - 3	1349SB130[6.0] 1349SB131[2.5]	04/24/03 04/24/03	< 0.0077	< 0.015 < 0.016	< 0.0077 0.0037 J	< 0.0077 0.0076 J	< 0.015 < 0.016	< 0.0077	0.0077 0.0022 J	< 0.0077 0.0042 J
134730131	6	3 - 10	1349SB131[2.5] 1349SB131[6.0]	04/24/03	< 0.0082	< 0.016	< 0.0037 3	< 0.0076 3	< 0.016	< 0.0082	< 0.0077	< 0.0077
1240CD122	2.5				< 0.0077		< 0.0077				< 0.0077	
1349SB132	5	0 - 3 3 - 10	1349SB132[2.5] 1349SB132[5.0]	04/24/03 04/24/03	< 0.0079	< 0.016 < 0.0077	< 0.0079	< 0.0079 < 0.0077	< 0.016 < 0.0077	< 0.0079 < 0.0077	< 0.0079	< 0.0079 < 0.0077
1349SB133	J	0 - 3	1349SB132[5.0] 1349SB133[2.5]	04/24/03	0.02	0.0077 0.0033 J	0.023	< 0.0077	0.0062 J	< 0.0077	0.010 J	0.0077
134730133	2.5	3 - 10	1349SB133[5.0]	04/24/03	< 0.0077	< 0.0033 3	0.023	< 0.017	0.0002 J	< 0.017	0.010 J	0.029

#### Notes

-- - Not applicable

NE - Not Established

µg/kg - micrograms per kilogram

PAH - Polycyclic Aromatic Hydrocarbon

**Bold** indicates value above cleanup level

- J+ The analyte was positively identified; the associated numerical value is biased high due to a high surrogate recovery and should be considered an approximate concentration of the analyte in the sample.
- J The analyte was positively identified; the associated numerical value is the approximate concentration of the analyte in the sample.
- U The analyte was analyzed for, but was not detected above the reported sample quantitation limit.
- UJ The analyte was not detected above the reported sample quantitation limit. However, the reported quantitation limit is approximate and may or may not represent the actual limit of quantitation necessary to accurately and precisely measure the analyte in the sample.
- Q-28 The opening calibration verification standard was outside acceptance criteria by 1.2%. Although the Laboratory Control Sample verified the accuracy of the batch, this should be considered in evaluating the data for its intended purpose.
- Q-28a The opening calibration verification standard was outside acceptance criteria by 1.7%. Although the Laboratory Control Sample verified the accuracy of the batch, this should be considered in evaluating the data for its intended purpose.
- Q-28b The opening calibration verification standard was outside acceptance criteria by 8.7%. Although the Laboratory Control Sample verified the accuracy of the batch, this should be considered in evaluating the data for its intended purpose.
- 1 Cleanup level values listed are obtained from Tables 1, 2 and 4 of California Environmental Protection Agency, Regional Water Quality Control Board, San Francisco Bay Region. Order R2-2003-0080, Revised Site Cleanup Requirements (SCRs) and Recession of Order No. 91-082 and Order No. 96-070, August, 2003.

#### Appendix B-3

#### Summary of TPH and BTEX Results at Telecommunications Conduit Building 1349

#### Presidio of San Francisco, California

Sample ID	Sample Depth	Soil Cleanup Interval	Sample Date	TPH As Diesel (Carbon Range C12-C24) (mg/kg)	Unknown TPH as Diesel (Carbon Range C12-C24)2 (mg/kg)	TPH As Fuel Oil (Carbon Range C24-C36) (mg/kg)	Benzene (mg/kg)	Toluene (mg/kg)	Ethylbenzene (mg/kg)	Xylenes (Total) (mg/kg)
Soil Cleanup Lev	els (1)		•							
0 - 3 feet bgs				700	NE	980	0.6	270	125	55
3 - 10 feet bgs				1,380	NE	1,900	0.6	530	840	1,080
>10 feet bgs and <	5 feet above	groundwater		115	NE	160	0.005	0.005	0.009	0.009
> 10 feet bgs and	> 5 feet abov	e groundwate	r	15,000		15,000	140	420	60	180
CSC1	3	0-3	11/17/95	14,000			< 0.12 UJ	0.17 J	0.53 J	4.3 J
CSC6	3	0-3	11/17/95	24,000			< 0.19 U	< 0.19 U	2.4	12 J
CSC8	3	0-3	11/17/95	18,000			< 0.052 U	< 0.052 U	0.64	4.4 J
CSC4	4	3-10	11/17/95	14,000			< 0.12 UJ	< 0.12 UJ	0.47 J	1.3 J
CSC3	6	3-10	11/17/95	13,000			< 0.12 UJ	< 0.12 UJ	0.21 J	0.91 J
CSC2	12	> 10	11/17/95	3,200			< 0.0058 UJ	0.0067 J	0.034 J	0.22 J
CSC5	12	> 10	11/17/95	6,300			< 0.11 U	0.32	1.8	11 J
CSC7	12	> 10	11/17/95	10,000			< 0.061 U	0.099	0.97	3.1 J
CSC9	12	> 10	11/17/95	5,900			< 0.21 U	0.99	1.2	9 J

#### Notes

-- - Not analyzed

TPH - Total Petroleum Hydrocarbons

bgs - below ground surface

mg/kg - milligrams per kilogram

Detected concentrations in **Bold** indicate an exceedance of applicable soil cleanup levels.

- J The analyte was positively identified; the associated numerical value is the approximate concentration of the analyte in the sample.
- U The analyte was analyzed for, but was not detected above the reported sample quantitation limit.
- UJ The analyte was not detected above the reported sample quantitation limit. However, the reported quantitation limit
- 1 Cleanup level values listed are obtained from Tables 1, 2 and 4 of California Environmental Protection Agency, Regional Water Quality Control Board, San Francisco Bay Region.
- 2 Total petroleum hydrocarbons were detected within the diesel range but the observed patterns did not match the standard.
  Order R2-2003-0080, Revised Site Cleanup Requirements (SCRs) and Recession of Order No. 91-082 and Order No. 96-070, August, 2003.

### Appendix B-4 Summary of PAH Results at Telecommunications Conduit Building 1349 Presidio of San Francisco, California

Sample	Sample	Soil	Sample		Pongo(a)	Benzo(a)-	Benzo(b)-	Benzo(g,h,i)-	Benzo(k)-		Fluor-				
ID	-	Screening Interval	Date	Anthropono	Benzo(a)- Anthracene	` '	Fluoranthene	Pervlene	Fluoranthene	Chrysene	anthene	Fluorene	Nanhthalana	Phenanthrene	Dynana
110	Depth		Date	Anthracene		Pyrene				•			Naphthalene		Pyrene
		(feet bgs)		(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)
Soil Clean	up Levels (	(1)													
0 - 3 feet b	gs			5,900	0.43	0.04	0.43	620	0.43	4.3	820	770	480	600	620
3 - 10 feet	bgs			5,900	0.43	0.04	0.43	620	0.43	4.3	820	770	480	600	620
>10 feet bg	gs and $< 5$ for	eet above GW		308	8	3	23	5,040	23	54	316	60	9	86	241
> 10 feet b	gs and $> 5$ f	eet above GW	7												
CSC1	3	0-3	11/17/95	< 1.10 U	< 2.3 U	2	< 2.3 U	< 2.3 U	< 2.3 U	< 1.1 U	< 1.1 U	4	24	<1.1 J	< 1.1 U
CSC6	3	0-3	11/17/95	< 12 UJ	< 23 UJ	< 4 UJ	< 23 UJ	< 23 UJ	< 2.3 UJ	< 12 UJ	< 1.2 UJ	< 12 UJ	51 J	15 J	< 12 UJ
CSC8	3	0-3	11/17/95	< 5.6 UJ	< 11 UJ	< 2 UJ	< 11 UJ	< 11 UJ	< 11 UJ	< 5.6 UJ	< 5.6 UJ	< 5.6 UJ	< 5.6 UJ	6.8 J	< 5.6 UJ
CSC3	6	3-10	11/17/95	< 2.4 U	< 4.9 U	<0.86 U	< 4.90 U	< 4.9 U	<4.9 U	< 2.4 U	< 2.4 U	< 2.4 U	4	< 2.4 U	< 2.4 U
CSC4	4	3-10	11/17/95	< 2.2 U	< 4.4 U	< <b>0.77</b> U	< 4.4 U	< 4.4	<4.9 U	< 2.2 U	< 2.2 U	< 2.2 U	16	< 2.2 U	< 2.2 U
CSC2	12	> 10	11/17/95	< 1.1 U	< 2.3 U	< 0.4 U	< 2.3 U	< 2.3 U	< 2.3 U	< 1.1 U	< 1.1 U	1	4	2	< 1.1 U
CSC5	12	> 10	11/17/95	< 0.11 U	< 0.22 U	89	< 0.22 U	< 0.22 U	< 0.22 U	0.15	<0.11 U	1.2 J	16	1.2 J	4
CSC7	12	> 10	11/17/95	< 0.12 U	< 0.25 U	< 0.44 U	<0.25 U	<0.25 U	<0.25 U	<0.12 U	<0.12 U	1.5	4	2.4 J	0.48
CSC9	12	> 10	11/17/95	< 1.2 UJ	< 2.4 UJ	< 420 UJ	< 2.4 UJ	< 2.4 UJ	< 2.4 UJ	< 1.2 UJ	< 1.2 UJ	1.4 J	17 J	1.8 J	<1.2 UJ

#### Notes

-- - Not applicable

GW - groundwater

mg/kg - milligrams per kilogram

PAH - Polycyclic Aromatic Hydrocarbon

- J The analyte was positively identified; the associated numerical value is the approximate concentration of the analyte in the sample.
- U The analyte was analyzed for, but was not detected above the reported sample quantitation limit.
- UJ The analyte was not detected above the reported sample quantitation limit. However, the reported quantitation limit is approximate and may or may not represent the actual limit of quantitation necessary to accurately and precisely measure the analyte in the sample.
- 1 Cleanup level values listed are obtained from Tables 1, 2 and 4 of California Environmental Protection Agency, Regional Water Quality Control Board, San Francisco Bay Region Order R2-2003-0080, Revised Site Cleanup Requirements (SCRs) and Recession of Order No. 91-082 and Order No. 96-070, August, 2003.

Well Name	Sample Date	pН	Alkalinity Total	Bicarbonate	Chloride	Dissolved	Fluoride	N as Nitrate	N as Nitrite	N as Nitrate + Nitrite	Sulfate
		1	Total			Oxygen	E300.0/	E300.0/	E300.0/	Nitrite	
	Analytical	Field	E310.1	E310.1	E300.0/	Field	E340.2/	E353.2/	E353.2/	E353.2	E300.0/
	Method <sup>1</sup>	Piciu	E310.1	E310.1	SW9056	Pielu	SW9056	SW9056	SW9056	E333.2	SW9056
			(mg/L)	(mg/L)	(mg/L)	(mg/L)	(mg/L)	(mg/L)	(mg/L)	(mg/L)	(mg/L)
1349MW01	03/15/04	5.60	280	280	740	0.39	0.11	2.2	< 0.1	NA	250
1	12/02/03	6.70	310	310	690	1.1	0.14	2.2	< 0.05	NA	220
	08/21/03	6.25	310	310	700	1.42	< 0.2	1.8	< 0.1	NA	220
	06/10/03	6.34	380	380	740	1.29	< 0.2	2.1	< 0.1	NA	230
İ	03/12/03	6.28	NA	NA	NA	1.59	NA	NA	NA	NA	NA
İ	12/09/02		360	360	750	0.76	< 0.2	1.7	< 0.1	NA	210
DUP1209021A	12/09/02		350	350	750		< 0.2	1.8	< 0.1	NA	220
1349MW01CL	12/09/02		350	350	360		1	1.4 J-	< 0.05 UJ	1.4 J-	220
	08/28/02		270	270	740	1.34	0.13	1.7	< 0.05	NA	240
	05/30/02		320	320	810	1.37	0.091 J	1.7	< 0.05	NA	230
	03/06/02		290	290	830	2.13	0.13	1.8	< 0.05	NA	250
	11/28/01		310	310	820	1.36	0.13	1.8	< 0.05	NA	240
	08/30/01		420	420	740	0.61	0.24	1.3	< 2.5	NA	180
DUP0830013A	08/30/01		430	430	740		0.14	1.2	< 2.5	NA	180
1349MW01CL	08/30/01		340	340	760		< 0.05	1.4 2	< 2.5	NA	210
	05/10/01		330	330	760	1.45	0.19	1.4	< 0.05	NA	220
	05/19/99		433	433	820	0.83	0.2	NA	NA	0.537	188
	02/19/99		468	468	731	1.83	0.15	NA	NA	0.641	192
	11/18/98		361	361	666	1.59	0.17	NA	NA	0.62	205
	08/18/98		574	574	701	2.24	0.11	NA	NA	0.404	161
	04/16/98		377	377	679	2.89	0.12	NA	NA	0.715	221
	01/22/98		509	509	673	1	0.124	NA	NA	0.416	159
	10/30/97		527	527	726	0.37	< 0.05	0.478	NA	0.368	158
	07/31/97		466	466	777	0.5	NA	0.532	NA	0.617	192
<u> </u>	05/01/97		489	489	768	1.17	NA	0.451	NA	NA	190
	02/10/97		374	374	888	1.26	NA	0.635	NA	< 0.05	262
	08/08/95		NA	NA	NA	NM	NA	NA	NA	NA	NA
1349MW02	08/12/04		700	700	600	0.4	< 0.1	1.5	< 0.1	NA	64
	05/26/04	7.09	660	660	650	0.59	0.11	1.3	< 0.1	NA	64
<u> </u>	03/15/04	7.11	630	630	670	0.44	< 0.1	1.4	< 0.1	NA	66
[	12/02/03	7.00	720	720	600	0.6	< 0.1	1.6	< 0.05	NA	64
	08/13/03	6.11	710	710	550	1.6	< 1	1.3 b,J-	< 0.5 UJ	NA	73

Well Name	Sample Date	pН	Alkalinity Total	Bicarbonate	Chloride	Dissolved Oxygen	Fluoride	N as Nitrate	N as Nitrite	N as Nitrate + Nitrite	Sulfate
			Total			Oxygen	E300.0/	E300.0/	E300.0/	Milite	
	Analytical	Field	E310.1	E310.1	E300.0/	Field	E340.2/	E353.2/	E353.2/	E353.2	E300.0/
	Method <sup>1</sup>	1 icia	L310.1	2310.1	SW9056	1 icia	SW9056	SW9056	SW9056	1333.2	SW9056
			(mg/L)	(mg/L)	(mg/L)	(mg/L)	(mg/L)	(mg/L)	(mg/L)	(mg/L)	(mg/L)
1349MW02	06/05/03	7.52	630	630	610	1.3	< 0.2	1.6	< 0.1	NA	62
DUP0605032A	06/05/03		620	620	610	NA	< 0.2	1.6	< 0.1	NA	62
	03/12/03	7.32	NA	NA	NA	0.3	NA	NA	NA	NA	NA
	12/04/02		660	660	580	1.8	< 0.2	1.7	< 0.1	NA	62
DUP1204023A	12/04/02		670	670	560		< 0.2	1.7	< 0.1	NA	63
	08/28/02		670	670	570	1	0.12	1.6	< 0.05	NA	68
1349MW02	05/30/02		680	680	630	0.7	0.12	1.6	< 0.05	NA	60
	03/06/02		640	640	680	1.2	0.13	1.6	< 0.05	NA	58
DUP0306022A	03/06/02		640	640	670		0.13	1.6	< 0.05	NA	59
	11/28/01		670	670	580	2.25	0.091 J	1.7	< 0.05	NA	60
DUP1128011A	11/28/01		680	680	570		0.1 J	1.8	< 0.05	NA	56
	08/30/01		660	660	570	NM	0.11	1.7	< 0.05	NA	64
DUP0830012A	08/30/01		660	660	550		0.11	1.7	< 0.05	NA	63
1349MW02CL	08/30/01		660	660	550		< 0.1	1.5 2	< 0.05	NA	56
	05/10/01		660	660	570	1.3	0.12	1.7	< 0.05	NA	62
	05/19/99		680	680	724	0.51	< 0.1	NA	NA	1.58	76
	02/19/99		706	706	766	0.6	< 0.1	NA	NA	1.29	80
	11/18/98		694	694	690	0.71	< 0.1	NA	NA	1.22	69
	08/18/98		688	688	637	0.39	< 0.1	NA	NA	1.24	69
	04/16/98		629	629	555	0.9	< 0.1	NA	NA	1.23	64
	01/22/98		689	689	586	1.34	< 0.1	NA	NA	1.12	60
	10/30/97		700	700	653	0.33	< 0.05	1.3	NA	1.21	72
	07/31/97		679	679	662	0.62	NA	1.29	NA	1.2	73
	05/01/97		696	696	661	0.31	NA	1.18	NA	NA	61
	02/10/97		548	548	501	0.5	NA	0.924	NA	1.3	52
	08/08/95		NA	NA	NA	NM	NA	NA	NA	NA	NA
1349MW03	03/12/03		NA	NA	NA	NM	NA	NA	NA	NA	NA
	08/28/02		440	440	110	1.4	< 0.1	5.9	< 0.05	NA	42
DUP0828022A	08/28/02		450	450	100		< 0.1	5.8	< 0.05	NA	42
1349MW03CL	08/28/02		420	420	110		< 1	6.1 2	< 1	NA	43
1349MW03	05/30/02		460	460	100	1.2	0.22	7	< 0.05	NA	41
DUP0530021A	05/30/02		470	470	110		0.22	7.4	< 0.05	NA	42

Well Name	Sample Date	pН	Alkalinity Total	Bicarbonate	Chloride	Dissolved Oxygen	Fluoride	N as Nitrate	N as Nitrite	N as Nitrate + Nitrite	Sulfate
			1 Otal			Oxygen	E300.0/	E300.0/	E300.0/	Nitrite	
	Analytical	Field	E310.1	E310.1	E300.0/	Field	E340.2/	E353.2/	E353.2/	E353.2	E300.0/
	Method <sup>1</sup>	Ficia	E310.1	E310.1	SW9056	Ticiu	SW9056	SW9056	SW9056	E333.2	SW9056
			(mg/L)	(mg/L)	(mg/L)	(mg/L)	(mg/L)	(mg/L)	(mg/L)	(mg/L)	(mg/L)
1349MW03CL	05/30/02		460	460	100		< 1	5.6 <sup>2</sup>	< 1	NA	44
Ī	03/06/02		470	470	110	1.1	0.18	5.6	< 0.05	NA	47
DUP0306022B	03/06/02		470	470	110		0.16	5.6	< 0.05	NA	47
1349MW03CL	03/06/02		460	460	110		< 1	5.9 <sup>2</sup>	< 1	NA	49
Ī	11/28/01		490	490	140	1.8	0.073 J	6.4	< 0.05	NA	46
DUP1128011B	11/28/01		480	480	140		0.13	6.6	< 0.05	NA	47
1349MW03CL	11/28/01		470	470	330		< 1	6.8 2	< 1	NA	73
	08/30/01		500	500	140	0.5	0.18	6.4	< 0.05	NA	49
	05/10/01		490	490	120	1.2	0.11	5.2	< 0.05	NA	49
	05/19/99		501	501	152	1.32	< 0.1	NA	NA	4.75	54
	02/19/99		472	472	106	1.61	< 0.1	NA	NA	5.19	47
	11/18/98		479	479	142	1.45	< 0.1	NA	NA	5.74	45
	08/18/98		482	482	138	1.56	< 0.1	NA	NA	5.32	45
Ī	04/16/98		461	461	110	1.63	< 0.1	NA	NA	5	45
	01/22/98		424	424	53.3	2.35	0.104	NA	NA	5.34	46
	10/30/97		460	460	174	1.03	< 0.05	5.64	NA	5.27	50
	07/31/97		451	451	145	1.14	NA	5.52	NA	5.33	46
	05/01/97		500	500	162	1.28	NA	4.58	NA	NA	48
	02/10/97		427	427	63	1.79	NA	5.84	NA	6.26	35
	08/08/95		NA	NA	NA	NM	NA	NA	NA	NA	NA
1349MW03R	08/10/04		350	350	68	3.94	< 0.1	4.6	< 0.05	NA	30
	05/26/04	7.64	340	340	79	5.7	< 0.1	4.5	< 0.05	NA	31
1349MW03R	03/09/04	7.68	380	380	78	7.08	< 0.1	4.5	< 0.05	NA	33
	12/02/03	7.90	350	350	72	5.2	< 0.1	4.8	< 0.05	NA	22
	08/13/03	8.00	360	360	78	4.8	< 0.5	4.5 b,J-	< 0.25 UJ	NA	32
	06/09/03	8.10	330	330	130	2.6	0.37	4.7	0.1	NA	33
1349MW100	08/10/04		970	970	1000	0.7	0.29	< 0.05	< 0.1	NA	0.51
[	05/27/04	6.30	940	940	1100	0.55	0.28	< 0.05	< 0.1	NA	2
l L	03/16/04	6.77	900	900	830	0.37	0.24	< 0.05	< 0.1	NA	10
<u>[</u>	12/02/03	6.70	890	890	1,200	1	0.24	< 0.1	< 0.1	NA	< 1
<u> </u>	08/12/03	6.19	800	800	1,100	0.5	< 0.5	< 0.25	< 0.25	NA	< 2.5
<u> </u>	06/09/03	6.84	860	860	890	1.8	< 0.5	< 0.25	< 0.25	NA	3.5
	03/12/03	6.50	810	810	840	0.6	< 0.2	< 0.1	< 0.1	NA	7.7

Well Name	Sample Date	pН	Alkalinity Total	Bicarbonate	Chloride	Dissolved Oxygen	Fluoride	N as Nitrate	N as Nitrite	N as Nitrate + Nitrite	Sulfate
			20002			011, gen	E300.0/	E300.0/	E300.0/	11101100	
	Analytical	Field	E310.1	E310.1	E300.0/	Field	E340.2/	E353.2/	E353.2/	E353.2	E300.0/
	Method <sup>1</sup>				SW9056		SW9056	SW9056	SW9056		SW9056
			(mg/L)	(mg/L)	(mg/L)	(mg/L)	(mg/L)	(mg/L)	(mg/L)	(mg/L)	(mg/L)
1349MW100	12/10/02		660	660	1,300	0.9	< 0.2	< 0.1	< 0.1	NA	9.2
1349MW101	03/09/04	7.80	260	260	210	3.52	0.13	3.5	< 0.05	NA	19
Ī	12/02/03	7.90	390	390	230	1.4	0.14	2.4	< 0.05	NA	19
Ī	08/19/03	8.00	280	280	260	1.7	0.25	2.5	< 0.05	NA	25
Ī	06/09/03	7.77	230	230	300	1.1	0.47	4.3	0.13	NA	38
1349MW102	08/10/04		580	580	400	1.54	0.24	0.8	< 0.05	NA	42
DUP0810042A	08/10/04		570	570	420	NA	0.24	0.54	< 0.05	NA	41
1349MW102	05/27/04	6.70	600	600	410	1.1	0.27	0.52	< 0.05	NA	44
DUP0527041A	05/27/04	6.70	630	630	400	NA	0.26	0.74	< 0.05	NA	47
1349MW102CL	05/27/04	6.70	620	620	88	NA	0.29	0.6	< 0.05	0.6	18
Ī	03/10/04	6.72	540	540	470	0.5	0.27	0.4	< 0.05	NA	48
DUP0310041A	03/10/04	6.72	550	550	470		0.27	0.4	< 0.05	NA	47
1349MW102CL	03/10/04	6.72	530	530	450		0.28	0.45 J	< 0.05 UJ	0.45 HT-04,J	44
ļ ļ	12/10/03	6.60	690	690	480	2	0.29	0.09	< 0.05	NA	43
DUP1210031A	12/10/03		670	670	480	NA	0.28	0.1	< 0.05	NA	43
ļ l	08/12/03	6.92	740	740	430	1.1	0.47	0.17 b,J	< 0.1 UJ	NA	47
Ī	06/09/03	6.80	660	660	560	1.9	0.35	0.14	< 0.1	NA	68
DUP0609032A	06/09/03	6.80	650	650	570	NM	0.34	0.11	< 0.1	NA	70
1349MW102CL	06/09/03	6.80	670	670	490	NM	0.6	0.13	< 0.05	0.13	59
1349MW103	03/15/04	7.01	490	490	830	0.52	0.42	< 0.05	< 0.1	NA	100
Ī	12/03/03	7.70	450	450	800	1.2	0.43	< 0.1	< 0.1	NA	97
DUP1203032A	12/03/03		450	450	800	NA	0.41	< 0.1	< 0.1	NA	110
	08/12/03	7.76	400	400	790	2.4	0.54	< 0.1	< 0.1	NA	110
ļ l	06/05/03	8.20	310	310	830	1.8	0.66	< 0.1	< 0.1	NA	110
1349MW104	03/15/04	6.82	670	670	820	0.32	0.16	0.35	< 0.1	NA	62
ļ l	12/02/03	7.50	740	740	790	1	< 0.2	0.12	< 0.1	NA	58
ļ	08/12/03	7.71	690	690	770	1.3	< 0.2	< 0.1	< 0.1	NA	55
[	06/06/03	7.87	600	600	870	3	0.21	0.17	< 0.1	NA	67
1349MW105	03/15/04	7.00	240	240	590	0.31	0.41	< 0.05	< 0.1	NA	150
<b> </b>	12/02/03	6.40	260	260	600	1.2	0.38	< 0.05	< 0.05	NA	150
ļ į	08/12/03	8.10	280	280	600	3.1	0.48	< 0.1	< 0.1	NA	130
<b> </b>	06/09/03	8.00	230	230	760	1.2	0.63	< 0.1	< 0.1	NA	130

### Appendix B-5 Results of General Chemistry Analyses in Groundwater Building 1349

#### Presidio of San Francisco, California

#### Notes

- 1 The identified analytical method(s) are for analyses performed beginning in the Second Quarter 2001. The analytical methods used during previous quarters are identified in their respective quarterly report.
- 2 The QC laboratory nitrate results shown have been converted to nitrate as nitrogen (nitrate-N) as other laboratory results are reported. The QC laboratory reported nitrate as NO<sub>3</sub> concentrations (nitrate-NO<sub>3</sub>) which are 4.43 times higher than nitrate-N concentrations.

mg/L - milligrams per liter

NA - Not analyzed

NM - Not measured

- "--" dissolved oxygen measurements were not taken for duplicate and quality control samples.
- "CL" suffix denotes a quality control duplicate sample was sent to the control laboratory.

pH data included for Second Quarter 2003 through Second Quarter 2004. Data range chosen to represent monitoring periods where data exists for all Building 1349 Study Area wells based on the initiation of monitoring.

Well Name	Sample Date	TPH as Gasoline (Carbon Range C <sub>7</sub> -C <sub>12</sub> )	TPH as Diesel (Carbon Range C <sub>12</sub> -C <sub>24</sub> )	TPH as Fuel Oil (Carbon Range C <sub>24</sub> -C <sub>36</sub> .		
	Analytical	SW8015B/	SW8015B/	SW8015B/		
	Method <sup>1</sup>	SW8015M	SW8015M	SW8015M		
		(µg/L)	(µg/L)	(µg/L)		
Cleanup 1	Levels <sup>2</sup>	770	880	1,200		
1349MW01	03/15/04	< 50	< 50	< 300		
1347111 01	12/02/03	< 50	< 50	< 300		
	08/21/03	< 50	< 50	< 300		
	06/10/03	< 50	< 50	< 300		
	03/12/03	NA	< 50	< 300		
	12/09/02	< 50	< 50	< 300		
DUP1209021A	12/09/02	< 50	< 50	< 300		
1349MW01CL	12/09/02	< 50	< 50	< 250		
1347WW01CL	08/28/02	< 50	< 50	< 300		
	05/30/02	< 50	< 50	< 300		
	03/06/02	< 50	< 50	< 300		
	11/28/01	< 50	< 50	< 300		
	08/30/01	< 50	< 50 <sup>3</sup>	< 300 <sup>3</sup>		
DUP0830013A	08/30/01	< 50	57 <sup>3</sup> Y,NJ	< 300 <sup>3</sup>		
1349MW01CL	08/30/01	< 50	< 50	< 300		
	05/10/01	< 50	< 50	< 300		
	05/19/99	NA	< 50	< 300		
	02/19/99	NA	< 50	< 300		
	11/18/98	NA	< 50	< 300		
	08/18/98	NA	< 50 (U15)	< 300		
	04/16/98	NA	< 50	< 300		
	01/22/98	NA	< 50	< 300		
	10/30/97	NA	< 50	< 300		
	07/31/97	NA	< 50	< 300		
	05/01/97	NA	< 50	< 300		
	02/10/97	NA	< 50	< 300		
	11/25/96	NA	< 50	< 300		
	09/12/96	NA	< 50	< 300		
	08/08/95	NA	< 50	NA		
1349MW02	08/12/04	< 50	< 50	< 300		
	05/26/04	< 50	< 50	< 300		
	03/15/04	< 50	< 50	< 300		
	12/02/03	< 50	< 50	< 300		
	08/13/03	< 50	290 HY	< 300		
	06/05/03	< 50	< 50	< 300		
DUP0605032A	06/05/03	< 50	< 50	< 300		
	03/12/03	NA To	< 50	< 300		
DYYD10010001	12/04/02	< 50	< 50	< 300		
DUP1204023A	12/04/02	< 50	< 50	< 300		
	08/28/02	< 50	< 50	< 300		
	05/30/02	< 50	< 50	< 300		
D11D020 <022 :	03/06/02	< 50	< 50	< 300		
DUP0306022A	03/06/02	< 50	< 50	< 300		
DIID11200111	11/28/01	< 50	< 50	< 300		
DUP1128011A	11/28/01	< 50	< 50	< 300		
	08/30/01	< 50	57 <sup>3</sup> Y,NJ	< 300 <sup>3</sup>		
DUP0830012A	08/30/01	< 50	67 <sup>3</sup> Y,NJ	< 300 <sup>3</sup>		
1349MW02CL	08/30/01	< 50	< 50	< 300		

Well Name	Sample Date	TPH as Gasoline	TPH as Diesel	TPH as Fuel Oil
	A 1 1 1	(Carbon Range C <sub>7</sub> -C <sub>12</sub> )	(Carbon Range C <sub>12</sub> -C <sub>24</sub> )	(Carbon Range C <sub>24</sub> -C <sub>36</sub> )
	Analytical	SW8015B/	SW8015B/	SW8015B/
	Method <sup>1</sup>	SW8015M	SW8015M	SW8015M
		(μg/L)	(μg/L)	(µg/L)
Cleanup 1	Levels <sup>2</sup>	770	880	1,200
	05/10/01	< 50	< 50	< 300
1349MW02	05/19/99	NA	< 50	< 300
	02/19/99	NA	< 50	< 300
	11/18/98	NA	< 50	< 300
	08/18/98	NA	< 50 (U15)	< 300
	04/16/98	NA	< 50	< 300
	01/22/98	NA	< 50	< 300
	10/30/97	NA	< 50	< 300
	07/31/97	NA	58 (R32)	< 300
	05/01/97	NA	< 50	< 300
	02/10/97	NA	< 50	< 300
	11/25/96	NA	< 50	< 300
	09/12/96	NA	< 50	< 300
	08/08/95	NA	< 50	NA
1349MW03	08/28/02	< 50	< 50	< 300
DUP0828022A	08/28/02	< 50	< 50	< 300
1349MW03CL	08/28/02	< 50	< 50 UJ	< 300 UJ
	05/30/02	< 50	< 50	< 300
DUP0530021A	05/30/02	< 50	< 50	< 300
1349MW03CL	05/30/02	< 50	< 50	< 300
	03/06/02	< 50	< 50	< 300
DUP0306022B	03/06/02	< 50	< 50	< 300
1349MW03CL	03/06/02	< 50	53 ndp	< 300
	11/28/01	< 50	< 50	390 H
DUP1128011B	11/28/01	< 50	< 50	< 300
1349MW03CL	11/28/01	< 50	< 50	< 500
	08/30/01	< 50	< 50 <sup>3</sup>	< 300 <sup>3</sup>
	05/10/01	< 50	< 50	< 300
	05/19/99	NA	< 50	< 300
	02/19/99	NA	< 50	< 300
	11/18/98	NA	< 50	< 300
	08/18/98	NA	< 50 (U15)	< 300
	04/16/98	NA	< 50	< 300
	01/22/98	NA	< 50	< 300
	10/30/97	NA	< 50	< 300
	07/31/97	NA	< 50	< 300
	05/01/97	NA	< 50	< 300
	02/10/97	NA	< 50	< 300
	11/25/96	NA	< 50	< 300
	09/12/96	NA	< 50	< 300
	08/08/95	NA	< 50	NA
1349MW03R	05/26/04	< 50	< 50	< 300
	03/09/04	< 50	81 HY	770 Z
	12/02/03	< 50	< 50	< 300
	08/13/03	< 50	< 50	< 300
	06/09/03	< 50	< 50	< 300
1349MW100	05/27/04	920 HY	3,600	< 300
	03/16/04	930 H	31,000	< 600
	12/02/03	1,000 HY,J+	1,100 LY	< 300

***	g 15.	TPH as Gasoline	TPH as Diesel	TPH as Fuel Oil
Well Name	Sample Date	(Carbon Range C <sub>7</sub> -C <sub>12</sub> )	(Carbon Range C <sub>12</sub> -C <sub>24</sub> )	(Carbon Range C <sub>24</sub> -C <sub>36</sub> )
	Analytical	SW8015B/	SW8015B/	SW8015B/
	Method <sup>1</sup>	SW8015M	SW8015M	SW8015M
		(μg/L)	(μg/L)	(µg/L)
Cleanup	Levels <sup>2</sup>	770	880	1,200
	08/12/03	700 YH	9,000	< 300
1349MW100	06/09/03	1,200 YH	5,100	< 300
	03/12/03	610 YH	1,800	< 300
	12/10/02	230 Y	1,500	< 300
1349MW101	03/09/04	< 50	< 50	< 300
	12/02/03	< 50	< 50	< 300
	08/19/03	< 50	< 50	< 300
	06/09/03	< 50	< 50	< 300
1349MW102	05/27/04	< 50	51 Y	< 300
DUP0527041A	05/27/04	< 50	< 50	< 300
1349MW102CL	05/27/04	< 50	54	< 240
	03/10/04	< 50	< 50	< 300
DUP0310041A	03/10/04	< 50	< 50	< 300
1349MW102CL	03/10/04	< 50	NA	NA
	12/10/03	< 50	< 50	< 300
DUP1210031A	12/10/03	< 50	< 50	< 300
	08/12/03	< 50	< 50	< 300
	06/09/03	< 50	< 50	< 300
DUP0609032A	06/09/03	< 50	< 50	< 300
1349MW102CL	06/09/03	< 50	< 50	< 250
1349MW103	03/15/04	< 50	< 50	< 300
	12/03/03	< 50	< 50	< 300
DUP1203032A	12/03/03	< 50	< 50	< 300
	08/12/03	< 50	< 50	< 300
	06/05/03	< 50	< 50	< 300
1349MW104	03/15/04	< 50	< 50	< 300
	12/02/03	< 50	< 50	< 300
	08/12/03	< 50	< 50	< 300
	06/06/03	< 50	< 50	< 300
1349MW105	03/15/04	< 50	< 50	< 300
	12/02/03	< 50	< 50	< 300
	08/12/03	< 50	< 50	< 300
	06/09/03	< 50	< 50	< 300

#### Notes

- 1 The identified analytical method(s) are for analyses performed beginning in the Second Quarter 2001. The analytical methods used during previous quarters are identified in the respective quarterly reports.
- 2- Drinking Water Cleanup Level from Table 7-6 Cleanup Levels Document (EKI, October 2002).
- 3 TPH analysis was not run using the silica gel cleanup method 3630A, although it was marked on the chain of custody.  $\mu$ g/L micrograms per liter

NA - Not analyzed

TPH - Total petroleum hydrocarbons

- Y Sample exhibits fuel pattern that does not resemble the standard.
- "CL" suffix denotes a quality control duplicate sample was sent to control laboratory.

Well Name	Sample Date	2- Butanone	Acetone	Benzene	Bromo- form	Carbon Disulfide	Dibromo- chloro- methane	Ethyl- benzene	MTBE	Toluene	Total Xylenes	All Other VOCs
	Analytical	SW8260/	SW8260/	SW8260/	SW8260/	SW8260/	SW8260/	SW8260/	SW8260/	SW8260/	SW8260/	SW8260/
		SW8260B/	SW8260B/	SW8260B/	SW8260B/	SW8260B/	SW8260B/	SW8260B/	SW8260B/	SW8260B/	SW8260B/	SW8260B/
	Method <sup>1</sup>	SW8260M	SW8260M	SW8260M	SW8260M	SW8260M	SW8260M	SW8260M	SW8260M	SW8260M	SW8260M	SW8260M
		(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)
Cleanup I	Levels 2	4200	700	1	100		100	700	13	150	1,750	
1349MW01	03/15/04	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	12/02/03	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	08/21/03	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	06/10/03	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	03/12/03	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	12/09/02	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5 UJ	< 0.5	< 0.5	ND
DUP1209021A	12/09/02	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5 UJ	< 0.5	< 0.5	ND
1349MW01CL	12/09/02	< 5	< 10	< 0.5	< 0.5	< 5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	08/28/02	< 10	< 10 UJ	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	05/30/02	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	03/06/02	< 10	< 10 UJ	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	11/28/01	< 10	< 10 UJ	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	08/30/01	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
DUP0830013A	08/30/01	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
1349MW01CL	08/30/01	< 50	< 50	< 0.5	< 1	< 0.5	< 1	< 0.5	< 5	< 0.5	< 0.5	ND
	05/10/01	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5 UJ	< 0.5	< 0.5 UJ	< 0.5 UJ	ND
	02/19/99	NA	NA	< 0.5	NA	NA	NA	< 0.5	NA	< 0.5	< 0.5	NA
	11/18/98	NA	NA	< 0.5	NA	NA	NA	< 0.5	NA	< 0.5	< 0.5	NA
	08/18/98	NA	NA	< 0.5 U18	NA	NA	NA	< 0.5 U18	NA	< 0.5 U18	< 0.5 U18	NA
	04/16/98	NA	NA	< 0.5	NA	NA	NA	< 0.5	NA	< 0.5	< 0.5	NA
	01/22/98	NA	NA	< 0.5	NA	NA	NA	< 0.5	NA	< 0.5	< 0.5	NA
	10/30/97	NA	NA	< 0.5	NA	NA	NA	< 0.5	NA	< 0.5	< 0.5	NA
	07/31/97	NA	NA	< 0.5	NA	NA	NA	< 0.5	NA	< 0.5	< 0.5	NA
	05/01/97	NA	NA	< 0.5	NA	NA	NA	< 0.5	NA	< 0.5	< 0.5	NA
	02/10/97	NA	NA	< 0.5	NA	NA	NA	< 0.5	NA	< 0.5	< 0.5	NA
	11/25/96	NA	NA	< 0.5	NA	NA	NA	< 0.5	NA	< 0.5	< 0.5	NA
	09/12/96	NA	NA	< 0.5	NA	NA	NA	< 0.5	NA	0.54	< 0.5	NA
	08/08/95	NA	NA	< 0.5	NA	NA	NA	< 0.5	NA	< 0.5	< 0.5	NA
1349MW02	03/15/04	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	12/02/03	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	08/13/03	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND

Well Name	Sample Date	2- Butanone	Acetone	Benzene	Bromo- form	Carbon Disulfide	Dibromo- chloro- methane	Ethyl- benzene	МТВЕ	Toluene	Total Xylenes	All Other VOCs
	Analytical	SW8260/	SW8260/	SW8260/	SW8260/	SW8260/	SW8260/	SW8260/	SW8260/	SW8260/	SW8260/	SW8260/
		SW8260B/	SW8260B/	SW8260B/	SW8260B/	SW8260B/	SW8260B/	SW8260B/	SW8260B/	SW8260B/	SW8260B/	SW8260B/
	Method <sup>1</sup>	SW8260M	SW8260M	SW8260M	SW8260M	SW8260M	SW8260M	SW8260M	SW8260M	SW8260M	SW8260M	SW8260M
		(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)
Cleanup L	evels <sup>2</sup>	4200	700	1	100		100	700	13	150	1,750	
1349MW02	06/05/03	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
DUP0605032A	06/05/03	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	03/12/03	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	12/04/02	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
DUP1204023A	12/04/02	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	08/28/02	< 10	< 10 UJ	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	05/30/02	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	03/06/02	< 10	< 10 UJ	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
DUP0306022A	03/06/02	< 10	< 10 UJ	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	11/28/01	< 10	< 10 UJ	0.8	< 1	< 0.5	< 0.5	< 0.5	< 0.5	1.5	< 0.5	ND
DUP1128011A	11/28/01	< 10	< 10	1.1	< 1	< 0.5	< 0.5	< 0.5	< 0.5	2.3	0.7	ND
	08/30/01	< 10	< 10	< 0.5	< 1	1.0	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
DUP0830012A	08/30/01	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
1349MW02CL	08/30/01	< 50	< 50	< 0.5	< 1	< 0.5	< 1	< 0.5	< 5	< 0.5	< 0.5	ND
	05/10/01	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	02/19/99	NA	NA	< 0.5	NA	NA	NA	< 0.5	NA	< 0.5	< 0.5	NA
	11/18/98	NA	NA	< 0.5	NA	NA	NA	< 0.5	NA	< 0.5	< 0.5	NA
	08/18/98	NA	NA	< 0.5 U18	NA	NA	NA	< 0.5 U18	NA	< 0.5 U18	< 0.5 U18	NA
	04/16/98	NA	NA	< 0.5	NA	NA	NA	< 0.5	NA	< 0.5	< 0.5	NA
	01/22/98	NA	NA	< 0.5	NA	NA	NA	< 0.5	NA	< 0.5	< 0.5	NA
	10/30/97	NA	NA	< 0.5	NA	NA	NA	< 0.5	NA	< 0.5	< 0.5	NA
	07/31/97	NA	NA	< 0.5	NA	NA	NA	< 0.5	NA	< 0.5	< 0.5	NA
	05/01/97	NA	NA	< 0.5	NA	NA	NA	< 0.5	NA	< 0.5	< 0.5	NA
	02/10/97	NA	NA	< 0.5	NA	NA	NA	< 0.5	NA	< 0.5	< 0.5	NA
	11/25/96	NA	NA	< 0.5	NA	NA	NA	< 0.5	NA	< 0.5	< 0.5	NA
	09/12/96	NA	NA	< 0.5	NA	NA	NA	< 0.5	NA	< 0.5	< 0.5	NA
	08/08/95	NA	NA	< 0.5	NA	NA	NA	< 0.5	NA	< 0.5	< 0.5	NA
1349MW03	12/09/02	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
	08/28/02	< 10	< 10 UJ	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
DUP0828022A	08/28/02	< 10	< 10 UJ	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND

Well Name	Sample Date	2- Butanone	Acetone	Benzene	Bromo- form	Carbon Disulfide	Dibromo- chloro- methane	Ethyl- benzene	МТВЕ	Toluene	Total Xylenes	All Other VOCs
	Analytical	SW8260/	SW8260/	SW8260/	SW8260/	SW8260/	SW8260/	SW8260/	SW8260/	SW8260/	SW8260/	SW8260/
	•	SW8260B/	SW8260B/	SW8260B/	SW8260B/	SW8260B/	SW8260B/	SW8260B/	SW8260B/	SW8260B/	SW8260B/	SW8260B/
	Method <sup>1</sup>	SW8260M	SW8260M	SW8260M	SW8260M	SW8260M	SW8260M	SW8260M	SW8260M	SW8260M	SW8260M	SW8260M
		(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)
Cleanup L	evels <sup>2</sup>	4200	700	1	100		100	700	13	150	1,750	
1349MW03CL	08/28/02	< 50 R	< 50	< 0.5	< 0.5	< 5	< 0.5	< 0.5	< 5	< 0.5	< 1	ND
1349MW03	05/30/02	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
DUP0530021A	05/30/02	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
1349MW03CL	05/30/02	7.9 J	< 50	< 0.5	< 0.5	< 5	< 0.5	< 0.5	< 5	< 0.5	< 1	ND
	03/06/02	< 10	< 10 UJ	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
DUP0306022B	03/06/02	< 10	< 10 UJ	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
1349MW03CL	03/06/02	< 50	< 50	< 0.5	< 0.5	< 5	< 0.5	< 0.5	< 5	< 0.5	< 1	ND
	11/28/01	< 10	< 10 UJ	0.8	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
DUP1128011B	11/28/01	< 10	< 10 UJ	0.8	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
1349MW03CL	11/28/01	< 50	< 50	0.7	< 0.5	< 5	< 0.5	< 0.5	< 5	< 0.5	0.9	ND
	08/30/01	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	05/10/01	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	07/21/00	< 10	< 20	< 5	< 5	< 5	< 5	< 5	< 5	< 5	< 5	ND
	02/19/99	NA	NA	< 0.5	NA	NA	NA	< 0.5	NA	< 0.5	< 0.5	NA
	11/18/98	NA	NA	< 0.5	NA	NA	NA	< 0.5	NA	< 0.5	< 0.5	NA
	08/18/98	NA	NA	< 0.5 U18	NA	NA	NA	< 0.5 U18	NA	< 0.5 U18	< 0.5 U18	NA
	04/16/98	NA	NA	< 0.5	NA	NA	NA	< 0.5	NA	< 0.5	< 0.5	NA
	01/22/98	NA	NA	< 0.5	NA	NA	NA	< 0.5	NA	< 0.5	< 0.5	NA
	10/30/97	NA	NA	< 0.5	NA	NA	NA	< 0.5	NA	< 0.5	< 0.5	NA
	07/31/97	NA	NA	< 0.5	NA	NA	NA	< 0.5	NA	< 0.5	< 0.5	NA
	05/01/97	NA	NA	< 0.5	NA	NA	NA	< 0.5	NA	< 0.5	< 0.5	NA
	02/10/97	NA	NA	< 0.5	NA	NA	NA	< 0.5	NA	< 0.5	< 0.5	NA
	11/25/96	NA	NA	< 0.5	NA	NA	NA	< 0.5	NA	< 0.5	< 0.5	NA
	09/12/96	NA	NA	< 0.5	NA	NA	NA	< 0.5	NA	< 0.5	< 0.5	NA
	08/08/95	NA	NA	< 0.5	NA	NA	NA	< 0.5	NA	< 0.5	< 0.5	NA
1349MW03R	03/09/04	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	12/02/03	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	08/13/03	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	06/09/03	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
1349MW100	03/16/04	< 10	< 10	24	< 1	< 0.5	< 0.5	2.5	< 0.5	< 0.5	5.5	ND
	12/02/03	< 10	< 10	7.8	< 1	< 0.5	< 0.5	2	0.5	0.5	3.8	ND

Well Name	Sample Date	2- Butanone	Acetone	Benzene	Bromo- form	Carbon Disulfide	Dibromo- chloro- methane	Ethyl- benzene	МТВЕ	Toluene	Total Xylenes	All Other VOCs
	Analytical	SW8260/	SW8260/	SW8260/	SW8260/	SW8260/	SW8260/	SW8260/	SW8260/	SW8260/	SW8260/	SW8260/
	,	SW8260B/	SW8260B/	SW8260B/	SW8260B/	SW8260B/	SW8260B/	SW8260B/	SW8260B/	SW8260B/	SW8260B/	SW8260B/
	Method	SW8260M	SW8260M	SW8260M	SW8260M	SW8260M	SW8260M	SW8260M	SW8260M	SW8260M	SW8260M	SW8260M
		(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)
Cleanup L	evels 2	4200	700	1	100		100	700	13	150	1,750	
1349MW100	08/12/03	< 10	< 10	9.1	< 1	< 0.5	< 0.5	1.1	< 0.5	0.5	3	ND
	06/09/03	< 10	< 10	27	< 1	1.3	< 0.5	7	< 0.5	0.7	12	ND
	03/12/03	< 10	< 10	25	< 1	< 0.5 UJ	< 0.5	5	< 0.5	0.6	9.8	ND
	12/10/02	< 10	< 10	2.6	< 1	< 0.5	< 0.5	1.3	< 0.5 UJ	0.8	3	ND
1349MW101	03/09/04	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	12/02/03	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	08/19/03	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	06/09/03	< 10	< 10	< 0.5	0.6 J	< 0.5	0.6	< 0.5	< 0.5	< 0.5	< 0.5	ND
1349MW102	03/10/04	< 10	< 10 UJ	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
DUP0310041A	03/10/04	< 10	< 10 UJ	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
1349MW102CL	03/10/04	< 5	< 10 R	< 0.5	< 0.5	< 5 UJ	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	12/10/03	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
DUP1210031A	12/10/03	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	08/12/03	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	06/09/03	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
DUP0609032A	06/09/03	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
1349MW102CL	06/09/03	< 5	< 10	< 0.5	< 0.5	< 5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
1349MW103	03/15/04	< 10	< 10 UJ	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	12/03/03	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
DUP1203032A	12/03/03	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	08/12/03	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	06/05/03	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
1349MW104	03/15/04	< 10	< 10 UJ	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	12/02/03	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	08/12/03	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	06/06/03	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
1349MW105	03/15/04	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	12/02/03	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	08/12/03	< 10	< 10	< 0.5	< 1	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND
	06/09/03	< 10	12	< 0.5	< 1	1.9	< 0.5	< 0.5	< 0.5	< 0.5	< 0.5	ND

#### Notes

- 1 The identified analytical method(s) are for analyses performed beginning in the Second Quarter 2001. The analytical methods used during previous quarters are identified in the respective quarterly reports.
- 2- Drinking Water Cleanup Level from Table 7-6 Cleanup Levels Document (EKI, October 2002).
- -- cleanup level not established

μg/L - micrograms per liter

ND - Not detected

NA - Not analyzed

NS - Not sampled

VOC - Volatile organic compound

MTBE - Methyl tert-butyl ether

"CL" suffix denotes a quality control duplicate sample was sent to the control laboratory.

# Appendix B-8 Results of OCP and PCB Analyses in Groundwater Building 1349 Presidio of San Francisco, California

Well Name	Sample Date	4,4'-DDD	4,4'-DDE	4,4'-DDT	Aldrin	alpha- Chlordane	beta-BHC	delta-BHC	Dieldrin	Endosulfan II	Endrin	gamma- BHC	gamma- Chlordane	Heptachlor	Heptachlor Epoxide	Methoxy- chlor	All Other OCPs and PCBs
	Analytical	SW8081/	SW8081/	SW8081/	SW8081/	SW8081/	SW8081/	SW8081/	SW8081/	SW8081/	SW8081/	SW8081/	SW8081/	SW8081/	SW8081/	SW8081/	SW8081/
	Method <sup>1</sup>	SW8081A/	SW8081A/	SW8081A/	SW8081A/	SW8081A/	SW8081A/	SW8081A/	SW8081A/	SW8081A/	SW8081A/	SW8081A/	SW8081A/	SW8081A/	SW8081A/	SW8081A/	SW8081A/
	Method	SW8082	SW8082	SW8082	SW8082	SW8082	SW8082	SW8082	SW8082	SW8082	SW8082	SW8082	SW8082	SW8082	SW8082	SW8082	SW8082
Cleanup Le	vels (2)	0.15 a	0.1 a	0.1 a	0.05 b	0.1	0.3		0.5	42 a	2	0.2	0.1 b	0.025	0.025	40	
		(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)
1349MW01	03/15/04	< 0.1	< 0.1	< 0.1	< 0.05	< 0.05	< 0.05	< 0.05	< 0.1	< 0.1	< 0.1	< 0.05	< 0.05	< 0.05	< 0.05	< 0.5	ND
	12/02/03	< 0.1 UJ	< 0.1 UJ	< 0.1 UJ	< 0.05	< 0.05 UJ	< 0.05	< 0.05	< 0.1 UJ	< 0.1 UJ	< 0.1 UJ	< 0.05	< 0.05 UJ	< 0.05	< 0.05	< 0.5 UJ	ND
	08/21/03	< 0.09	< 0.09	< 0.09	< 0.05	< 0.05	< 0.05	< 0.05	< 0.09	< 0.09	< 0.09	< 0.05	< 0.05	< 0.05	< 0.05	< 0.5	ND
	06/10/03	< 0.1	< 0.1	< 0.1	< 0.05	< 0.05	< 0.05	< 0.05	< 0.1	< 0.1	< 0.1	< 0.05	< 0.05	< 0.05	< 0.05	< 0.5	ND
	03/12/03	< 0.1	< 0.1	< 0.1	< 0.05 UJ	< 0.05	< 0.05 UJ	< 0.05 UJ	< 0.1	< 0.1	< 0.1	< 0.05 UJ	< 0.05	< 0.05 UJ	< 0.05 UJ	< 0.5	ND
	12/09/02	< 0.097	< 0.097	< 0.097	< 0.049	< 0.049	< 0.049	< 0.049	< 0.097	< 0.097	< 0.097	< 0.049	< 0.049	< 0.049	< 0.049	< 0.49	ND
DUP1209021A	12/09/02	< 0.097	< 0.097	< 0.097	< 0.049	< 0.049	< 0.049	< 0.049	< 0.097	< 0.097	< 0.097	< 0.049	< 0.049	< 0.049	< 0.049	< 0.49	ND
1349MW01CL	12/09/02	< 0.1	< 0.1	< 0.1	< 0.05 UJ	NA	< 0.05 UJ	< 0.05 UJ	< 0.1	< 0.1	< 0.1	< 0.05 UJ	< 0.5	< 0.05 UJ	< 0.05 UJ	< 0.5	ND
	08/28/02	< 0.097	< 0.097	< 0.097	< 0.049 UJ	< 0.049	< 0.049 UJ	< 0.049 UJ	< 0.097	< 0.097	< 0.097	< 0.049 UJ	< 0.049	< 0.049 UJ	< 0.049 UJ	< 0.49	ND
	05/30/02	< 0.098	< 0.098	< 0.098	< 0.049 UJ	< 0.049	< 0.049 UJ	< 0.049 UJ	< 0.098	< 0.098	< 0.098	< 0.049 UJ	< 0.049	< 0.049 UJ	< 0.049 UJ	< 0.49	ND
	03/06/02	< 0.098	< 0.098	< 0.098 UJ	< 0.049 UJ	< 0.049	< 0.049 UJ	< 0.049 UJ	< 0.098	< 0.098	< 0.098	< 0.049 UJ	< 0.049	< 0.049 UJ	< 0.049 UJ	< 0.49	ND
	11/28/01	< 0.096	< 0.096	< 0.096	< 0.048	< 0.048	< 0.048	< 0.048	< 0.096	< 0.096	< 0.096	< 0.048	< 0.048	< 0.048	< 0.048	< 0.48	ND
	08/30/01	< 0.097 UJ	< 0.097 UJ	< 0.097 UJ	< 0.049	< 0.049 UJ	< 0.049	< 0.049	< 0.097 UJ	< 0.097 UJ	< 0.097 UJ	< 0.049	< 0.049 UJ	< 0.049	< 0.049	< 0.49 UJ	ND
DUP0830013A	08/30/01	< 0.098	< 0.098	< 0.098	< 0.049	< 0.049	< 0.049	< 0.049	< 0.098	< 0.098	< 0.098	< 0.049	< 0.049	< 0.049	< 0.049	< 0.49	ND
1349MW01CL	08/30/01	< 0.06	< 0.06	< 0.06	< 0.06	< 0.06	< 0.06	< 0.06	< 0.06	< 0.06	< 0.06	< 0.06	< 0.06	< 0.06	< 0.06	< 0.06	ND
	05/10/01	< 0.094 UJ	< 0.094 UJ	< 0.094 UJ	< 0.047	< 0.047 UJ	< 0.047	< 0.047	< 0.094 UJ	< 0.094 UJ	< 0.094 UJ	< 0.047	< 0.047 UJ	< 0.047	< 0.047	< 0.47 UJ	ND
1349MW02	05/26/04	< 0.09	< 0.09	< 0.09	< 0.05	< 0.05	< 0.05	< 0.05	< 0.09	< 0.09	< 0.09	< 0.05	< 0.05	< 0.05	< 0.05	< 0.5	ND
	03/15/04	< 0.1	< 0.1	< 0.1	< 0.05	< 0.05	< 0.05	< 0.05	< 0.1	< 0.1	< 0.1	< 0.05	< 0.05	< 0.05	< 0.05	< 0.5	ND
	12/02/03	< 0.1	< 0.1	< 0.1	< 0.05	< 0.05	< 0.05	< 0.05	< 0.1	< 0.1	< 0.1	< 0.05	< 0.05	< 0.05	< 0.05	< 0.5	ND
	08/13/03	< 0.1	< 0.1	< 0.1	< 0.05	< 0.05	< 0.05	< 0.05	< 0.1	< 0.1	< 0.1	< 0.05	< 0.05	< 0.05	< 0.05	< 0.5	ND
	06/05/03	< 0.09	< 0.09	< 0.09 UJ	< 0.05	< 0.05	< 0.05	< 0.05	< 0.09	< 0.09	< 0.09	< 0.05	< 0.05	< 0.05	< 0.05	< 0.5	ND
DUP0605032A	06/05/03	< 0.09	< 0.09	< 0.09 UJ	< 0.05	< 0.05	< 0.05	< 0.05	< 0.09	< 0.09	< 0.09	< 0.05	< 0.05	< 0.05	< 0.05	< 0.5	ND
	03/12/03	< 0.1	< 0.1	< 0.1	< 0.05	< 0.05	< 0.05	< 0.05	< 0.1	< 0.1	< 0.1	< 0.05	< 0.05	< 0.05	< 0.05	< 0.5	ND
	12/04/02	< 0.097	< 0.097	< 0.097	< 0.049	< 0.049	< 0.049	< 0.049	< 0.097	< 0.097	< 0.097	< 0.049	< 0.049	< 0.049	< 0.049	< 0.49	ND
DUP1204023A	12/04/02	< 0.094 UJ	< 0.094 UJ	< 0.094 UJ	< 0.047	< 0.047 UJ	< 0.047	< 0.047	< 0.094 UJ	< 0.094 UJ	< 0.094 UJ	< 0.047	< 0.047 UJ	< 0.047	< 0.047	< 0.47 UJ	ND
	08/28/02	< 0.095	< 0.095	< 0.095	< 0.048	< 0.048	< 0.048	< 0.048	< 0.095	< 0.095	< 0.095	< 0.048	< 0.048	< 0.048	< 0.048	< 0.48	ND
	05/30/02	< 0.099	< 0.099	< 0.099	< 0.05 UJ	< 0.05	< 0.05 UJ	< 0.05 UJ	< 0.099	< 0.099	< 0.099	< 0.05 UJ	< 0.05	< 0.05 UJ	< 0.05 UJ	< 0.5	ND
	03/06/02	< 0.095	< 0.095	< 0.095 UJ	< 0.048	< 0.048	< 0.048	< 0.048	< 0.095	< 0.095	< 0.095	< 0.048 UJ	< 0.048	< 0.048	< 0.048	< 0.48	ND
DUP0306022A	03/06/02	< 0.095	< 0.095	< 0.095 UJ	< 0.048 UJ	< 0.048	< 0.048 UJ	< 0.048 UJ	< 0.095	< 0.095	< 0.095	< 0.048 UJ	< 0.048	< 0.048 UJ	< 0.048 UJ	< 0.48	ND
	11/28/01	< 0.096	< 0.096	< 0.096	< 0.048	< 0.048	< 0.048	< 0.048	< 0.096	< 0.096	< 0.096	< 0.048	< 0.048	< 0.048	< 0.048	< 0.48	ND
DUP1128011A	11/28/01	< 0.096 UJ	< 0.096 UJ	< 0.096 UJ	< 0.048	< 0.048 UJ	< 0.048	< 0.048	< 0.096 UJ	< 0.096 UJ	< 0.096 UJ	< 0.048	< 0.048 UJ	< 0.048	< 0.048	< 0.48 UJ	ND
	08/30/01	< 0.098 UJ	< 0.098 UJ	< 0.098 UJ	< 0.049	< 0.049 UJ	< 0.049	< 0.049	< 0.098 UJ	< 0.098 UJ	< 0.098 UJ	< 0.049	< 0.049 UJ	< 0.049	< 0.049	< 0.49 UJ	ND
DUP0830012A	08/30/01	< 0.097	< 0.097	< 0.097	< 0.049	< 0.049	< 0.049	< 0.049	< 0.097	< 0.097	< 0.097	< 0.049	< 0.049	< 0.049	< 0.049	< 0.49	ND
1349MW02CL	08/30/01	< 0.06	< 0.06	< 0.06	< 0.06	< 0.06	< 0.06	< 0.06	< 0.06	< 0.06	< 0.06	< 0.06	< 0.06	< 0.06	< 0.06	< 0.06	ND
	05/10/01	< 0.094	< 0.094	< 0.094	< 0.047	< 0.047	< 0.047	< 0.047	< 0.094	< 0.094	< 0.094	< 0.047	< 0.047	< 0.047	< 0.047	< 0.47	ND

# Appendix B-8 Results of OCP and PCB Analyses in Groundwater Building 1349 Presidio of San Francisco, California

Well Name	Sample Date	4,4'-DDD	4,4'-DDE	4,4'-DDT	Aldrin	alpha- Chlordane	beta-BHC	delta-BHC	Dieldrin	Endosulfan II	Endrin	gamma- BHC	gamma- Chlordane	Heptachlor	Heptachlor Epoxide	Methoxy- chlor	All Other OCPs and PCBs
	Analytical	SW8081/	SW8081/	SW8081/	SW8081/	SW8081/	SW8081/	SW8081/	SW8081/	SW8081/	SW8081/	SW8081/	SW8081/	SW8081/	SW8081/	SW8081/	SW8081/
	_	SW8081A/	SW8081A/	SW8081A/	SW8081A/	SW8081A/	SW8081A/	SW8081A/	SW8081A/	SW8081A/	SW8081A/	SW8081A/	SW8081A/	SW8081A/	SW8081A/	SW8081A/	SW8081A/
	Method <sup>1</sup>	SW8082	SW8082	SW8082	SW8082	SW8082	SW8082	SW8082	SW8082	SW8082	SW8082	SW8082	SW8082	SW8082	SW8082	SW8082	SW8082
Cleanup Lev	vels (2)	0.15 a	0.1 a	0.1 a	0.05 b	0.1	0.3		0.5	42 a	2	0.2	0.1 b	0.025	0.025	40	
		(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)
1349MW03	12/09/02	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
	08/28/02	< 0.094	< 0.094	< 0.094	< 0.047 UJ	< 0.047	< 0.047 UJ	< 0.047 UJ	< 0.094	< 0.094	< 0.094	< 0.047 UJ	< 0.047	< 0.047 UJ	< 0.047 UJ	< 0.47	ND
DUP0828022A	08/28/02	< 0.094	< 0.094	< 0.094	< 0.047	< 0.047	< 0.047	< 0.047	< 0.094	< 0.094	< 0.094	< 0.047	< 0.047	< 0.047	< 0.047	< 0.47	ND
1349MW03CL	08/28/02	< 0.06	< 0.06	< 0.06	< 0.05	< 0.06	< 0.05	< 0.05	< 0.06	< 0.06	< 0.06	< 0.05	< 0.06	< 0.05	< 0.05	< 0.06	ND
	05/30/02	< 0.094	< 0.094	< 0.094	< 0.047 UJ	< 0.047	< 0.047 UJ	< 0.047 UJ	< 0.094	< 0.094	< 0.094	< 0.047 UJ	< 0.047	< 0.047 UJ	< 0.047 UJ	< 0.47	ND
DUP0530021A	05/30/02	< 0.094	< 0.094	< 0.094	< 0.047	< 0.047	< 0.047	< 0.047	< 0.094	< 0.094	< 0.094	< 0.047	< 0.047	< 0.047	< 0.047	< 0.47	ND
1349MW03CL	05/30/02	< 0.1	< 0.1	< 0.1	< 0.05	< 0.5	< 0.05	< 0.05	< 0.1	< 0.1	< 0.1	< 0.05	< 0.5	< 0.05	< 0.05	< 0.5	ND
	03/06/02	< 0.095	< 0.095	< 0.095 UJ	< 0.048	< 0.048	< 0.048	< 0.048	< 0.095	< 0.095	< 0.095	< 0.048 UJ	< 0.048	< 0.048	< 0.048	< 0.48	ND
DUP0306022B	03/06/02	< 0.095	< 0.095	< 0.095 UJ	< 0.048	< 0.048	< 0.048	< 0.048	< 0.095	< 0.095	< 0.095	< 0.048 UJ	< 0.048	< 0.048	< 0.048	< 0.48	ND
1349MW03CL	03/06/02	< 0.06	< 0.06	< 0.06	< 0.05	< 0.06	< 0.05	< 0.05	< 0.06	< 0.06	< 0.06	< 0.05	< 0.06	< 0.05	< 0.05	< 0.06	ND
	11/28/01	< 0.096	< 0.096	< 0.096	< 0.048	< 0.048	< 0.048	< 0.048	< 0.096	< 0.096	< 0.096	< 0.048	< 0.048	< 0.048	< 0.048	< 0.48	ND
DUP1128011B	11/28/01	< 0.094 UJ	< 0.094 UJ	< 0.094 UJ	< 0.047	< 0.047 UJ	< 0.047	< 0.047	< 0.094 UJ	< 0.094 UJ	< 0.094 UJ	< 0.047	< 0.047 UJ	< 0.047	< 0.047	< 0.47 UJ	ND
1349MW03CL	11/28/01	< 0.06	< 0.06	< 0.06	< 0.06	< 0.06	< 0.06	< 0.06	< 0.06	< 0.06	< 0.06	< 0.06	< 0.06	< 0.06	< 0.06	< 0.06	ND
	08/30/01	< 0.097	< 0.097	< 0.097	< 0.049	< 0.049	< 0.049	< 0.049	< 0.097	< 0.097	< 0.097	< 0.049	< 0.049	< 0.049	< 0.049	< 0.49	ND
	05/10/01	< 0.097 UJ	< 0.097 UJ	< 0.097 UJ	< 0.049	< 0.049 UJ	< 0.049	< 0.049	< 0.097 UJ	< 0.097 UJ	< 0.097 UJ	< 0.049	< 0.049 UJ	< 0.049	< 0.049	< 0.49 UJ	ND
	07/21/00	< 0.1	< 0.1	< 0.1	< 0.1	NA	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	< 0.1	NA	< 0.1	< 0.1	< 0.1	ND
1349MW03R	05/26/04	< 0.1	< 0.1	< 0.1	< 0.05 UJ	< 0.05	< 0.05 UJ	< 0.05 UJ	< 0.1	< 0.1	< 0.1	< 0.05 UJ	< 0.05	< 0.05 UJ	< 0.05 UJ	< 0.5	ND
	03/09/04	< 0.1	< 0.1	< 0.1	< 0.05	< 0.05	0.08 C	< 0.05	< 0.1	< 0.1	< 0.1	< 0.05	< 0.05	< 0.05	< 0.05	< 0.5	ND
	12/02/03	< 0.1	< 0.1	< 0.1	< 0.05	< 0.05	< 0.05	< 0.05	< 0.1	< 0.1	< 0.1	< 0.05	< 0.05	< 0.05	< 0.05	< 0.5	ND
	08/13/03	< 0.09	< 0.09	< 0.09	< 0.05 UJ	< 0.05	< 0.05 UJ	< 0.05 UJ	< 0.09	< 0.09	< 0.09	< 0.05 UJ	< 0.05	< 0.05 UJ	< 0.05 UJ	< 0.5	ND
	06/09/03	< 0.1 UJ	< 0.1 UJ	< 0.1 UJ	< 0.05	< 0.05 UJ	< 0.05	< 0.05	< 0.1 UJ	< 0.1 UJ	< 0.1 UJ	< 0.05	< 0.05 UJ	< 0.05	< 0.05	< 0.5 UJ	ND
1349MW100	05/27/04	< 0.2 UJ	< 0.2 UJ	0.5 C, J-	< 0.09	0.2 C, J-	< 0.09	0.2 C	0.3 J-	0.7 C, J-	0.2 J-	< 0.2	0.1 J-	0.8 C	0.2 C	< 0.9 UJ	ND
	03/16/04	< 0.09 UJ	0.7 Cb,J-	0.7 C,J-	< 0.05 UJ	0.2 J-	< 0.05 UJ	0.08 b,J-	0.3 J-	0.6 J-	0.2 J-	< 0.05 UJ	0.3 C,J-	0.8 Cb,J-	0.2 C,J-	1.2 b,J-	ND
	12/02/03	0.5 C	0.7 C	0.5 Cb,J-	< 0.05	< 0.05	3.9 C	0.06 C	0.1	< 0.09	< 0.09	2.3 C	< 0.05	< 0.05	0.2 C	< 0.5	ND
	08/12/03	< 0.1 UJ	< 0.1 UJ	< 0.1 UJ	0.2 C	0.1 J-	< 0.2	< 0.05	< 0.1 UJ	< 0.1 UJ	< 0.1 UJ	4.6 C	0.07 J-	2.6 Cb,J-	0.1	< 0.5 UJ	ND
	06/09/03	0.3 C,J-	0.3 C,J-	< 0.09 UJ	0.07 C	< 0.05 UJ	< 0.05	0.2 C	< 0.09 UJ	< 0.09 UJ	< 0.09 UJ	4.5 C	0.4 C,J-	< 0.05	< 0.05	< 0.5 UJ	ND
	03/12/03	0.3 Cb,J+	< 0.1 UJ	0.2 C,J-	0.3 C,J+	0.2 C,J-	6.1 C,J+	0.1 C,J+	< 0.1 UJ	< 0.1 UJ	< 0.1 UJ	2.2 C,J+	0.2 C,J-	0.8 C,J+	0.3 C J+	< 0.5 UJ	ND
	12/10/02	< 0.097	< 0.097	< 0.097	0.11 C,J-	< 0.049	1.5 C,J-	< 0.049 UJ	< 0.097	< 0.097	< 0.097	0.43 C,J-	< 0.049	0.83 C,J-	< 0.049 UJ	< 0.49	ND
1349MW101	03/09/04	< 0.1	< 0.1	< 0.1	< 0.05	< 0.05	0.06 C	< 0.05	< 0.1	< 0.1	< 0.1	< 0.05	< 0.05	< 0.05	< 0.05	< 0.5	ND
	12/02/03	< 0.1	< 0.1	< 0.1	< 0.05	< 0.05	< 0.05	< 0.05	< 0.1	< 0.1	< 0.1	< 0.05	< 0.05	< 0.05	< 0.05	< 0.5	ND
	08/19/03	< 0.09	< 0.09	< 0.09	< 0.05	< 0.05	< 0.05	< 0.05	< 0.09	< 0.09	< 0.09	< 0.05	< 0.05	< 0.05	< 0.05	< 0.5	ND
	06/09/03	< 0.09 UJ	< 0.09 UJ	< 0.09 UJ	< 0.05	< 0.05 UJ	< 0.05	< 0.05	< 0.09 UJ	< 0.09 UJ	< 0.09 UJ	< 0.05	< 0.05 UJ	< 0.05	< 0.05	< 0.09 UJ	ND

### Appendix B-8 Results of OCP and PCB Analyses in Groundwater Building 1349 Presidio of San Francisco, California

Well Name	Sample Date	4,4'-DDD	4,4'-DDE	4,4'-DDT	Aldrin	alpha- Chlordane	beta-BHC	delta-BHC	Dieldrin	Endosulfan II	Endrin	gamma- BHC	gamma- Chlordane	Heptachlor	Heptachlor Epoxide	Methoxy- chlor	All Other OCPs and PCBs
	Analytical	SW8081/	SW8081/	SW8081/	SW8081/	SW8081/	SW8081/	SW8081/	SW8081/	SW8081/	SW8081/	SW8081/	SW8081/	SW8081/	SW8081/	SW8081/	SW8081/
	Method <sup>1</sup>	SW8081A/	SW8081A/	SW8081A/	SW8081A/	SW8081A/	SW8081A/	SW8081A/	SW8081A/	SW8081A/	SW8081A/	SW8081A/	SW8081A/	SW8081A/	SW8081A/	SW8081A/	SW8081A/
	Method	SW8082	SW8082	SW8082	SW8082	SW8082	SW8082	SW8082	SW8082	SW8082	SW8082	SW8082	SW8082	SW8082	SW8082	SW8082	SW8082
Cleanup Le	evels (2)	0.15 a	0.1 a	0.1 a	0.05 b	0.1	0.3		0.5	42 a	2	0.2	0.1 b	0.025	0.025	40	
		(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	$(\mu g/L)$	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)
1349MW102	05/27/04	< 0.1	< 0.1	< 0.1	< 0.05 UJ	< 0.05	< 0.05 UJ	< 0.05 UJ	< 0.1	< 0.1	< 0.1	< 0.05 UJ	< 0.05	< 0.05 UJ	< 0.05 UJ	< 0.5	ND
DUP0527041A	05/27/04	< 0.1	< 0.1	< 0.1	< 0.05 UJ	< 0.05	< 0.05 UJ	< 0.05 UJ	< 0.1	< 0.1	< 0.1	< 0.05 UJ	< 0.05	< 0.05 UJ	< 0.05 UJ	< 0.5	ND
1349MW102CL	05/27/04	< 0.098	< 0.098	< 0.098	< 0.049	NA	< 0.049	< 0.049	< 0.098	< 0.098	< 0.098	< 0.049	< 0.49	< 0.049	< 0.049	< 0.49	ND
	03/10/04	< 0.1	< 0.1	< 0.1	< 0.05 UJ	< 0.05	< 0.05 UJ	< 0.05 UJ	< 0.1	< 0.1	< 0.1	< 0.05 UJ	< 0.05	< 0.05 UJ	< 0.05 UJ	< 0.5	ND
DUP0310041A	03/10/04	< 0.1	< 0.1	< 0.1	< 0.05	< 0.05	< 0.05	< 0.05	< 0.1	< 0.1	< 0.1	< 0.05	< 0.05	< 0.05	< 0.05	< 0.5	ND
1349MW102CL	03/10/04	< 0.1 UJ	< 0.1 UJ	< 0.1 UJ	< 0.05 UJ	NA	< 0.05 UJ	< 0.05 UJ	< 0.1 UJ	< 0.1 UJ	< 0.1 UJ	< 0.05 UJ	< 0.5 UJ	< 0.05 UJ	< 0.05 UJ	< 0.5 UJ	ND
	12/10/03	< 0.1	< 0.1	< 0.1 b,UJ	< 0.05	< 0.05	< 0.05	< 0.05	< 0.1	< 0.1	< 0.1	0.07 C,J+	< 0.05	< 0.05 b,UJ	< 0.05	< 0.5 b,UJ	ND
DUP1210031A	12/10/03	< 0.09	< 0.09	< 0.09 b,UJ	< 0.05	< 0.05	< 0.05	< 0.05	< 0.09	< 0.09	< 0.09	0.07 J+	< 0.05	< 0.05 b,UJ	< 0.05	< 0.5 b,UJ	ND
	08/12/03	< 0.1	< 0.1	< 0.1	< 0.05	< 0.05	< 0.05	< 0.05	< 0.1	< 0.1	< 0.1	< 0.05	< 0.05	< 0.05 UJ	< 0.05	< 0.5	ND
	06/09/03	< 0.09 UJ	< 0.09 UJ	< 0.09 UJ	< 0.05	< 0.05 UJ	< 0.05	< 0.05	< 0.09 UJ	< 0.09 UJ	< 0.09 UJ	< 0.05	< 0.05 UJ	< 0.05	< 0.05	< 0.5 UJ	ND
DUP0609032A	06/09/03	< 0.09 UJ	< 0.09 UJ	< 0.09 UJ	< 0.05	< 0.05 UJ	< 0.05	< 0.05	< 0.09 UJ	< 0.09 UJ	< 0.09 UJ	< 0.05	< 0.05 UJ	< 0.05	< 0.05	< 0.5 UJ	ND
1349MW102CL	06/09/03	< 0.095 UJ	< 0.095 UJ	< 0.095 UJ	< 0.048 UJ	NA	< 0.048 UJ	< 0.048 UJ	< 0.095 UJ	< 0.095 UJ	< 0.095 UJ	< 0.048 UJ	< 0.48 UJ	< 0.048 UJ	< 0.048 UJ	< 0.48 UJ	ND
1349MW103	03/15/04	< 0.1	< 0.1	< 0.1	< 0.05	< 0.05	< 0.05	< 0.05	< 0.1	< 0.1	< 0.1	< 0.05	< 0.05	< 0.05	< 0.05	< 0.5	ND
	12/03/03	< 0.1	< 0.1	< 0.1	< 0.05 UJ	< 0.05	< 0.05 UJ	< 0.05 UJ	< 0.1	< 0.1	< 0.1	< 0.05 UJ	< 0.05	< 0.05 UJ	< 0.05 UJ	< 0.5	ND
DUP1203032A	12/03/03	< 0.1	< 0.1	< 0.1	< 0.05	< 0.05	< 0.05	< 0.05	< 0.1	< 0.1	< 0.1	< 0.05	< 0.05	< 0.05	< 0.05	< 0.5	ND
	08/12/03	< 0.1	< 0.1	< 0.1	< 0.05 UJ	< 0.05	< 0.05 UJ	< 0.05 UJ	< 0.1	< 0.1	< 0.1	< 0.05 UJ	< 0.05	< 0.05 UJ	< 0.05 UJ	< 0.5	ND
	06/05/03	< 0.09 UJ	< 0.09 UJ	< 0.09 UJ	< 0.05 UJ	< 0.05 UJ	< 0.05 UJ	< 0.05 UJ	< 0.09 UJ	< 0.09 UJ	< 0.09 UJ	< 0.05 UJ	< 0.05 UJ	< 0.05 UJ	< 0.05 UJ	< 0.5 UJ	ND
1349MW104	03/15/04	< 0.1 UJ	< 0.1 UJ	< 0.1 UJ	< 0.05	< 0.05 UJ	< 0.05	< 0.05	< 0.1 UJ	< 0.1 UJ	< 0.1 UJ	< 0.05	< 0.05 UJ	< 0.05	< 0.05	< 0.5 UJ	ND
	12/02/03	< 0.1	< 0.1	< 0.1	< 0.05	< 0.05	< 0.05	< 0.05	< 0.1	< 0.1	< 0.1	< 0.05	< 0.05	< 0.05	< 0.05	< 0.5	ND
	08/12/03	< 0.09	< 0.09	< 0.09	< 0.05 UJ	< 0.05	< 0.05 UJ	< 0.05 UJ	< 0.09	< 0.09	< 0.09	< 0.05 UJ	< 0.05	< 0.05 UJ	< 0.05 UJ	< 0.5	ND
	06/06/03	< 0.09 UJ	< 0.09 UJ	< 0.09 UJ	< 0.05	< 0.05 UJ	< 0.05	< 0.05	< 0.09 UJ	< 0.09 UJ	< 0.09 UJ	< 0.05	< 0.05 UJ	< 0.05	< 0.05	< 0.5 UJ	ND
1349MW105	03/15/04	< 0.09 UJ	< 0.09 UJ	< 0.09 UJ	< 0.05 UJ	< 0.05 UJ	< 0.05 UJ	< 0.05 UJ	< 0.09 UJ	< 0.09 UJ	< 0.09 UJ	< 0.05 UJ	< 0.05 UJ	< 0.05 UJ	< 0.05 UJ	< 0.5 UJ	ND
	12/02/03	< 0.1	< 0.1	< 0.1	< 0.05	< 0.05	< 0.05	< 0.05	< 0.1	< 0.1	< 0.1	< 0.05	< 0.05	< 0.05	< 0.05	< 0.5	ND
	08/12/03	< 0.1	< 0.1	< 0.1	< 0.05 UJ	< 0.05	< 0.05 UJ	< 0.05 UJ	< 0.1	< 0.1	< 0.1	< 0.05 UJ	< 0.05	< 0.05 UJ	< 0.05 UJ	< 0.5	ND
	06/09/03	< 0.1 UJ	< 0.1 UJ	< 0.1 UJ	< 0.05 UJ	< 0.05 UJ	< 0.05 UJ	< 0.05 UJ	< 0.1 UJ	< 0.1 UJ	< 0.1 UJ	< 0.05 UJ	< 0.05 UJ	< 0.05 UJ	< 0.05 UJ	< 0.5 UJ	ND

#### Notes

- 1 The identified analytical method(s) are for analyses performed beginning in the Second Quarter 2001. The analytical methods used during previous quarters are identified in the respective quarterly reports.
- 2- Drinking Water Cleanup Level from Table 7-6 Cleanup Levels Document (EKI, October 2002).
- a) Values obtained from Environmental Screening Levels (ESLs) for Drinking Water (RWQCB, 2003b)
- b) Value is laboratory reporting limit.
- μg/L micrograms per liter
- ND Not detected
- NA Not analyzed
- OCPs Organochlorine pesticides
- PCBs Polychlorinated biphenyls
- "CL" suffix denotes a quality control duplicate sample was sent to the control laboratory.

## Appendix B-9 Results of PAH Analyses in Groundwater Building 1349 Presidio of San Francisco, California

Well Name	Sample Date	Anthracene	Benzo(a)- Anthracene	Benzo(g,h,i)- Perylene	Chrysene	Dibenz(a,h)- Anthracene	Fluor- anthene	Fluorene	Indeno- (1,2,3-c,d)- Pyrene	Naph- thalene	Phen- anthrene	Pyrene	All Other PAHs
	Analytical Method <sup>1</sup>	SW8310	SW8310	SW8310	SW8310	SW8310	SW8310	SW8310	SW8310	SW8310	SW8310	SW8310	SW8310
		(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)
Cleanup L	evel 2	770	0.1	150	20		300	300		300	230	230	
1349MW01	03/15/04	< 0.47	< 0.09	< 0.19	< 0.09	< 0.19	< 0.38	< 0.94	< 0.13	< 0.94	< 0.47	< 0.19	ND
	12/02/03	< 0.48	< 0.1	< 0.19	< 0.1	< 0.19	< 0.38	< 0.95	< 0.13	< 0.95	< 0.48	< 0.19	ND
	08/21/03	< 0.48	< 0.1	< 0.19	< 0.1	< 0.19	< 0.38	< 0.95	< 0.13	< 0.95	< 0.48	< 0.19	ND
	06/10/03	< 0.48	< 0.1	< 0.19	< 0.1	< 0.19	< 0.38	< 0.96	< 0.13	< 0.96	< 0.48	< 0.19	ND
	03/12/03	< 0.48	< 0.1	< 0.19	< 0.1	< 0.19	< 0.38	< 0.96	< 0.13	< 0.96	< 0.48	< 0.19	ND
	12/09/02	< 0.49	< 0.1	< 0.19	< 0.1	< 0.19	< 0.39	< 0.97	< 0.14	< 0.97	< 0.49	< 0.19	ND
DUP1209021A	12/09/02	< 0.47	< 0.09	< 0.19	< 0.09	< 0.19	< 0.38	< 0.94	< 0.13	< 0.94	< 0.47	< 0.19	ND
1349MW01CL	12/09/02	< 0.05	< 0.05	< 0.1	< 0.05	< 0.2	< 0.1	< 0.1	< 0.05	< 0.5	< 0.05	< 0.05	ND
	08/28/02	< 0.5	< 0.1	< 0.2	< 0.1	< 0.2	< 0.4	< 0.99	< 0.14	< 0.99	< 0.5	< 0.2	ND
	05/30/02	< 0.49	< 0.1	< 0.2	< 0.1	< 0.2	< 0.39	< 0.98	< 0.14	< 0.98	< 0.49	< 0.2	ND
	03/06/02	< 0.49	< 0.1	< 0.19	< 0.1	< 0.19	< 0.39	< 0.97	< 0.14	< 0.97	< 0.49	< 0.19	ND
	11/28/01	< 0.48	< 0.1	< 0.19	< 0.1	< 0.19	< 0.38	< 0.96	< 0.13	< 0.96	< 0.48	< 0.19	ND
	08/30/01	< 0.48	< 0.1	< 0.19	< 0.1	< 0.19	< 0.38	< 0.95	< 0.13	< 0.95	< 0.48	< 0.19	ND
DUP0830013A	08/30/01	< 0.53	< 0.11	< 0.19	< 0.11	< 0.19	< 0.43	< 1.1	< 0.13	< 1.1	< 0.53	< 0.21	ND
1349MW01CL	08/30/01	< 0.05	< 0.1	< 0.1	< 0.1	< 0.1	< 0.15	< 0.1	< 0.1	< 0.15	< 0.1	< 0.15	ND
	05/10/01	< 0.48 UJ	< 0.1 UJ	< 0.19 UJ	< 0.1 UJ	< 0.19 UJ	< 0.38 UJ	< 0.95 UJ	< 0.13 UJ	< 0.95 UJ		< 0.19 UJ	ND
1349MW02	03/15/04	< 0.47	< 0.09	< 0.19	< 0.09	< 0.19	< 0.38	< 0.94	< 0.13	< 0.94	< 0.47	< 0.19	ND
	12/02/03	< 0.48	< 0.1	< 0.19	< 0.1	< 0.19	< 0.38	< 0.95	< 0.13	< 0.95	< 0.48	< 0.19	ND
	08/13/03	< 0.48	< 0.1	< 0.19	< 0.1	< 0.19	< 0.38	< 0.95	< 0.13	< 0.95	< 0.48	< 0.19	ND
	06/05/03	< 0.47	< 0.09	< 0.19	< 0.09	< 0.19	< 0.38	< 0.94	< 0.13	< 0.94	< 0.47	< 0.19	ND
DUP0605032A	06/05/03	< 0.47	< 0.09	< 0.19	< 0.09	< 0.19	< 0.38	< 0.94	< 0.13	< 0.94	< 0.47	< 0.19	ND
	03/12/03	< 0.49	< 0.1	< 0.19	< 0.1	< 0.19	< 0.39	< 0.97	< 0.14	< 0.97	< 0.49	< 0.19	ND
	12/04/02	< 0.47	< 0.09	< 0.19	< 0.09	< 0.19	< 0.38	< 0.94	< 0.13	< 0.94	< 0.47	< 0.19	ND
DUP1204023A	12/04/02	< 0.49	< 0.1	< 0.2	< 0.1	< 0.2	< 0.39	< 0.98	< 0.14	< 0.98	< 0.49	< 0.2	ND
	08/28/02	< 0.49	< 0.1	< 0.2	< 0.1	< 0.2	< 0.39	< 0.98	< 0.14	< 0.98	< 0.49	< 0.2	ND
	05/30/02	< 0.47	< 0.09	< 0.19	< 0.09	< 0.19	< 0.38	< 0.94	< 0.13	< 0.94	< 0.47	< 0.19	ND
1349MW02	03/06/02	< 0.48	< 0.1	< 0.19	< 0.1	< 0.19	< 0.38	< 0.95	< 0.13	< 0.95	< 0.48	< 0.19	ND
DUP0306022A	03/06/02	< 0.48	< 0.1	< 0.19	< 0.1	< 0.19	< 0.38	< 0.95	< 0.13	< 0.95	< 0.48	< 0.19	ND
	11/28/01	< 0.48	< 0.1	< 0.19	< 0.1	< 0.19	< 0.38	< 0.96	< 0.13	< 0.96	< 0.48	< 0.19	ND
DUP1128011A	11/28/01	< 0.48	< 0.1	< 0.19	< 0.1	< 0.19	< 0.38	< 0.96	< 0.13	< 0.96	< 0.48	< 0.19	ND
	08/30/01	< 0.48	< 0.1	< 0.19	< 0.1	< 0.19	< 0.38	< 0.95	< 0.13	< 0.95	< 0.48	< 0.19	ND
DUP0830012A	08/30/01	< 0.51	< 0.1	< 0.19	< 0.1	< 0.19	< 0.41	< 1	< 0.13	< 1	< 0.51	< 0.2	ND

# Appendix B-9 Results of PAH Analyses in Groundwater Building 1349 Presidio of San Francisco, California

Well Name	Sample Date	Anthracene	Benzo(a)- Anthracene	Benzo(g,h,i)- Perylene	Chrysene	Dibenz(a,h)- Anthracene	Fluor- anthene	Fluorene	Indeno- (1,2,3-c,d)- Pyrene	Naph- thalene	Phen- anthrene	Pyrene	All Other PAHs
	Analytical Method <sup>1</sup>	SW8310	SW8310	SW8310	SW8310	SW8310	SW8310	SW8310	SW8310	SW8310	SW8310	SW8310	SW8310
		(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	$(\mu g/L)$	(µg/L)
Cleanup L	Level 2	770	0.1	150	20		300	300		300	230	230	
1349MW02CL	08/30/01	< 0.05	< 0.1	< 0.1	< 0.1	< 0.1	< 0.15	< 0.1	< 0.1	< 0.15	< 0.1	< 0.15	ND
	05/10/01	< 0.49 UJ	< 0.1	< 0.19	< 0.1	< 0.19	< 0.39	< 0.97	< 0.14	< 0.97	< 0.49	< 0.19	ND
1349MW03	12/09/02	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS	NS
	08/28/02	< 0.47	< 0.09	< 0.19	< 0.09	< 0.19	< 0.38	< 0.94	< 0.13	< 0.94	< 0.47	< 0.19	ND
DUP0828022A	08/28/02	< 0.49	< 0.1	< 0.2	< 0.1	< 0.2	< 0.39	< 0.98	< 0.14	< 0.98	< 0.49	< 0.2	ND
1349MW03CL	08/28/02	< 0.05 UJ	< 0.1 UJ	< 0.1 UJ	< 0.1 UJ	< 0.1 UJ	< 0.15 UJ	< 0.1 UJ	< 0.1 UJ	< 0.15 UJ	< 0.1 UJ	< 0.15 UJ	ND
	05/30/02	< 0.47	< 0.09	< 0.19	< 0.09	< 0.19	< 0.38	< 0.94	< 0.13	< 0.94	< 0.47	< 0.19	ND
DUP0530021A	05/30/02	< 0.47	< 0.09	< 0.19	< 0.09	< 0.19	< 0.38	< 0.94	< 0.13	< 0.94	< 0.47	< 0.19	ND
1349MW03CL	05/30/02	< 0.05	< 0.1	< 0.1	< 0.1	< 0.1	< 0.15	< 0.1	< 0.1	< 0.15	< 0.1	< 0.15	ND
	03/06/02	< 0.48	< 0.1	< 0.19	< 0.1	< 0.19	< 0.38	< 0.95	< 0.13	< 0.95	< 0.48	< 0.19	ND
DUP0306022B	03/06/02	< 0.48	< 0.1	< 0.19	< 0.1	< 0.19	< 0.38	< 0.95	< 0.13	< 0.95	< 0.48	< 0.19	ND
1349MW03CL	03/06/02	< 0.05	< 0.1	< 0.1	< 0.1	< 0.1	< 0.15	< 0.1	< 0.1	< 0.15	< 0.1	< 0.15	ND
	11/28/01	< 0.48	< 0.1	0.28	< 0.1	0.36	< 0.38	< 0.96	0.17	< 0.96	< 0.48	< 0.19	ND
DUP1128011B	11/28/01	< 0.48	< 0.1	< 0.19	< 0.1	< 0.19	< 0.38	< 0.96	< 0.13	< 0.96	< 0.48	< 0.19	ND
1349MW03CL	11/28/01	< 0.05	< 0.1	< 0.1	< 0.1	< 0.1	< 0.15	< 0.1	< 0.1	< 0.15	< 0.1	< 0.15	ND
	08/30/01	< 0.48	< 0.1	< 0.19	< 0.1	< 0.19	< 0.38	< 0.96	< 0.13	< 0.96	< 0.48	< 0.19	ND
	05/10/01	< 0.49 UJ	< 0.1	< 0.19	< 0.1	< 0.19	< 0.39	< 0.97	< 0.14	< 0.97	< 0.49	< 0.19	ND
	07/21/00	< 9.6	< 9.6	< 9.6	< 9.6	< 9.6	< 9.6	< 9.6	< 9.6	< 9.6	< 9.6	< 9.6	ND
1349MW03R	03/09/04	< 0.47	< 0.09	< 0.19	< 0.09	< 0.19	< 0.38	< 0.94	< 0.13	< 0.94	< 0.47	< 0.19	ND
	12/02/03	< 0.48	< 0.1	< 0.19	< 0.1	< 0.19	< 0.38	< 0.95	< 0.13	< 0.95	< 0.48	< 0.19	ND
	08/13/03	< 0.48	< 0.1	< 0.19	< 0.1	< 0.19	< 0.38	< 0.95	< 0.13	< 0.95	< 0.48	< 0.19	ND
	06/09/03	< 0.48	< 0.1	< 0.19	< 0.1	< 0.19	< 0.38	< 0.96	< 0.13	< 0.96	< 0.48	< 0.19	ND
1349MW100	03/16/04	< 9.4	6.2	< 3.8	2.7	< 3.8	14	46	< 2.6	< 19	86	< 3.8	ND
	12/02/03	0.59 J,J+	< 0.1	< 0.19	0.32 J+	< 0.19	0.96 J+	11 J+	< 0.13	< 0.95	9.6 J+	0.28 J+	ND
	08/12/03	1.1 J+	< 0.1	< 0.19	0.81 J+	< 0.19	1.7 J+	19 J+	< 0.13	< 0.95	18 J+	0.51 J+	ND
	06/09/03	< 0.47	0.53 J+	< 0.19	1 J+	< 0.19	2.4 J+	13 J+	< 0.13	7.5 J+	17 J+	0.75 J+	ND
	03/12/03	< 0.49	0.14	< 0.2	0.16	< 0.2	< 0.39	5.2	< 0.14	< 0.98	5.3	0.27	ND
	12/10/02	0.25 J	0.15	< 0.19	0.17	< 0.19	0.43	4	< 0.13	< 0.94	4.2	0.23	ND
1349MW101	03/09/04	< 0.48	< 0.1	< 0.19	< 0.1	< 0.19	< 0.38	< 0.95	< 0.13	< 0.95	< 0.48	< 0.19	ND
	12/02/03	< 0.49	< 0.1	< 0.19	< 0.1	< 0.19	< 0.39	< 0.97	< 0.14	< 0.97	< 0.49	< 0.19	ND
	08/19/03	< 0.48 UJ	< 0.1 UJ	< 0.19 UJ	< 0.1 UJ	< 0.19 UJ		< 0.95 UJ			< 0.48 UJ		ND
	06/09/03	< 0.47 UJ	< 0.09 UJ	< 0.19 UJ	$<0.09\ UJ$	< 0.19 UJ	< 0.38 UJ	< 0.94 UJ	< 0.13 UJ	< 0.94 UJ	< 0.47  UJ	< 0.19 UJ	ND

### Appendix B-9 Results of PAH Analyses in Groundwater Building 1349 Presidio of San Francisco, California

Well Name	Sample Date	Anthracene	Benzo(a)- Anthracene	Benzo(g,h,i)- Perylene	Chrysene	Dibenz(a,h)- Anthracene	Fluor- anthene	Fluorene	Indeno- (1,2,3-c,d)- Pyrene	Naph- thalene	Phen- anthrene	Pyrene	All Other PAHs
	Analytical Method <sup>1</sup>	SW8310	SW8310	SW8310	SW8310	SW8310	SW8310	SW8310	SW8310	SW8310	SW8310	SW8310	SW8310
		(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)
Cleanup L	evel 2	770	0.1	150	20		300	300		300	230	230	
1349MW102	03/10/04	< 0.49	< 0.1	< 0.2	< 0.1	< 0.2	< 0.39	< 0.98	< 0.14	< 0.98	< 0.49	< 0.2	ND
DUP0310041A	03/10/04	< 0.49	< 0.1	< 0.19	< 0.1	< 0.19	< 0.39	< 0.97	< 0.14	< 0.97	< 0.49	< 0.19	ND
1349MW102CL	03/10/04	< 0.05	< 0.05	< 0.1 UJ	< 0.05	< 0.2 UJ	< 0.1	< 0.1	< 0.05 UJ	< 0.5	< 0.05	< 0.05	ND
	12/10/03	< 0.47	< 0.09	< 0.19	< 0.09	< 0.19	< 0.38	< 0.94	< 0.13	< 0.94	< 0.47	< 0.19	ND
DUP1210031A	12/10/03	< 0.47	< 0.09	< 0.19	< 0.09	< 0.19	< 0.38	< 0.94	< 0.13	< 0.94	< 0.47	< 0.19	ND
	08/12/03	< 0.48	< 0.1	< 0.19	< 0.1	< 0.19	< 0.38	< 0.95	< 0.13	< 0.95	< 0.48	< 0.19	ND
	06/09/03	< 0.48	< 0.1	< 0.19	< 0.1	< 0.19	< 0.38	< 0.95	< 0.13	< 0.95	< 0.48	< 0.19	ND
DUP0609032A	06/09/03	< 0.48	< 0.1	< 0.19	< 0.1	< 0.19	< 0.38	< 0.96	< 0.13	< 0.96	< 0.48	< 0.19	ND
1349MW102CL	06/09/03	< 0.048	< 0.048	< 0.095	< 0.048	< 0.19	< 0.095	< 0.095	< 0.048	< 0.48	< 0.048	< 0.048	ND
1349MW103	03/15/04	< 0.48	< 0.1	< 0.19	< 0.1	< 0.19	< 0.38	< 0.95	< 0.13	< 0.95	< 0.48	< 0.19	ND
	12/03/03	< 0.47	< 0.09	< 0.19	0.16	< 0.19	0.1 J	< 0.94	< 0.13	< 0.94	< 0.47	< 0.19	ND
DUP1203032A	12/03/03	< 0.48	< 0.1	< 0.19	< 0.1	< 0.19	< 0.38	< 0.95	< 0.13	< 0.95	< 0.48	< 0.19	ND
	08/12/03	< 0.48	< 0.1	< 0.19	< 0.1	< 0.19	< 0.38	< 0.96	< 0.13	< 0.96	< 0.48	< 0.19	ND
	06/05/03	0.1 J	< 0.1	< 0.19	0.16	< 0.19	0.25 J	< 0.95	< 0.13	< 0.95	0.84	< 0.19	ND
1349MW104	03/15/04	< 0.47	< 0.09	< 0.19	< 0.09	< 0.19	< 0.38	< 0.94	< 0.13	< 0.94	< 0.47	< 0.19	ND
	12/02/03	< 0.47	< 0.09	< 0.19	< 0.09	< 0.19	< 0.38	< 0.94	< 0.13	< 0.94	< 0.47	< 0.19	ND
	08/12/03	< 0.48	< 0.1	< 0.19	< 0.1	< 0.19	< 0.38	< 0.95	< 0.13	< 0.95	< 0.48	< 0.19	ND
	06/06/03	< 0.47	< 0.09	< 0.19	< 0.09	< 0.19	< 0.38	< 0.94	< 0.13	< 0.94	< 0.47	< 0.19	ND
1349MW105	03/15/04	< 0.48	< 0.1	< 0.19	< 0.1	< 0.19	< 0.38	< 0.95	< 0.13	< 0.95	< 0.48	< 0.19	ND
	12/02/03	< 0.49	< 0.1	< 0.19	< 0.1	< 0.19	< 0.39	< 0.97	< 0.14	< 0.97	< 0.49	< 0.19	ND
	08/12/03	< 0.48	< 0.1	< 0.19	< 0.1	< 0.19	< 0.38	< 0.95	< 0.13	< 0.95	< 0.48	< 0.19	ND
	06/09/03	< 0.48	< 0.1	< 0.19	< 0.1	< 0.19	0.02 J	< 0.95	< 0.13	< 0.96	< 0.48	< 0.19	ND

#### Notes

- 1 The identified analytical method(s) are for analyses performed beginning in the Second Quarter 2001. The analytical methods used during previous quarters are identified in the respective quarterly reports.
- 2- Drinking Water Cleanup Level from Table 7-6 Cleanup Levels Document (EKI, October 2002).
- -- cleanup level not established
- μg/L micrograms per liter
- ND Not detected
- NS Not sampled
- PAHs Polycyclic aromatic hydrocarbons
- "CL" suffix denotes a quality control duplicate sample was sent to control laboratory.

# Appendix B-10 Results of Chlorinated Herbicide Analyses in Groundwater Building 1349 Presidio of San Francisco, California

Well Name	Sample Date	2,4-D	2,4-DB	All Other Chlorinated Herbicides
	Analytical Method <sup>1</sup>	SW8151/	SW8151/	SW8151/
	Aliarytical Method	SW8151A	SW8151A	SW8151A
		(μg/L)	(μg/L)	(μg/L)
1349MW01	03/15/04	< 0.24 U	< 0.96 U	ND
	12/02/03	< 0.24 U	< 0.96 U	ND
	08/21/03	< 0.25	<1	ND
1349MW02	06/10/03 08/12/04	< 0.24 < 0.24 U UJ	< 0.96 < 0.96 U UJ	ND ND
1349WIWU2	05/26/04	< 0.24 U UJ	< 0.96 U UJ	ND ND
	03/15/04	< 0.24 U	< 0.96 U	ND
	12/02/03	< 0.24 U	< 0.96 U	ND
	08/13/03	< 0.24	< 0.96	ND
	06/05/03	< 0.24	< 0.96	ND
DUP0605032A	06/05/03	< 0.24	< 0.96	ND
1349MW03R	08/10/04	< 0.24 U	< 0.96 U	ND
	05/26/04	< 0.24 U	< 0.96 U	ND
	03/09/04	< 0.24 U	< 0.96 U	ND
	12/02/03	< 0.24 U	< 0.96 U	ND
	08/13/03	< 0.24	< 0.96	ND
	06/09/03	< 0.24	< 0.96	ND
1349MW100	08/10/04	< 0.24 U	< 0.96 U	ND
1349W W 100				
	05/27/04	< 0.24 U	< 0.96 U	ND
	03/16/04	< 0.24 U	< 0.96 U	ND
	12/02/03	< 0.24 U 2.1	< 0.96 U	ND ND
	08/12/03	· · · · · · · · · · · · · · · · · · ·		
1240 43 1101	06/09/03	< 0.24	< 0.96	ND
1349MW101	03/09/04	< 0.24 U	< 0.96 U	ND
	12/02/03	< 0.24 U	< 0.96 U	ND
	08/19/03	< 0.24	< 0.96	ND
	06/09/03	< 0.24	< 0.96	ND
1349MW102	08/10/04	< 0.24 U	< 0.96 U	ND
DUP0810042A	08/10/04	< 0.24 U	< 0.96 U	ND
	05/27/04	< 0.24 U	< 0.96 U	ND
DUP0527041A	05/27/04	< 0.24 U	< 0.96 U	ND
1349MW102CL	05/27/04	< 0.24	< 0.24	ND
	03/10/04	< 0.24 U	< 0.96 U	ND
1349MW102CL	03/10/04	< 0.25 UJ	< 0.25 UJ	ND
	12/10/03	< 0.24 U	< 0.96 U	ND
DUP1210031A	12/10/03	< 0.24 U	< 0.96 U	ND
	08/12/03	< 0.25	< 1	ND
	06/09/03	< 0.24	< 0.96	ND
DUP0609032A	06/09/03	< 0.24	< 0.96	ND
1349MW102CL	06/09/03	< 0.24 UJ	< 0.24 UJ	ND
1349MW103	03/15/04	< 0.24 U	< 0.96 U	ND
	12/03/03	< 0.24 U	< 0.96 U	ND
DUP1203032A	12/03/03	< 0.24 U	< 0.96 U	ND
	08/12/03	< 0.25	<1	ND
	06/05/03	< 0.24	< 0.96	ND

## Appendix B-10 Results of Chlorinated Herbicide Analyses in Groundwater Building 1349 Presidio of San Francisco, California

Well Name	Sample Date	2,4-D	2,4-DB	All Other Chlorinated Herbicides
	Analytical Method <sup>1</sup>	SW8151/	SW8151/	SW8151/
	Anarytical Method	SW8151A	SW8151A	SW8151A
		(µg/L)	(µg/L)	(µg/L)
1349MW104	03/15/04	< 0.24 U	< 0.96 U	ND
	12/02/03	< 0.24 U	< 0.96 U	ND
	08/12/03	< 0.25	< 1	ND
	06/06/03	< 0.24	< 0.96	ND
1349MW105	03/15/04	< 0.24 U	< 0.96 U	ND
	12/02/03	< 0.24 U	< 0.96 U	ND
	08/12/03	< 0.25	< 1	ND
	06/09/03	< 0.24	< 0.96	ND

#### Notes

 $\mu g/L$  - micrograms per liter

ND - Not detected

<sup>1</sup> - The identified analytical method(s) are for analyses performed beginning in the Second Quarter 2001. The analytical methods used during previous quarters are identified in the respective quarterly reports.

<sup>&</sup>quot;CL" suffix denotes a quality control duplicate sample was sent to the control laboratory.

Well Name	Sample Date	Aluminum	Antimony	Arsenic	Barium	Beryllium	Cadmium	Calcium	Chromium 2	Cobalt	Copper	Hexavalent Chromium <sup>2</sup>	Iron	Lead	Magnesium	Manganese	Mercury	Nickel	Potassium	Selenium	Silver	Sodium	Thallium	Vanadium	Zinc	Total Dissolved Solids
	Analytical Method <sup>1</sup>	SW6010/ SW6020	SW6020	SW6020	SW6010/ SW6020	SW6020	SW6020	SW6010/ SW6020	SW6020	SW6020	SW6020	SW7196/ SW7196A	SW6010/ SW6020	SW6010/ SW6020	SW6010/ SW6020	SW6010/ SW6020	SW7470/ SW7470A	SW6020	SW6010/ SW6020	SW6010/ SW6020	SW6010/ SW6020	SW6010/ SW6020	SW6010/ SW6020	SW6010/ SW6020	SW6010/ SW6020	E160.1
Cleanup Level <sup>3</sup>			6	10	1000	4	5		50	140 a	1000	21 a		15			2	100		50	50		2	15 a	5000	
		(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(mg/L)
1349MW01	03/15/04	< 100	< 1	< 5	34 J-	< 2	< 1	110,000	< 10	< 10	3	NA	270	< 3	210,000	< 10	< 0.2	< 20	1,800	< 5	< 1	250,000	< 1	< 10	< 20	1,650
	12/02/03	< 100	< 1	< 5	38	< 2	< 1	86,000	< 10	< 10	1.3	NA	370	< 3	180,000	< 10	< 0.2	< 20	1,900	< 5	<1 UJ	200,000	< 1	< 10	< 20	1,240
	08/21/03	< 100	< 1	< 5	39	< 2	< 1	94,000	< 10	< 10	< 1	NA	610	< 3	200,000	< 10	< 0.2	< 20	1,700	5.3	<1 UJ	200,000	< 1	< 10	< 20 UJ	1,660
	06/10/03	< 100	< 1	< 5	38	< 2	< 1	100,000	< 10	< 10	< 1	NA 10	150	< 3	180,000	12	< 0.2	< 20	1,900	< 5	< 1	170,000	< 1	< 10	< 20	1,650
DIID1200021 A	12/09/02	< 100	< 1	< 1	44	< 1	< 1	100,000	8.2	< 1	< 1	< 10	330	< 3	210,000	10 J	0.22	6.9	2,100	< 5	<1 UJ	200,000	< 1	< 10	< 10	1,490
DUP1209021A	12/09/02	< 100	< 1	< 1	46	< 1	< 1	100,000	10	< 1	< 1	< 10	320	< 3	210,000	12 J	< 0.2	11	2,100	< 5	< 1 UJ	190,000	< 1	< 10	< 10	1,580
1349MW01CL	12/09/02	< 300	< 5	14	46	< 1	< l	110,000 J+	7.3	< 7	6.5	< 5	< 150	< 3	240,000	11	< 0.2	12	2,600	6.1	< 1	210,000	< 2	< 10	< 10	1,600
	08/28/02 05/30/02	< 100	< 1	< 1	280	< 1	< 1	110,000	1.2 J	< 1	1.3	< 10 < 10 UJ	180	< 3	230,000	< 10 < 10	< 0.2 < 0.2	3.8	2,000	< 5	<1 UJ	230,000	< 1	< 10	30	1,750 1,670
	03/30/02	< 100 < 100	< 1	< 1	42	< 1	< 1	100,000	3.2	< 1	1.2	1	200 480	< 3	210,000	< 10		4.3 5.6	2,000	< 5	< 1 UJ	210,000	< 1	< 10 < 10	< 10	
	11/28/01	< 100	1.1	1.1	450 590	< 1	< 1	130,000	3.8 27 J	< 1	3.4	< 10 < 10	< 100	< 3 < 3	250,000	15	< 0.2 < 0.2	8.8	2,200 2,500	< 5 11	1.8 J- < 1	290,000	< 1	< 10	90 200	1,660 1,610
	08/30/01	< 100	1.6	< 1	470 J+	< 1	< 1	98,000	16	< 1	2.7	< 10 UJ	300	< 3	260,000	15	< 0.2	14	2,300	< 5	< 1 UJ	210,000	< 1	< 10	98	NA
DUP0830013A	08/30/01	< 100	< 1	< 1	110 J+	< 1	< 1	98,000	15	< 1	2.7	< 10 UJ	300	< 3	260,000	15	< 0.2	17	1,800	< 5	< 1 UJ	210,000	< 1	< 10	13	NA NA
1349MW01CL	08/30/01	< 200	0.53 J	< 2	110 3+	< 1	< 1	100,000	7.2	0.97 J	1.5 J	< 10	< 200	< 5	220,000	16	< 0.2	6.7	2,600	7.4	< 1	260,000	< 5	< 5	19	2,100
1347MWOICE	05/10/01	< 100	< 1	1.3	620	< 1	< 1	110,000	10 J	< 1	4.6 J	< 10 UJ	840	< 3	230,000	11	< 0.2	5.4 J	2,700	5.9	< 1 UJ	220,000	< 1	< 10	180 J	1,690 J
	05/19/99	< 100	NA	NA	NA	NA	NA	107,000	NA	NA	< 10	NA	< 100	NA	240,000	< 10	NA	NA	< 5,000	NA	NA	203,000	NA	NA	NA	1,900
	02/19/99	< 100	NA	NA	NA	NA	NA	101,000	NA	NA	< 10	NA	< 100	NA	234,000	< 10	NA	NA	< 5,000	NA	NA	193,000	NA	NA	NA	1,800
	11/18/98	< 100	NA	NA	NA	NA	NA	96,900	NA	NA	< 10	NA	< 100	NA	237,000	< 10	NA	NA	< 5,000	NA	NA	190,000	NA	NA	NA	1,640
	08/18/98	< 100	NA	NA	NA	NA	NA	102,000	NA	NA	11.8	NA	< 100	NA	248,000	< 10	NA	NA	< 5,000	NA	NA	197,000	NA	NA	NA	1,900
	04/16/98	< 100	NA	NA	NA	NA	NA	100,000	NA	NA	28.4	< 10 (U16)	< 100	NA	222,000	< 10	NA	NA	< 5,000	NA	NA	200,000	NA	NA	NA	1,980
	01/22/98	< 100	NA	NA	NA	NA	NA	94,900	NA	NA	< 10	NA	< 100	NA	238,000	13.4	NA	NA	< 5,000	NA	NA	182,000	NA	NA	NA	1,830
	10/30/97	< 100	NA	NA	NA	NA	NA	97,000	NA	NA	< 20	NA	< 100	NA	237,000	24.2	NA	NA	< 5,000	NA	NA	178,000	NA	NA	NA	1,950
	07/31/97	< 100	NA	NA	NA	NA	NA	93,200	NA	NA	< 20	NA	< 100	NA	221,000	14.2	NA	NA	< 5,000	NA	NA	190,000	NA	NA	NA	1,650
	05/01/97	< 100	NA	NA	NA	NA	NA	110,000	NA	NA	< 10	NA	< 100	NA	263,000	29	NA	NA	3,040	NA	NA	191,000	NA	NA	NA	1,830
	02/10/97	< 100	NA	NA	NA	NA	NA	118,000	NA	NA	5.1	NA	< 100	NA	260,000	34	NA	NA	< 5,000	NA	NA	234,000	NA	NA	NA	2,090
1349MW02	08/12/04	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	1,620
	05/26/04	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	1,620
	03/15/04	< 100	< 1	< 5	230 J-	< 2	< 1	85,000	83	< 10	1.8	NA	190	< 3	270,000	< 10	< 0.2	< 20	< 500	< 5	< 1	230,000	< 1	< 10	< 20	1,600
	12/02/03	< 100	1.3	< 5	170	< 2	< 1	57,000	75	< 10	1.1	NA	220	< 3	270,000	< 10	< 0.2	< 20	< 500	< 5	< 1 UJ	200,000	< 1	< 10	< 20	1,160
	08/13/03	< 100	1.7	< 5	180	< 2	< 1	61,000	87	< 10	< 1	NA	300	< 3	230,000	< 10	< 0.2	< 20	< 500	< 5	< 1 UJ	190,000	< 1	< 10	< 20	1,540
	06/05/03	< 100	1.3	< 5	180	< 2	< 1	59,000	80	< 10	1.2	NA	150	< 3	250,000	< 10	0.26	< 20	530	< 5	< 1	210,000	< 1	< 10	< 20	1,440
DUP0605032A	06/05/03	< 100	1.3	< 5	180	< 2	< 1	65,000	83	< 10	< 1	NA	100	< 3	240,000	< 10	< 0.2	< 20	< 500	< 5	< 1	190,000	< 1	< 10	< 20	1,500
	12/04/02	< 100	< 1	< 1	160	< 1	< 1	53,000	92	< 1	< 1	80	160	< 3	220,000	< 10	< 0.2	6.3	< 500	< 5	< 1 UJ	180,000	< 1	< 10	< 10	1,600
DUP1204023A	12/04/02	< 100	< 1	< 1	160	< 1	< 1	52,000	94	< 1	1.1	80	160	< 3	220,000	< 10	< 0.2	6.6	< 500	< 5	<1 UJ	180,000	< 1	< 10	< 10	1,400
	08/28/02	< 100	1.2	< 1	510	< 1	< 1	55,000	82 J	< 1	1.4	90	< 100	< 3	240,000	< 10	< 0.2	6.2	660	< 5	< 1 UJ	210,000	< 1	< 10	68	1,500
	05/30/02	< 100	< 1	< 1	460	< 1	< 1	61,000	79	< 1	1.4	70 J-	< 100	< 3	230,000	< 10	< 0.2	5.1	690	< 5	< 1 UJ	200,000	< 1	< 10	87	1,610
	03/06/02	< 100	< 1	< 1	340	< 1	< 1	90,000	95	< 1	< 1	90	310	< 3	270,000	< 10	< 0.2	7	580	< 5	< 1 UJ	240,000	< 1	< 10	< 10	1,610
DUP0306022A	03/06/02	< 100	< 1	< 1	390	< 1	< 1	96,000	97	< 1	< 1	90 J-	310	< 3	290,000	< 10	< 0.2	7.2	600	< 5	< 1 UJ	260,000	< 1	< 10	16	1,580
	11/28/01	< 100	< 1	1.2	760	< 1	< 1	51,000	130 J	< 1	2.7	100	< 100	< 3	260,000	< 10	< 0.2	8.2	1,100	5.1	< 1	220,000	< 1	< 10	190	1,510
DUP1128011A	11/28/01	< 100	< 1	1	350	< 1	< 1	52,000	130 J	< 1	2.1	100 J	< 100	< 3	260,000	< 10	< 0.2	8.4	900	< 5	< 1	220,000	< 1	< 10	30	1,470
	08/30/01	< 100	< 1	< 1	150 J+	< 1	< 1	45,000	110	< 1	1.8	< 10	150	< 3	250,000	< 10	< 0.2	6.9	< 500	< 5	< 1 UJ	210,000	< 1	< 10	< 10	1,550
DUP0830012A	08/30/01	< 100	< 1	< 1	160 J+	< 1	< 1	47,000	100	< 1	1.9	< 10	150	< 3	260,000	< 10	< 0.2	6.6	< 500	< 5	< 1 UJ	210,000	< 1	< 10	15	1,470

Well Name	Sample Date	Aluminum	Antimony	Arsenic	Barium	Beryllium	Cadmium	Calcium	Chromium 2	Cobalt	Copper	Hexavalent Chromium <sup>2</sup>	Iron	Lead	Magnesium	Manganese	Mercury	Nickel	Potassium	Selenium	Silver	Sodium	Thallium	Vanadium	Zinc	Total Dissolved Solids
	Analytical Method <sup>1</sup>	SW6010/ SW6020	SW6020	SW6020	SW6010/ SW6020	SW6020	SW6020	SW6010/ SW6020	SW6020	SW6020	SW6020	SW7196/ SW7196A	SW6010/ SW6020	SW6010/ SW6020	SW6010/ SW6020	SW6010/ SW6020	SW7470/ SW7470A	SW6020	SW6010/ SW6020	SW6010/ SW6020	SW6010/ SW6020	SW6010/ SW6020	SW6010/ SW6020	SW6010/ SW6020	SW6010/ SW6020	E160.1
Cleanup Level <sup>3</sup>			6	10	1000	4	5		50	140 a	1000	21 a		15			2	100		50	50		2	15 a	5000	
•		(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(mg/L)
1349MW02CL	08/30/01	< 200	1.2 J	< 2	800	< 1	< 1	47,000	110	0.92 J	1.7 J	90	< 200	< 5	230,000	< 5	< 0.2	8.3	<1,000	7.9	< 1	280,000	< 1	< 5	170	1,900
1349MW02	05/10/01	< 100	< 1	1.1	560	< 1	< 1	49,000	98 J	< 1	4.2 J	70 J	390	<3	250,000	< 10	< 0.2	9.3 J	780	< 5	< 1 UJ	210,000	< 1	< 10	160 J	1,620 J
	05/19/99	< 100	NA	NA	NA	NA	NA	57,300	NA	NA	< 10	NA	< 100	NA	274,000	< 10	NA	NA	< 5,000	NA	NA	204,000	NA	NA	NA	1,900
	02/19/99	< 100	NA	NA	NA	NA	NA	63,500	NA	NA	< 10	NA	< 100	NA	284,000	< 10	NA	NA	< 5,000	NA	NA	215,000	NA	NA	NA	1,840
	11/18/98	< 100	NA	NA	NA	NA	NA	59,300	NA	NA	18.7	NA	< 100	NA	283,000	< 10	NA	NA	< 5,000	NA	NA	213,000	NA	NA	NA	1,770
	08/18/98	< 100	NA	NA	NA	NA	NA	57,800	NA	NA	< 10	NA	< 100	NA	267,000	< 10	NA	NA	< 5,000	NA	NA	211,000	NA	NA	NA	1,900
	04/16/98	< 100	NA	NA	NA	NA	NA	53,500	NA	NA	< 10	43 (J16)	< 100	NA	233,000	< 10	NA	NA	< 5,000	NA	NA	195,000	NA	NA	NA	1,760
	01/22/98	< 100	NA	NA	NA	NA	NA	50,800	NA	NA	< 10	NA	< 100	NA	244,000	< 10	NA	NA	< 5,000	NA	NA	196,000	NA	NA	NA	1,750
	10/30/97	< 100	NA	NA	NA	NA	NA	52,300	NA	NA	< 20	NA	< 100	NA	244,000	< 10	NA	NA	< 5,000	NA	NA	199,000	NA	NA	NA	1,750
	07/31/97	< 100	NA	NA	NA	NA	NA	51,300	NA	NA	< 20	NA	< 100	NA	249,000	< 10	NA	NA	< 5,000	NA	NA	205,000	NA	NA	NA	1,810
	05/01/97	< 100	NA	NA	NA	NA	NA	53,900	NA	NA	< 10	NA	< 100	NA	266,000	< 10	NA	NA	< 1,000	NA	NA	188,000	NA	NA	NA	1,700
	02/10/97	< 100	NA	NA	NA NA	NA	NA NA	39,600	NA	NA	2.5	NA NA	< 100	NA NA	176,000	19.7	NA NA	NA NA	< 5,000	NA NA	NA NA	145,000	NA NA	NA NA	NA	1,490
1349MW03	08/28/02	< 100	< 1	< 1	170	< 1	< 1	23,000	99 J	< 1	< 1	110	< 100	< 3	130,000	< 10	< 0.2	5	< 500	< 5	< 1 UJ	60,000	< 1	< 10	25	680
DUP0828022A	08/28/02	< 100	< 1	< 1	370	< 1	< 1	23,000	110 J	< 1	< 1	100	< 100	< 3	130,000	< 10	< 0.2	5.1	< 500	< 5	< 1 UJ	59,000	<1	< 10	62	710
1349MW03CL	08/28/02	54 J	< 2	< 2	74	< 1	< 1	23,000	110 B	0.4 J	< 2 BJ,U	90	30 J	NA	120,000	2.7 J	< 0.2	5.9	400 J	9.3	< 1	55,000	< 1	2.8 J	18	790
	05/30/02	< 100	< 1	< 1	84	< 1	< 1	22,000	99	< 1	< 1	90 J-	< 100	< 3	120,000	< 10	< 0.2	4.7	< 500	< 5	< 1 UJ	53,000	< 1	< 10	19	720
DUP0530021A	05/30/02	< 100	1	< 1	190	< 1	< 1	23,000	98	< 1	< 1	90 J-	< 100	< 3	130,000	< 10	< 0.2	5	< 500	< 5	< 1 UJ	56,000	< 1	< 10	69	740
1349MW03CL	05/30/02	< 100	0.36 J	< 2	120 B	< 1	<1 BJ,U	23,000	98 J+	0.38 J	1.8 BJ	100	< 100	< 5	120,000	6.9	< 0.2	5.5 B	660 J	< 5	< 1	51,000	< 1	2.4 J	39	740 J-
	03/06/02	< 100	< 1	< 1	95	< 1	< 1	28,000	100	< 1	< 1	100	< 100	< 3	160,000	< 10	< 0.2	5.2	< 500	< 5	< 1 UJ	70,000	< 1	< 10	12	720
DUP0306022B	03/06/02	< 100	< 1	< 1	74	< 1	< 1	28,000	100	< 1	< 1	100	< 100	< 3	160,000	< 10	< 0.2	5.4	< 500	< 5	< 1 UJ	70,000	< 1	< 10	< 10	720
1349MW03CL	03/06/02	< 200	0.55 J	0.57 J	290	< 2	0.081 J	24,000	100	0.43 J	1.7 BJ	100	36 J	< 5	130,000	< 5	NA	5.1	< 1,000	6.3	< 1	53,000	< 1	< 5	43 B	870
	11/28/01	< 100	< 1	< 1	260	< 1	< 1	26,000	120 J	< 1	13	110	< 100	< 3	180,000	< 10	< 0.2	6.5	< 500	< 5	< 1	68,000	< 1	< 10	41	760
DUP1128011B	11/28/01	< 100	1	< 1	680	< 1	< 1	27,000	120 J	< 1	1.7	110	< 100	< 3	140,000	< 10	< 0.2	6.6	930	< 5	< 1	72,000	< 1	< 10	170	770
1349MW03CL	11/28/01	< 200	0.11 J	< 2	80	< 1	< 1	23,000	110	0.46 J	1.4 BJ	110	< 200	< 5	130,000	< 5	< 0.2	5.8	< 1,000	5.2	< 1	58,000	< 1	< 5	16 B	770
	08/30/01 05/10/01	< 100 < 100	< 1 2.3	< 1	170 J+ 530	< 1	<1	25,000 26,000	110 110 J	< 1	1.3 2.5 J	< 10 90	< 100 200	< 3 < 3	160,000 150,000	< 10 < 10	< 0.2 < 0.2	5.4 7 J	< 500 < 500	< 5 < 5	<1 UJ	67,000 66,000	<1	< 10 < 10	47 86 J	850 860 J
	07/21/00	NA	<60	< 5	<17	< 2	< 5	NA	70	< 20	< 10	80	NA	< 3	NA	NA	< 0.2	< 20	NA	< 5	< 5	NA	< 5	< 10	< 20	NA
	05/19/99	< 100	NA	NA	NA	NA	NA	26,800	NA	NA	< 10	NA	< 100	NA	149,000	< 10	NA	NA	< 5,000	NA	NA	58,300	NA	NA	NA	863
	02/19/99	< 100	NA	NA	NA	NA	NA	21,100	NA	NA	< 10	NA	< 100	NA	116,000	< 10	NA	NA	< 5,000	NA	NA	46,300	NA	NA	NA	747
	11/18/98	< 100	NA	NA	NA	NA	NA	23,900	NA	NA	< 10	NA	< 100	NA	138,000	< 10	NA	NA	< 5,000	NA	NA	64,300	NA	NA	NA	832
	08/18/98	< 100	NA	NA	NA	NA	NA	26,000	NA	NA	< 10	NA	< 100	NA	139,000	< 10	NA	NA	< 5,000	NA	NA	54,300	NA	NA	NA	795
1	04/16/98	< 100	NA	NA	NA	NA	NA	23,700	NA	NA	< 10	69 (J16)	< 100	NA	128,000	< 10	NA	NA	< 5,000	NA	NA	49,700	NA	NA	NA	667
	01/22/98	< 100	NA	NA	NA	NA	NA	21,200	NA	NA	< 10	NA	< 100	NA	106,000	< 10	NA	NA	< 5,000	NA	NA	40,200	NA	NA	NA	616
	10/30/97	< 100	NA	NA	NA	NA	NA	23,100	NA	NA	< 20	NA	< 100	NA	130,000	< 10	NA	NA	< 5,000	NA	NA	59,400	NA	NA	NA	912
	07/31/97	< 100	NA	NA	NA	NA	NA	23,200	NA	NA	< 20	NA	< 100	NA	131,000	< 10	NA	NA	< 5,000	NA	NA	57,400	NA	NA	NA	806
1	05/01/97	< 100	NA	NA	NA	NA	NA	25,300	NA	NA	< 10	NA	< 100	NA	151,000	< 10	NA	NA	< 1,000	NA	NA	52,800	NA	NA	NA	836
124014337020	02/10/97	< 100	NA NA	NA NA	NA NA	NA NA	NA NA	21,200	NA NA	NA NA	2.6	NA NA	37.2	NA NA	106,000	< 10	NA NA	NA NA	< 5,000	NA NA	NA NA	38,800	NA NA	NA NA	NA NA	825
1349MW03R	08/10/04	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	540
	05/26/04 03/09/04	NA < 100	NA < 1	NA < 5	NA < 10	NA < 2	NA < 1	NA 23,000	NA 94	NA < 10	NA < 1	NA NA	NA < 100	NA < 3	NA 84,000	NA < 10	NA < 0.2	NA < 20	NA 3000 J	NA < 5	NA <1 UJ	NA 67,000	NA < 1	NA < 10	NA < 20	580 550
	12/02/03	< 100	1.9	5.4	< 10	< 2	< 1	18,000	42	< 10	< 1	NA NA	< 100	< 3	68,000	< 10	< 0.2	< 20	4,400	< 5	< 1 UJ	56,000	< 1	< 10	< 20	360
	08/13/03	< 100	3.3	7.4	< 10	< 2	< 1	24,000	59	< 10	< 1	NA	120	< 3	70,000	< 10	< 0.2	< 20	6,100	< 5	<1 UJ	63,000	<1	< 10	< 20	510
	06/09/03	< 100	1.4	6.2	< 10	< 2	< 1	30,000	44	< 10	< 1	NA	< 100	< 3	60,000	< 10	< 0.2	< 20	9,700	< 5	< 1 UJ	100,000	< 1	< 10	< 20	690
1349MW100	08/10/04	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	2450
1	05/26/04	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	2490
	03/16/04	< 100	1.8	11	600 J-	< 2	< 1	150,000	< 10	< 10	1.3	NA	30,000	< 3	210,000	16,000	< 0.2	< 20	2,800	< 5	< 1	440,000	< 1	< 10	< 20	2050

Well Name	Sample Date	Aluminum	Antimony	Arsenic	Barium	Beryllium	Cadmium	Calcium	Chromium 2	Cobalt	Copper	Hexavalent Chromium <sup>2</sup>	Iron	Lead	Magnesium	Manganese	Mercury	Nickel	Potassium	Selenium	Silver	Sodium	Thallium	Vanadium	Zinc	Total Dissolved Solids
	Analytical Method <sup>1</sup>	SW6010/ SW6020	SW6020	SW6020	SW6010/ SW6020	SW6020	SW6020	SW6010/ SW6020	SW6020	SW6020	SW6020	SW7196/ SW7196A	SW6010/ SW6020	SW6010/ SW6020	SW6010/ SW6020	SW6010/ SW6020	SW7470/ SW7470A	SW6020	SW6010/ SW6020	SW6010/ SW6020	SW6010/ SW6020	SW6010/ SW6020	SW6010/ SW6020	SW6010/ SW6020	SW6010/ SW6020	E160.1
Cleanup Level <sup>3</sup>			6	10	1000	4	5		50	140 a	1000	21 a		15			2	100		50	50		2	15 a	5000	
		(µg/L)	(μg/L)	(µg/L)	(µg/L)	(μg/L)	(μg/L)	(µg/L)	(µg/L)	(μg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(μg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(µg/L)	(μg/L)	(mg/L)
	12/02/03	< 100	2.6	23	530	< 2	< 1	170,000	16	< 10	1.3	NA	36,000	< 3	290,000	15,000	< 0.2	< 20	3,900	< 5	<1 UJ	380,000	< 1	< 10	< 20	1,820
1349MW100	08/12/03 06/09/03	< 100 < 100	< 1 1.9	15 J+	700 520	< 2 < 2	< 1 < 1	160,000 130,000	15 J 10	< 10 < 10	< 1	NA NA	21,000 25,000	< 3	250,000 190,000	160 14,000	< 0.2 < 0.2	< 20 < 20	3,400 2,900	< 5 < 5	<1 UJ	350,000 370,000	< 1 < 1	< 10 < 10	< 20 UJ < 20	2,450 2,200
1349WW 100	03/12/03	< 100	< 1	7.9	680	< 1	< 1	140,000	7.2	8.9	< 1	< 10	13,000	< 3	190,000	14,000	< 0.2	15	2,600	< 5	< 1 UJ	330,000 J	< 1	< 10	< 10	2,100
	12/10/02	< 100	< 1	5.9	300	< 1	< 1	190,000	12	33	1.3	< 10	4,600	< 3	290,000	6,600 J	< 0.2	28	7,600	< 5	<1 UJ	300,000	< 1	< 10	< 10	2,480
1349MW101	03/09/04	< 100	1.3	5.2	< 10	< 2	< 1	23,000	45	< 10	< 1	NA	< 100	< 3	61,000	< 10	< 0.2	< 20	4300 J	< 5	<1 UJ	99,000	< 1	< 10	< 20	590
	12/02/03	< 100	1.8	< 5	< 10	< 2	< 1	20,000	15	< 10	< 1	NA	< 100	< 3	54,000	24	< 0.2	< 20	6,300	< 5	< 1 UJ	120,000	< 1	< 10	< 20	390
	08/19/03	< 100	< 1	5.9	< 10	< 2	< 1	29,000	15	< 10	< 1	NA	120	< 3	57,000	19	< 0.2	< 20	7,500	< 5	< 1 UJ	150,000	< 1	< 10	< 20 UJ	660
10107 577100	06/09/03	< 100	< 1	6.1	< 10	< 2	< 1	36,000	34	< 10	< 1	NA	< 100	< 3	56,000	< 10	< 0.2	< 20	9,800	< 5	< 1 UJ	160,000	< 1	< 10	< 20	890
1349MW102	08/10/04	NA	NA NA	NA NA	NA NA	NA NA	NA	NA NA	NA NA	NA	NA	NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA	NA	NA NA	NA NA	NA	1,160
DUP0810042A	08/10/04 05/26/04	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	1,260 1,270
DUP0527041A	05/26/04	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	NA NA	1,220
1349MW102CL	05/26/04	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	1,100
	03/10/04	< 100	< 1	< 5	83	< 2	< 1	73,000	< 10	< 10	< 1	NA	290	< 3	160,000	430	< 0.2	< 20	3,400	< 5	<1 UJ	160,000	< 1	< 10	< 20	1,150
DUP0310041A	03/10/04	< 100	< 1	< 5	81	< 2	< 1	77,000	< 10	< 10	< 1	NA	260	< 3	160,000	400	< 0.2	< 20	3,300	< 5	< 1 UJ	170,000	< 1	< 10	< 20	1,280
1349MW102CL	03/10/04	< 100	< 5	5.6	77	< 1	< 1	76,000	< 10	< 7	< 10	NA	640	< 3	170,000	420	< 0.2	< 10	3,600	< 5	< 1	170,000	< 2	< 10	< 20	1,100 QB01
D	12/10/03	< 100	< 1	< 5	69	< 2	< 1	77,000	< 10	< 10	< 1	NA	420	< 3	160,000	550	< 0.2	< 20	3,800	< 5 R	< 1	160,000	< 1	< 10	< 20 UJ	1,260
DUP1210031A	12/10/03 08/12/03	< 100	1.8 2.7	< 5 < 5 UJ	72 34	< 2	<1	80,000 100,000	< 10 < 10 UJ	< 10 < 10	1	NA NA	460 390	< 3	170,000 180,000	600 550	< 0.2 < 0.2	< 20 < 20	4,000 6,400	< 5 R < 5	<1 <1 UJ	170,000	<1	< 10 < 10	< 20 UJ	1,090 1,430
	06/09/03	< 100 < 100	< 1	< 5	31	< 2 < 2	< 1	100,000	< 10 03	< 10	< 1	NA NA	210	< 3	190,000	440	< 0.2	< 20	9,800	< 5	< 1 UJ	190,000 230,000	< 1	< 10	< 20 03	1,430
DUP0609032A	06/09/03	< 100	2.9	< 5	32	< 2	<1	98,000	< 10	< 10	< 1	NA NA	260	< 3	200,000	450	< 0.2	< 20	9,600	< 5	< 1 UJ	220,000	< 1	< 10	< 20	1,630
1349MW102CL	06/09/03	< 100	< 5	7.3	31	< 1	< 1	110,000	< 5	1.4	< 5	NA	530	< 3	180,000	340	< 0.2	7.4	11,000	< 5	< 1	240,000	< 2	< 10	23	1,900 HT-RA,J-
1349MW103	03/15/04	< 100	< 1	< 5	11 J-	< 2	< 1	88,000	< 10	< 10	1.2	NA	210	< 3	320,000	280	< 0.2	180	6,800	< 5	< 1	200,000	< 1	< 10	< 20	1,650
	12/03/03	< 100	< 1	< 5	< 10	< 2	< 1	75,000	< 10	< 10	1	NA	360	< 3	250,000	260	< 0.2	110	7,800	< 5	< 1 UJ	190,000	< 1	< 10	< 20	1,450
DUP1203032A	12/03/03	< 100	3.6	< 5	< 10	< 2	< 1	74,000	< 10	< 10	< 1	NA	370	< 3	250,000	250	< 0.2	100	7,500	< 5	< 1 UJ	190,000	< 1	< 10	< 20	1,440
	08/12/03	< 100	2.2	< 5 UJ	< 10	< 2	< 1	72,000	< 10 UJ	< 10	< 1	NA	270	< 3	240,000	190	< 0.2	100	8,400	< 5	< 1 UJ	190,000	< 1	< 10	< 20 UJ	1,590
124014771104	06/05/03	< 100	3	< 5	17	< 2	< 1	72,000	< 10	< 10	1	NA	170	< 3	190,000	160	< 0.2	42	13,000	< 5	< 1	190,000	< 1	< 10	< 20	1,520
1349MW104	03/15/04 12/02/03	< 100 < 100	< 1 2.2	< 5 5.8	49 J- 38	< 2 < 2	< 1 < 1	82,000 65,000	40 49	< 10 < 10	1.5	NA NA	190 280	< 3	320,000 280,000	56 80	< 0.2 < 0.2	< 20 < 20	4,200 4,800	< 5 < 5	<1 <1 UJ	280,000 240,000	<1	< 10 < 10	< 20 < 20	1,800 780
	08/12/03	< 100	2.2	5.8 6 J+	35	< 2	< 1	73,000	12 J	< 10	< 1	NA NA	360	< 3	260,000	530	< 0.2	< 20	5,800	< 5 < 5	< 1 UJ	240,000	< 1	< 10	< 20 UJ	1,000
	06/06/03	< 100	1.5	< 5	50	< 2	<1	76,000	< 10	< 10	< 1	NA NA	190	< 3	260,000	970	< 0.2	32	8.300	< 5	<1	270,000	<1	< 10	< 20	1,870
1349MW105	03/15/04	< 100	1.5	12	47 J-	< 2	< 1	86,000	< 10	< 10	1.1	NA	360	< 3	180,000	310	< 0.2	< 20	11,000	< 5	< 1	150,000	< 1	< 10	< 20	1,260
	12/02/03	< 100	1.7	10	36	< 2	< 1	75,000	11	< 10	< 1	NA	600	< 3	160,000	340	< 0.2	< 20	13,000	< 5	< 1 UJ	140,000	< 1	< 10	< 20	850
	08/12/03	< 100	2.5	12 J+	54	< 2	< 1	79,000	< 10 UJ	< 10	< 1	NA	590	< 3	150,000	380	< 0.2	< 20	15,000	< 5	< 1 UJ	160,000	< 1	< 10	< 20 UJ	920
	06/09/03	< 100	4.5	10	41	< 2	< 1	82,000	< 10	< 10	< 1	NA	440	< 3	180,000	350	< 0.2	< 20	16,000	< 5	< 1 UJ	200,000	< 1	< 10	< 20	1,480

#### Note

- 1 The identified analytical method(s) are for analyses performed beginning in the Second Quarter 2001. The analytical methods used during previous quarters are identified in the respective quarterly reports.
- 2 Results of Army and Trust studies support the hypothesis that dissolved chromium and hexavalent chromium measured in groundwater in upland areas of the Presidio appear to be naturally occurring and derived from serpentinite. Hexavalent chromium was not retained as a COC (Treadwell and Rollo, 2002e).
- 3- Drinking Water Cleanup Level from Table 7-6 Cleanup Levels Document (EKI, October 2002).
- a) Values obtained from Environmental Screening Levels (ESLs) for Drinking Water (RWQCB, 2003b)

Groundwater samples collected from all site monitoring wells were field filtered and analyzed for dissolved metals.

 $\mu g/L$  - micrograms per liter

mg/L - milligrams per liter

Well Name	Sample Date	Aluminum	Antimony	Arsenic	Barium	Beryllium	Cadmium	Calcium	Chromium 2	Cobalt	Copper	Hexavalent Chromium <sup>2</sup>	Iron	Lead	Magnesium	Manganese	Mercury	Nickel	Potassium	Selenium	Silver	Sodium	Thallium	Vanadium	Zinc	Total Dissolved Solids
	Analytical Method <sup>1</sup>	SW6010/ SW6020	SW6020	SW6020	SW6010/ SW6020	SW6020	SW6020	SW6010/ SW6020	SW6020	SW6020	SW6020	SW7196/ SW7196A					SW7470/ SW7470A	1800000				SW6010/ SW6020				F160 I
Cleanup Level <sup>3</sup>			6	10	1000	4	5		50	140 a	1000	21 a		15			2	100		50	50		2	15 a	5000	
		(µg/L)	(µg/L)	(µg/L)	$(\mu g/L)$	(µg/L)	$(\mu g/L)$	(µg/L)	$(\mu g/L)$	(µg/L)	$(\mu g/L)$	$(\mu g/L)$	(µg/L)	(µg/L)	$(\mu g/L)$	$(\mu g/L)$	$(\mu g/L)$	(µg/L)	(µg/L)	(µg/L)	$(\mu g/L)$	(µg/L)	(µg/L)	$(\mu g/L)$	(µg/L)	(mg/L)

NA - Not analyzed
"CL" suffix denotes a quality control duplicate sample was sent to the control laboratory.

### Appendix C

# Previous Investigation Summary (From Others)



#### Table 10-2 Excavation Soil Analytical Results, Section MT-6 Fuel Distribution System Removal Report

#### Presidio of San Francisco

Sample Designation		ydrocarbons by odified <sup>b</sup> (mg/kg <sup>e</sup> )	Total Petroleum Hydrocarbons		g)	Total PAHs by Immunoassay				
(depth)* date	Diesel Range (C12-C24)	Fuel Oil Range (C24-C36)	by Immunoassay (mg/kg)	Benzo(a)- anthracene	Benzo(a)- pyrene	Benzo(b)- fluoranthene	Benzo(k)- fluoranthene	Chrysene	Total Carcinogenic	(mg/kg)
FM06039T01 (5.0) 10/24/96	NA°	NA	<115	NA	NA	NA	NA	NA	NA	<5.0
FM06039T02 (6.0) 10/24/96	NA	NA	<115	NA	NA	NA	NA .	NA	NA	<5.0
FM06040T01 (3.0) 10/24/96	NA	NA	<115	NA	NA	NA	NA	NA	NA	<5.0
FM06040T02 (3.5) 10/24/96	NA	NA	115	NA	NA	NA	NA	NA	NA	<5.0
FM06041T01 (3.6) 10/16/96	NA	NA	<115	NA	NA	NA	NA	NA	NA	<5.0
FM06041T02 (3.0) 10/24/96	NA	NA	<115	NA	NA	NA	NA	NA	NA	<5.0
FM06042T01 (3.0) 10/16/96	NA	NA	<115	NA	NA	NA	NA	NA	NA	<5.0
FM06042T02 (3.0) 10/16/96	NA	NA	<115	NA	NA	NA	NA	NA	NA	<5.0
FM06043W01 (7.0) 2/25/97	NA	NA	<1,380	NA	NA	NA	NA ·	NA	NA	5.0
FM06043W02 (7.0) 2/25/97	NA	NA .	>1,380	NA	NA	NA	NA	NA	NA	>5.0 #
FM06043W03 (8.5) 2/25/97	NA	NA	>1,380	NA	NA	NA	NA	NA	NA .	>5.0 *
FM06043W04 (4.0) 2/25/97	1,400	1,800	>1,380	<0.018	0.36	<0.018	<0.018	<0.018	0.36	>5.0
FM06043W05 (6.5) 2/25/97	NA	NA	1,380	NA	NA	NA	NA	NA	NA	>5.0

<sup>a</sup>(depth) - Sample depth in feet below original ground surface

"NA - not analyzed

approved by: C.P. 5/24/99
approved by: 5-21.95

bU.S. Environmental Protection Agency, 1996, Test Methods for Evaluating Solid Waste, Physical/Chemical Methods, SW-846, Washington, DC. cmg/kg - milligrams per kilogram

<sup>&</sup>lt;sup>d</sup>PAHs - polycyclic aromatic hydrocarbons

#### Table 10-3 Stockpile Soil Analytical Results, Section MT-6 Fuel Distribution System Removal Report

#### Presidio of San Francisco

Sample	Collection	Total Petroleum Hydrocarbons	Total PAHsb by	Petroleum Hydrocarbons by EPA 8015 Modified (mg/kg)			
Designation	Date	by Immunoassay (mg/kg²)	Immunoassay (mg/kg)	Diesel Range (C10-C24)	Fuel Oil Range (C24-C36)		
FM06040S01	10/30/96	<100	<5.0	NAd	NA		
FM06040S02	10/30/96	<71	<1	NA	NA		
FM06040S03	10/30/96	<100	<5.0	NA	NA		
FM06040S04	10/30/96	<71	<1	NA	NA		
FM0643S01	10/16/96	<71	<1.3	82	<540		
FM0643S02°	10/16/96	<71	<1.7	51	250		
FM0644S01	10/10/96	>71	>1	NA	NA		

<sup>a</sup>mg/kg - milligrams per kilogram <sup>b</sup>PAHs - Polycyclic Aromatic Hydrocarbons

U.S. Environmental Protection Agency, 1996, Test Methods for Evaluating Solid Waste, Physical/Chemical Methods, SW-846. Washington, DC.

dNA - not analyzed

"FM0643S02 - duplicate of FM0643S01

Source: IT, 1999. Fuel Distribution System Closure Report, Presidio of San Francisco, California, Volumes 1 through 3. May. Shaded values represent exceedence of cleanup level.

#### Table 11-2 Excavation Soil Analytical Results, Section MT-7 Fuel Distribution System Removal Report

Presidio of San Francisco (Page 2 of 3)

			i ugo z							
Sample Designation	Petroleum H EPA 8015 M	ydrocarbons by lodified (mg/kg)	Total Petroleum Hydrocarbons		Carcino	genic PAHs	by EPA 83	10 (mg/kg)	)	Total PAHs by
(depth) date	Diesel Range (C12-C24)	Fuel Oil Range (C24-C36)	by Immunoassay (mg/kg)	Benzo(a)- anthracene	Benzo(a)- pyrene	Benzo(b)- fluoranthene	Benzo(k)- fluoranthene	Chrysene	Total Carcinogenic	Immunoassay (mg/kg)
FM07045T03 (4.0) 11/12/96	NA	NA	<575	NA	NA	NA	NA	NA	NA	<5.0
FM07045T04 (4.0) 11/12/96	NA	NA	<575	NA	NA	NA	NA	NA	NA	<5.0
FM07045T05 (3.5) 4/1/97	NA	NA	<115	NA	NA	NA	NA	NA	NA	<5.0
FM07046T01 (2.5) 3/20/97	NA	NA	<115	NA	NA	NA	NA	NA	NA	<5.0
FM07046T02 (2.5) 4/15/97	NA	NA	<115	NA	NA	NA	NA	NA	NA	<5.0
FM07046T03 (1.5) 4/16/97	NA	NA	<115	NA	NA	NA	NA	NA	NA	<5.0
FM07047T01 (2.0) 3/24/97	NA	NA	<575	NA	NA	NA	NA	NA	NA	<5.0
FM07047T02 (2.5) 4/15/97	NA	NA	<115	NA	NA	NA	NA -	NA	NA	<5.0
FM07047T03 (1.5) 4/16/97	NA	NA	<115	NA	NA	NA	NA	NA	NA	<5.0
FM07048T01 (2.5) 3/25/97	NA	NA	115	NA	NA	NA	NA	NA	NA.	<5.0
FM07048T02 (2.5) 4/15/97	NA	NA	<115	NA	NA	NA	NA	NA	NA	<5.0
FM07048T03 (1.5) 4/16/97	NA	NA	<115	NA	NA	NA	NA	NA	NA	<5.0
FM07049T01 (2.5) 3/25/97	NA	NA	<115	NA	NA	NA	NA	NA	NA	<5.0
FM07049T02 (2.0) 4/17/97	NA	NA	<115	NA	NA	NA	NA	NA	NA	<5.0
FM07049T03 (2.0) 4/22/97	NA	NA	<115	NA	NA	NA	NA	NA	NA	<5.0

Source: IT, 1999. Fuel Distribution System Closure Report, Presidio of San Francisco, California, Volumes 1 through 3. May. Shaded values represent exceedence of cleanup level.

#### Table 11-2 Excavation Soil Analytical Results, Section MT-7 Fuel Distribution System Removal Report

Presidio of San Francisco (Page 1 of 3)

				11 age						
Sample Designation		ydrocarbons by odified <sup>h</sup> (mg/kg <sup>e</sup> )	Total Petroleum Hydrocarbons by		Carcino	genic PAHs	by EPA 83	10 <sup>b</sup> (mg/kg	)	Total PAHs by
(depth)* date	Diesel Range (C12-C24)	Fuel Oil Range (C24-C36)	Immunoassay (mg/kg)	Benzo(a)- anthracene	Benzo(a)- pyrene	Benzo(b)- fluoranthene	Benzo(k)- fluoranthene	Chrysene	Total Carcinogenic	Immunoassay (mg/kg)
FM07043T02 (3.0) 10/16/96	NA°	NA	<115	NA	NA	NA	NA	NA	NA	<5.0
FM07043T03 (5.0) 10/22/96	NA	NA	<1,380	NA	NA	NA	NA	NA	NA	5.0
FM07044T08 (4.5) 10/22/96	NA	NA	<115	NA	NA	NA	NA	NA	NA	<5.0
FM07044T09 (5.0) 11/12/96	NA	NA	<575	NA	NA	NA	NA	NA	NA	<5.0
FM07044T11 (4.5) 11/12/96	NA	NA	<575	NA	NA	NA	NA	NA	NA	<5.0
FM07044T13 (5.0) 11/12/96	NA	NA	115	NA	NA	NA	NA	NA	NA	<5.0
FM07044T14 (6.0) 11/12/96	NA	NA	<575	NA	NA	NA	NA	NA	NA	<5.0
FM07044W01 (6.5) 2/24/97	NA	NA	<115	NA	NA	NA	NA	NA	NA	<5.0
FM07044W02 (6.5) 2/24/97	NA	NA	≈≥6,856	NA	NA	NA	NA '	NA	NA	>5.0
FM07044W03 (6.5) 2/24/97	NA	NA	>6,856	NA	NA	NA	NA	NA	NA	>5.0 %
FM07044W04 (3.5) 2/24/97	NA	NA	<139	NA	NA	NA	NA	NA	NA.	<5.0
FM07044W05 (4.0) 2/25/97	NA	NA	>1,380	NA	NA	NA	NA	NA	NA	<5.0
FM07044W06 (4.0) 2/25/97	NA	NA	<575	NA	NA -	NA	NA	NA	NA	<5.0
FM07044W07 (4.0) 2/25/97	NA	NA	<691	NA	NA	. NA	NA	NA	NA	<5.0
FM07044W08 (4.0) 2/25/97	NA	NA	>1,380	NA	NA	NA	NA	NA	NA	>5.0
FM07044W09 (3.5) 2/25/97	1,300	1,800	>1,380	<0.018	0.30	<0.018	<0.018	<0.018	0.30	≥5.0
FM07044W10 (7.0) 2/26/97	NA	NA	<115	NA	NA	NA	NA	NA	NA	<5.0

Source: IT, 1999. Fuel Distribution System Closure Report, Presidio of San Francisco, California, Volumes 1 through 3. May. Shaded values represent exceedence of cleanup level.

#### Table 11-2 Excavation Soil Analytical Results, Section MT-7 Fuel Distribution System Removal Report

#### Presidio of San Francisco (Page 3 of 3)

				11 490 0	0,0					
Sample	Petroleum Hydrocarbons by EPA 8015 Modified (mg/kg)		Total Petroleum Hydrocarbons		Total PAHs by					
Designation (depth) date	Diesel Range (C12-C24)	Fuel Oil Range (C24-C36)		Benzo(a)- anthracene	Benzo(a)- pyrene	Benzo(b)- fluoranthene	Benzo(k)- fluoranthene	Chrysene	Total Carcinogenic	Immunoassay (mg/kg)
FM07050T01 (2.5) 3/25/97	NA	NA	<115	NA	NA	NA	NA	NA	NA	<5.0
FM07050T02 (2.0) 4/17/97	NA	NA	<115	NA	NA	NA	NA	NA	NA	<5.0
FM07050T03 (2.0) 4/22/97	NA	NA	<115	NA	NA	NA	NA	NA	NA	<5.0
FM07051T02 (2.0) 4/17/97	NA	NA	<115	NA	NA	NA	NA	NA	NA	<5.0

a(depth) - Sample depth in feet below original ground surface

bU.S. Environmental Protection Agency, 1996, Test Methods for Evaluating Solid Waste, Physical/Chemical Methods, SW-846, Washington, DC.

<sup>°</sup>mg/kg - milligrams per kilogram
dPAHs - polycyclic aromatic hydrocarbons
NA - not analyzed

#### Table 11-3 Stockpile Soil Analytical Results, Section MT-7 Fuel Distribution System Removal Report

#### Presidio of San Francisco

Sample Designation	Collection Date	Total Petroleum Hydrocarbons by Immunoassay (mg/kg*)	Total PAHs <sup>b</sup> by Immunoassay (mg/kg)
FM07046S01	4/15/97	<62.5	<1.0
FM07046S02	4/16/97	<62.5	<1.0
FM07048S01	4/21/97	62.5	1.0
FM07049S01	4/21/97	<62.5	<1.0

Source: IT, 1999. Fuel Distribution System Closure Report, Presidio of San Francisco, California, Volumes 1 through 3. May. Shaded values represent exceedence of cleanup level.

amg/kg - milligrams per kilogram bPAHs - Polycyclic Aromatic Hydrocarbons

TABLE 4-1
SOIL SAMPLE RESULTS - ORGANICS PRESIDIO OF SAN FRANCISCO, BUILDING 1349
(From Montgomery Watson, January 1995)

BTEX (EP A 8240)

				DIEA	(EP A 8240)	
Soil	Depth	TPH-Extractable	Benzene	Toluene	Ethylbenzene	Xylene
		(EP A 8015 - modified)				
Boring	(bgs)	(EP A 6015 - modified)	(ug/kg)	(ug/kg)	(ug/kg)	(ug/kg)
1349SB01	1	220Ja	<5.0	<1.0	<5.0	<5.0
1349SB01	5	1.3Ja	<5.0	<1.0	<5.0	<5.0
1349SB01	10	6.5 J a	<5.0	<1.0	<5.0	<5.0
1349SB01	13	2.2 J a	<5.0	<1.0	<5.0	<5.0
1349SB02	4	240 J	<5.0	<0.50	<5.0	<5.0
1349SB02	5	7.7 J a	<5.0	<1.0	<5.0	<5.0
1349SB02	10	<1.2	< 5.0	<1.0	<5.0	<5.0
1349SB03	1	63 J a	<5.0	< 0.50	<5.0	<5.0
1349SB03	5	1.2 J a	< 5.0	< 0.50	<5.0	<5.0
1349SB03	10	<1.1	<5.0	< 0.50	<5.0	<5.0
1349SB03	15	<1.1	<5.0	< 0.50	<5.0	<5.0
1349SB03	20	<1.1	<5.0	< 0.50	<5.0	<5.0
1349SB04	1	2.3 J a	<5.0	< 0.50	<5.0	<5.0
1349SB04	4	1.8 J a	<5.0	< 0.50	<5.0	<5.0
1349SB05	1	980 J a	<5.0	< 0.50	<5.0	<5.0
1349SB05	5	9,100	<25	< 0.50	220	1,900
1349SB05	10.8	6.4	<5.0	< 0.50	<5.0	<5.0
1349SB06	1	64,000 J a	<6.2	< 0.62	<6.2	<6.2
1349SB06	5	13,000	<27	< 0.54	320	2,000
1349SB06	10	7,900	<25	< 0.50	220	1,700
1349SB06	16.5	<1.1	<5.4	< 0.54	< 5.4	<5.4
1349SB07	1	170,000 J a	<25	< 0.50	68	1,100
1349SB07	5	3,700	<25	< 0.50	90	610
1349SB07	10	2,700	<25	< 0.50	130	940
1349SB07	15	2,500	<25	< 0.50	40	310
1349SB08	1	4 J a	<6.1	< 0.61	<6.1	<6.1
1349SB08	4.5	2.7 J a	<5.8	< 0.58	<5.8	<5.8
1349SB08	10	4 J a	<6.2	< 0.62	<6.2	<6.2
1349SB08	16.5	<1.1	<5.3	< 0.53	<5.3	<5.3
1349SB09	0.5	4.6 J a	<5.5	< 0.55	<5.5	<5.5
1349SB09	2	3.4 J a	<5.5	< 0.55	<5.5	<5.5
1349SB09	5	1.5 J a	<5.3	< 0.53	<5.3	<5.3
1349SB09	10	<1.1	<5.4	< 0.54	<5.4	<5.4
1349SB09	15	<1.1	<5.5	< 0.55	<5.5	<5.5
1349SB09	20	2.4 J a	<5.5	<0.55	<5.5	<5.5
1349SB10	1	160 J a	<5.0	< 0.50	<5.0	<5.0
1349SB10	3	1.5Ja	<5.0	< 0.50	<5.0	< 5.0
1349SB10	5	1.4 J a	<5.0	< 0.50	<5.0	<5.0
1349SB10	6	1.1Ja	<5.0	< 0.50	<5.0	<5.0
1349SB10	10	2.5 J a	<5.0	<0.50	<5.0	<5.0
1349SB11	1	59,000	<31	< 0.61	280	230
1349SB11	5	1,900 -	<28	<1.1	180	1,200
1349SB11	9	2,000	<28	< 0.56	89	620

TABLE 4-1
SOIL SAMPLE RESULTS - ORGANICS PRESIDIO OF SAN FRANCISCO, BUILDING 1349
(From Montgomery Watson, January 1995)

BTEX (EP A 8240)

				BIEX (	EP A 8240)	
Soil	Depth	TPH-Extractable	Benzene	Toluene	Ethylbenzene	Xylene
	4 \	(EP A 8015 - modified)	(	(	(ua/ka)	(ug/kg)
Boring	(bgs)	10.1-	(ug/kg)	(ug/kg) <0.50	(ug/kg) <5.0	<5.0
1349SB12	1	13 J a	<5.0			8,300
1349SB12	5	4,000	<500	<0.50	620 150	1,400
1349SB12	10	5,300	<25	< 0.50	99	760
1349SB12	15	3,100	<25	< 0.50	<5.0	<5.0
1349SB12	20	2.6 J a	<5.0	<0.50		<5.8
1349SB13	1	21 J a	<5.8	<1.2	<5.8 250	210
1349SB13	5	4,300	<30	< 0.61		
1349SB13	10	1,500	<27	<0.54	72	550
1349SB14	1.5	77 J a	<6.0	<6.0	<6.0	<6.0
1349SB14	5	2.8 J a	<5.4	< 5.4	<5.4	<5.4
1349SB14	10	17 Ja	<5.4	< 5.4	<5.4	< 5.4
1349SB14	15	1.1Ja	<5.3	<5.3	<5.3	<5.3
1349SB15	1.5	19 J a	<5.8	<5.8	<5.8	<5.8
1349SB15	5	4.4 J a	<5.4	<5.4	<5.4	<5.4
1349SB15	10	2.5 J a	<5.2	<5.2	<5.2	<5.2
1349SB16	1	9.6 J a	<5.6	<5.6	<5.6	<5.6
1349SB16	5	<1.1	<5.6	<5.6	<5.6	7.3
1349SB16	10	<1.1	<5.5	<5.5	<5.5	<5.5
1349SB16	15	<1.1	<5.6	<5.6	<5.6	< 5.6
1349SB16	20	1.3 J a	<5.6	<5.6	<5.6	<5.6
1349SB17	1	16 J a	< 5.4	< 5.4	< 5.4	<5.4
1349SB17	5	2Ja	<5.6	< 5.6	<5.6	<5.6
1349SB17	10	1.9 J a	<5.5	<5.5	<5.5	<5.5
1349SB17	15	1.1Ja	< 5.4	<5.4	< 5.4	< 5.4
1349SB17	20	<1.1	<5.3	<5.3	<5.3	<5.3
1349SB18	1	9.5 J a	<5.8	<5.8	<5.8	<5.8
1349SB18	5	2.2 J a	< 5.7	< 5.7	< 5.7	< 5.7
1349SB18	10	1.3 J a	< 5.4	<5.4	<5.4	13
1349SB18	15	<1.1 J a	<5.7	< 5.7	<5.7	< 5.7
1349SB19	1	4.6 J a	<5.4	<5.4	<5.4	<5.4
1349SB19	5	1.6 J a	<5.7	<5.7	<5.7	< 5.7
1349SB19	10.5	1.4 J a	< 5.3	<5.3	<5.3	<5.3
1349SB19	15.5	1.1 Ja	<5.2	<5.2	<5.2	<5.2
1349SB20	1.5	18 J a	<5.5	<5.5	<5.5	<5.5
1349SB20	5	1.6 J a	< 5.7	< 5.7	< 5.7	< 5.7
1349SB20	10	1.3 J a	<5.7	< 5.7	< 5.7	< 5.7
1349SB20	15	1.1 Ja	<5.5	<5.5	<5.5	<5.5
1349SB20	20	1.6 J a	< 5.6	< 5.6	< 5.6	< 5.6
1349SB21	2	15,000	<570	1,100	2,600	20,000
1349SB21	5	5,400	<61	130	840	4,600
1349SB21	10	1,700 -	<55	110	240	2,000
1349SB21	15	1,400	<56	64	150	1,300
1349SB21	20	1,300	<55	<55	100	580
1349SB21	26	510	<53	<53	<53	55
1349SB21	30	370	<54	<54	<54	<54
13433DZ1	30	3/0	~54	-04	-0-4	707

a Hydrocarbon pattern in the sample appears as an unknown mixture atypical of fresh diesel fuel. Quantitation is based on a diesel reference from n-Cl0 through n-C24 only. Since these data do not have a specific standard, the detected amount is considered an estimate. J - The analyte was positively identified; the associated numerical value is the approximate concentration of the analyte in the

sample.

Table 4-2 SOIL SAMPLE RESULTS - METALS PRESIDIO OF SAN FRANCISCO, BUILDING 1349 (From Montgomery Watson, January 1995)

SOIL BORING	DEPTH							METALS						
		Arsenic (EPA 7060)	Beryllium (EPA 6010)	Cadmium (EPA 6010)	Chromium (EPA6OIO)	Copper (EPA 6010)	Iron (EPA 6010)	Lead (EPA 6010)	Manganese (EPA 6010)	Mercury (EPA 7471)	Nickel (EPA 6010)	Selenium (EPA 7740)	Vanadium (EPA 6010)	Zinc (EPA 6010
	(bgs)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)	(mg/kg)	(mglkg)	(mg/kg)	(mg/kg)	(mg/kg)	(mglkg)
1349SB01	1	2.7	0.68	< 0.57	86.6	33.1	35,500	22.8	871	< 0.11	74.4	<1.0	77.4	47.4
	5	4.3	0.94	< 0.55	64.4	141	42,700	23.2	612	<o.11< td=""><td>88.2</td><td>&lt;1.0</td><td>50.2</td><td>212</td></o.11<>	88.2	<1.0	50.2	212
	10	4.2	0.65	< 0.54	35.7	74.2	40,500	18.4	483	< 0.11	81.8	<1.0	46.2	113
	13	6.1	0.54	<0.54	55	71	38,800	18.9	331	<0.11	104	<1.0	50.5	158
1349SB02	4	3	0.48	< 0.57	110	22.8	31,600	12.3	402	<0.11	89.8	<0.50	85.5	37
	5 10	2.4 5.7	0.27 2	<0.55 <0.58	91.2 45.6	15.7 84.3	26,300 37,300	8.6 21.2	279 389	<0.11	62.7 96.9	<1.0 <1.0	66.7 49.3	31.3 135
1349SB03	10	3.9	<0.21	<0.51	108	26.9	20,500	34.4	409	<0.10	127	< 0.50	41.8	74.1
15493005	5	3	0.36	< 0.56	116	17.4	31,200	14.9	808	< 0.11	99	< 0.50	82.5	35.4
	10	6.2	1.5	< 0.57	44.3	72	37,200	21.6	196	<o.11< td=""><td>84.5</td><td>&lt; 0.50</td><td>68.5</td><td>113</td></o.11<>	84.5	< 0.50	68.5	113
	15	13.4	0.82	0.63	34.7	74.9	47,400	39.9	2,390	< 0.11	163	< 0.50	58.2	137
	20	8.1	0.56	< 0.54	45.2	76.1	47,200	23.3	526	<o.11< td=""><td>125</td><td>&lt; 0.50</td><td>42.6</td><td>135</td></o.11<>	125	< 0.50	42.6	135
1349SB04	1	2.7	0.42	< 0.56	120	44	28,800	12.3	611	<o.11< td=""><td>100</td><td>&lt; 0.50</td><td>72.5</td><td>68</td></o.11<>	100	< 0.50	72.5	68
	4	5.6	1.4	< 0.55	45.6	146	37,100	11.6	238	< 0.11	53.3	< 0.50	47.7	191
1349SB05	1	4	0.39	< 0.55	116	15.4	32,400	11.4	496	<0.11	74	<0.50	82.4	86.9
	5	6.4	1.2	< 0.54	26.9	31.9	26,500	17.6	88.6	<0.11	41.3	< 0.50	36.7	42.3
	10.8	9.7	1.8	<0.56	35	59.2	26,000	20.3	133	<o.ll< td=""><td>37.7</td><td>&lt; 0.50</td><td>41.5</td><td>62.7</td></o.ll<>	37.7	< 0.50	41.5	62.7
1349SB06	1	4.5 J	<0.25	< 0.62	77	14.4	26,700	17.3	287	< 0.12	42.2	< 0.62	66.9	49.3
	5	3.5	0.65	< 0.54	27.4	38.2	20,000	11.4	131	<0.11	31.7	<0.54	30.5	57.9
	10	1.1	0.35	< 0.50	44.7	22.8	15,600	7.6	65.2	<0.10	27.9 73.8	< 0.50	27.9 59.3	66.1 129
12400007	16.5	6.4 2.9	<0.23	< 0.54	36.5 57.1	53.1 7.1	35,100	17.1 36.7	535 134	<0.11	34	<0.54	32.1	50.8
1349SB07	5	2.7	1.1	<0.57 <0.54	33.9	54.6	14,900 33,100	13	195	<0.11	55.2	<0.50	42.8	82.8
	10	1.8	1.6	<0.53	31.8	33.4	30,000	13.6	262	<0.11	48.8	<0.50	48	87.9
	15	5.6	0.89	< 0.53	32.4	38.8	30,400	19.9	387	< 0.11	65.4	< 0.50	46.7	81.8
1349SB08	1	3.9	0.24	<0.61	56.4	12.5	20,100	11	377	< 0.12	41.9	< 0.61	50.8	37.4
	4.5	3.8	< 0.23	< 0.58	86.3	8.4	24,400	10.1	377	< 0.12	74.6	< 0.58	64.1	27.7
	10	< 0.62	0.44	< 0.62	113	33.1	13,000	17.9	17.3	0.9	55.7	< 0.62	30.2	72.2
	16.5	4.6	1.4	< 0.53	54.1	45.5	28,400	18	220	< 0.11	46.6	< 0.53	62.9	73.7
13498B09	0.5	3	0.34	< 0.55	87.9	50.8	29,200	126	995	< 0.11	110	< 0.55	66.7	71.9
	2	3.6	0.41	< 0.55	84.3	20.1	27,800	11.6	647	< 0.11	60.4	< 0.55	71.3	44.9
	5	3.1	0.21	< 0.53	98.6	13	26,100	13.6	145	< 0.11	48.8	< 0.53	75.6	28.7
	10	3	0.6	< 0.54	78.2	57.6	47,500	12.5	260	< 0.11	43.3	< 0.54	130	91.5
	15	2.4	1.9	< 0.55	57.4	55	42,300	7.8	516	< 0.11	69.3	< 0.55	81.9	90.6
101007710	20	10.6	1.8	<0.55	45	67.8	33,300	25.9	821	<0.11	111	< 0.55	53	103
1349SB10	1	4	0.43	< 0.56	92.2	23.7	31,100	12.1	1,020	<0.11	94,3 J	<0.50	75.8 62.1	61.8
	3 5	3 2.9	0.23 <0.22	<0.55 <0.56	80.1 90.9	14.1 14	24,600	8.2 15.7	398 361	<0.11	66.1 67.8	<0.50	66.3	33
	6	3	0.22	< 0.55	90.9	12.1	26,000 28,800	8.5	338	<0.11	65.3	< 0.50	79:03:00	33.9
	10	7	2.1	< 0.62	82.1	75.9	58,800	29.6	240	< 0.11	124	< 0.50	IIS	121
1349SB11	1	3.2	<0.25	<0.61	76.9	15.8	23,900	12.2	209	<0.12	39.6	<0.61	63.5	96.5
	5	4.5	1.2	<0.55	24.6	27.6	15,500	9	125	<0.11	28.2	<1.1	27.5	38.9
	9	9.3	1.4	< 0.56	29.9	49.7	29,500	27	201	<0. II	40.7	< 0.56	38.2	67.6
13498B12	1	4.3	0.47	< 0.57	96.4	17.9	31,900	15.4	438	< 0.11	65.5	<0.50	75.8	55.3
	5	4.2	1.4	< 0.55	36.4	36.9	29,600	13.8	140	< 0.11	42.3	< 0.50	46.7	58
	10	9.5	2.3	0.58	48.2	83	44,700	23.1	330	< 0.11	62.1	< 0.50	52.7	74.5
	15	12.6	1.6	< 0.57	40.4	87.1	47,200	33.3	465	< 0.11	92.8	< 0.50	61.6	139
	20	3.1	0.68	< 0.59	117	55	34,100	19.5	469	< 0.12	89,6	<0.50	60.2	145
1349SB13	1	2.9	<0.23	<0.58	87	12.4	23,300	10.1	301	<0.12	49.2	<1.2	66	30.8
	5	17.3	1.7	<0.61	45	73.1	46,900	26.9	193	0.95	60.6	< 0.61	95	87.9
	10	8.1	1.7	< 0.54	25.1	47.7	22,500	21.3	235	<0.11	38.2	< 0.54	37.1	66.4

Highlighted samples have subsequently been removed during excavation of TPH impacted soils.

#### TABLE 4-3 STATISTICAL SUMMARY OF SOIL RESULTS PRESIDIO OF SAN FRANCISCO, BUILDING 1349

(From Montgomery Watson, January, 1995)

			S	ample Stat	istics			Quartile	Means <sup>a</sup>	
	No. of Positive				Std.					== 4000/
	Samples	Minimum	Maximum	Average	Deviation	Skewness	0-25%	25-50%	50-75%	75-100%
Arsenic	50	<0.62	17.3	5.1	3	1.8	4.8	5.2	4.7	5.8
Chromium	51	24.6	120	65.7	30	OJ	70	74	72	45
Copper	51	7.1	146	44	31	1.3	52	55	30	41
Iron	51	13 ,000	58,000	31,437	9,703	0.5	35,900	31,685	28,123	29,925
Lead	50 <sup>b</sup>	7.6	39.9	18	8	1	18	17	17	19
Manganese	51	17.3	2,390	414	365	3.4	551	441	438	208
Nickel	51	27.9	163	70	30	0.9	81	80	68	48
Vanadium	51	27.5	130	60	21	0.9	70	59	60	50
Zoic	51	27.7	212	80	43	1.1	86	94	62	74
TPHc	44	<1	170,000	6,976	28,130	5	<1.1	3.5	740	28,842
Ethylbenzene	15	<5	620	55	146	1.9d	<5.1	<5.3	670	1,741
Xylenes	15	<5	8,300	428	1,981	3.3d	<5.1	<5.3	95	222

#### Notes:

- a Quartile means shown for metals are the average metal concenttations corresponding to the TPH quartiles.
- b Maximum concentration detected, 126 mg/kg, was not included in the calculation as explained in the text.
- C When TPH-Diesel is non-detect, TPH-Unknown is used in the calculation.
- d Skewness for ethylbenzene and xylenes would be 2.8 and 5.0, respectively if ND values were included.

TABLE 4.4
GRAB GROUNDWATER SAMPLE RESULTS PRESIDIO OF SAN FRANCISCO, BUILDING 1349
(From Montgomery Watson, January 1995)

Sample ID	1349SB09	1349SB19
Depth where groundwater was encountered <sup>a</sup>	34 feet bgs	39.5 feet bgs
Organics (ug/l)		
TPH -Extractable	110 <sup>b</sup> J	110,000
Benzene	<0.5	<5
Toluene	<0.5	<5
Ethylbenzene	<0.5	<5
Xylenes	<0.5	50
Arsenic	<0.005	NA°
Metals (mg/l)		
Beryllium	<0.002	NA
Cadmium	<0.001	NA
Chromium	1.6	NA
Copper	0.012	NA
Iron	31.1	NA
Lead	< 0.0032	NA
Manganese	3.8	NA
Mercury	<0.0002	NA
Nickel	3.4	NA
Selenium	<0.005	NA
Vanadium	0.03	NA
Zinc	0.066	NA

#### Notes:

- a Depth at which groundwater was encountered may not be the same as the groundwater table since recharge rates at the two soil borings were unknown. b The hydrocarbon pattern of this sample represents an unknown mixture of fuel atypical of fresh diesel fuel. Quantitation is based ona diesel reference from n-Cl0 through n-24 only. Since these data do not have a specific standard, the detected amount is considered an estimate
- c Not analyzed.
- J The analyte was positively identified; the associated numerical value is the approximate concentration of the analyte in the sample.

TABLE 3.3
SOIL SAMPLE ANALYTICAL RESULTS - TPH.EXTRACTABLE (TPH-E)
BUILDING 1349 ASI

(From Montgomery Watson, May 1996)

Soil	Depth	TPH-E	Soil	Depth	TPH-E
Boring	(ft bgs)	(mg/kg)	Boring	(ft bgs)	(m/kg)
1240CD22	5	2.5	1240CD26	5	12
1349SB23		3.5	1349SB26		13
	10	3.3		10	3.8
	15	1.9		15	1.7
	20	<1.1		20	<1.2
	25	<1.1		25	1.3
	30	<1.1		30	1.5
	35	<1		34	<1
	40	28		40	1.8
	45	27		45	58
	50	49	10.100.000	50	<1.2
10100001	58	16	1349SB28	5	7.1
1349SB24	5	93		10	<1.2
	10	<1.1		15	<1.1
	15	<1.1		20	<1.1
	20	<1.1		25	<1.1
	25	<1.1		30	<1.1
	30	<1.1		35	2.5
	35	<1.1		40	1.6
	40	<1.1		45	18
	45	<1.1		50	120
	50	4.1	1349SB29	5	3.6
1349SB25	0	6		10	1.2
	5	7.7		15	<2
	10	1.8		20	<1.2
	15	<1		25	<1.2
	20	<1.1		30	<1.1
	25	<1.1		35	<1.2
	30	<1		40	<1.2
2	35	330		45	<1.1
	40	990	1349SB30	5	2.2
	45	880		10	<1.3
	50	2.5		15	1.8
100				20	<1.1
				25	<1.1
				30	<1.1
				35	<1.1

#### Notes:

TPH-E quantified as diesel using USEPA Method 8015 Modified

ft bgs - feet below ground surface

mglkg - milligrams per kilogram

**TABLE 3-5** 

#### GROUNDWATER GRAB SAMPLE ANALYTICAL RESULTS - BTEX AND TPH-E

#### **BUILDING 1349 ASI**

(From Montgomery Watson, May 1996)

	Benzene	Toluene	Ethylbenzene	Total Xylenes	TPH-E
Boring	(ug/L)	(ug/L)	(ug/L)	(ug/L)	(ug/L)
1349SB22	<0.5	<0.5	<0.5	<0.5	1,300
1349SB23	<0.5	<0.5	<0.5	<0.5	<50
1349SB24	<0.5	<0.5	<0.5	<0.5	<50
1349SB25	<0.5	<0.5	2.9	12	24,000
1349SB26	<0.5	<0.5	<0.5	<0.5	<50
1349SB27	<0.5	<0.5	<0.5	1.1	4.7
1349SB28	<0.5	<0.5	<0.5	<0.5	<50
1349SB29	<0.5	<0.5	<0.5	<0.5	<50
1349SB30	<0.5	<0.5	<0.5	<0.5	<50
Phase 1 Investigation					
(August 1993)	-0.5	.0.5	-0.5	-0.5	440
1349SB09	<0.5	<0.5	<0.5	<0.5	110
Phase 2 Investigation (February 1994)					
1349SB19	<0.5	<0.5	<0.5	50	110

#### Notes:

BTEX - Benzene. toluene. ethylbenzene. xylenes using USEPA Method 8020 ug/L - micrograms per liter

TPH-E - Total petroleum hydrocarbons-extractable quantified as diesel u

### Appendix D

# Evaluation of OCP Properties and Occurrence



### Appendix D. Evaluation of OCP Properties and Occurrence

As discussed in Section 2 of this Building 1349 Study Area Corrective Action Plan (CAP), organochlorine pesticides (OCPs) have been consistently detected at relatively low (and often laboratory-qualified as estimated) concentrations at one monitoring well, 1349MW100. The following subsections discuss typical uses, physical and chemical properties of OCPs, and their relation to the observed concentrations at the Study Area.

#### D.1 Physical and Chemical Properties and Mobility of OCPs

OCPs historically were developed to effectively control animal or insect pests and are highly toxic. The use of many OCPs in the United States has been generally discontinued since the early 1970s with the exception a few such as aldrin, dieldrin, chlordane, and endrin which were used for limited and specific use until the mid-to late-1980s. OCPs were designed to be applied to the general ground surface, either spread as a granular solid or by a liquid carrying agent, where it would remain for long periods of time. To achieve this goal, OCPs were designed to be relatively insoluble and nonvolatile, and have a strong affinity for organic carbon. Thus, OCPs have a tendency to be very stable in the environment and do not migrate in groundwater for significant distances under normal transport mechanisms.

The properties of the OCPs which directly affect their fate in the environment include:

- Water Solubility  $(S_w)$ :  $S_w$  is the saturated concentration of the compound in water at a given temperature and pressure. Compounds with high  $S_w$  tend to desorb from soil and sediment, are less likely to volatilize from water, and are susceptible to biodegradation.
- Henry's Law Constant (K<sub>H</sub>): K<sub>H</sub> is the ratio of the partial pressure of a compound in air to the concentration of the compound in water at a given temperature under equilibrium conditions. K<sub>H</sub> indicates the relative volatility of the constituent.
- Soil partition coefficient (K<sub>OC</sub>): K<sub>OC</sub> is the ratio of the adsorbed chemical per unit weight of organic carbon to the aqueous solute concentration. This indicates the tendency of a constituent to bind to particles containing organic carbon. Thus, constituents with a higher K<sub>OC</sub> will also tend to move more slowly than groundwater flow as dissolved constituents will sorb onto aquifer materials. High K<sub>OC</sub> of OCP constituents turns them toward sorbing to aquifer materials.

The following table summarizes the physico-chemical properties of OCPs (Montgomery Watson, 1991). The physico-chemical properties of benzene, another more mobile Study Area chemical of concern (COC), is also included for comparison.

Constituent	S <sub>W</sub> (mg/L)	K <sub>H</sub> (atm-	Koc
		m <sup>3</sup> /mol)	
Alpha-BHC	1.63	$5.3 \times 10^{-6}$	1,901
Beta-BHC	0.24	$2.3 \times 10^{-7}$	3,573
Gamma-BHC	21.3	$2.5 \times 10^{-7}$	1,901
Chlordane	0.056	$4.8 \times 10^{-5}$	371,535
DDD	0.09	2.2 x 10 <sup>-5</sup>	239,883
Dieldrin	0.2	5.8 x 10 <sup>-7</sup>	35,481

Constituent	S <sub>W</sub> (mg/L)	K <sub>H</sub> (atm- m <sup>3</sup> /mol)	Koc
Benzene	1,780	$5.5 \times 10^{-3}$	100

As a group, the OCP constituents exhibit very low  $S_W$  and  $K_H$ . They also have very high  $K_{OC}$ . Thus the behavior of the OCP constituents would be described by their strong preference for being sorbed to aquifer materials and by very slow and limited migration in the dissolved phase. Relatively speaking, benzene would be more preferably associated with the dissolved phase and would volatilize more readily. In the environment, OCPs would only be expected to occur in groundwater in the immediate vicinity of a source.

Another potential mechanism for OCP migration in groundwater is colloidal transport. However, prior studies completed at the Presidio indicate a general absence of OCPs sorbed to colloids or suspended solids in groundwater at the Study Area. As part of a separate study, split groundwater samples were collected from monitoring well 1349MW100. One sample was directly analyzed as collected while a duplicate was subjected to centrifugation to reduce the amount of suspended solids and colloids in the sample (BBL, 2004). The samples from well 1349MW100 were analyzed for OCPs as well as other parameters. The results of the analyses indicate that the concentrations of OCPs that were detected in the normal sample aliquot were generally marginally reduced in the centrifuged aliquot. The absence of significant reduction in concentration of OCPs in the centriguged aliquot indicates that OCPs were not sorbed to suspended solids or colloids.

#### D.2 Data Quality and Occurrence of OCPs at the Study Area

The following subsections discuss analytical data quality issues that may affect observed OCP data at the Study Area as well as possible scenarios for the occurrence of OCPs at the Study Area.

#### **Analytical Data Quality Summary for OCPS at Study Area**

OCPs are quantified using U.S. Environmental Protection Agency (USEPA) SW-846 Method 8081A, which is a dual-column gas chromatography method. Sample extracts are analyzed in both columns and the more conservative (i.e., higher) result from the two columns is the laboratory reported concentration. By method, a relative percent difference (RPD) of less than or equal to 40% is acceptable and the higher result is reported. The laboratory reporting limits (RLs) for OCPs are relatively low. The following summarizes cleanup levels and laboratory RLs for OCPs detected at the Study Area:

Constituent	Cleanup Level	Reporting Limit [µg/L]
	[µg/L]	
δ-ВНС	0.3	0.05
DDD	0.15	0.01
DDE	0.10	0.01
DDT	010	0.01
Aldrin	0.05	0.05
Chlordane	0.1	0.05
Dieldrin	0.5	0.05
Endrin	2	0.01
γ-BHC (Lindane)	0.2	0.05
Heptachlor	0.01	0.025

Study Area cleanup levels are discussed in Section 3.2.

It should be noted that nearly all detections of OCPs in well 1349MW100 were laboratory qualified. The majority of the laboratory qualifications were either "C"-, "J+"- or "J-"- qualified (or combinations thereof). The descriptions of commonly observed laboratory qualifications are as follows:

- J The analyte was positively identified; the associated numerical value is biased low due to a low surrogate recovery and should be considered an approximate concentration of the analyte in the sample. Data were qualified if the continuing calibration samples had two compounds with percent differences less than -15%.
- J+ The analyte was positively identified; the associated numerical value is biased high due to a high surrogate recovery and should be considered an approximate concentration of the analyte in the sample. Data were qualified if the continuing calibration samples had two compounds with percent differences less than +15%.
- C Presence confirmed, but confirmation concentration differed by more than a factor of two.
- J The analyte was positively identified; the associated numerical value is an approximate concentration of the analyte in the sample.
- U The analyte was analyzed for, but was not detected above the reported sample quantitation limit.

Of particular significance are the numerous C-qualified data observed. C-qualified data indicate that the results of the dual-column analysis varied by more than two times (100%) and, by method, the highest concentration is reported. Therefore, the lower observed column concentration was at least half of that reported. In many cases, C-qualified data had reported concentrations in excess of the appropriate cleanup levels for the Study Area. In reality, the actual concentration of a C-qualified OCP may have been lower than that reported.

Some data quality issues observed in laboratory analysis may also be related to interferences associated with high turbidity in submitted groundwater samples. As noted in Section 2, the specific yield of a majority of Study Area wells is very low. This is true at well 1349MW100. A review of field sampling logs indicates that during the seven quarterly sampling events, well 1349MW100 was dewatered during purging and sampling at least three times. On several occasions following purging, the well was left for an extended period of time to allow groundwater to recharge the well so that sufficient sample volume could be collected (Treadwell & Rollo, 2004). During the sampling events that required the well to recharge after dewatering, recharge took between approximately six hours to approximately 18 hours. In two of these cases, groundwater samples were collected the day after initial well purging began. Consequently, observed turbidity in the collected sample was sometimes relatively high (noted to be greater than >1000 NTU). Even during sampling events that took less than an hour to purge and sample, observed turbidity of samples was noted to be as high as 786 NTU.

#### **Summary of Possible Occurrence of Organochlorine Pesticides**

As described below, the occurrence of OCPs in Study Area monitoring well 1349MW100 is inconsistent with water quality observed in other Study Area wells. While OCPs have been detected in four other wells located generally to the west of 1349MW100, those detections were not repeatable and were laboratory qualified concentrations slightly above their detection limits. No known uses of OCPs at the Study Area were documented in previous SI reports or from general knowledge of Study Area or general Presidio activities. Presidio-wide OCP occurrences in soil and groundwater data were also evaluated, particularly for the Directorate of Engineering and Housing (DEH) Study Area (Dames & Moore, 1997; MACTEC, 2003; and Treadwell & Rollo, 2004). The DEH Study Area included a main Presidio Facility for mixing, cutting, and storing pesticides for general Presidio-wide application purposes. Relatively high concentrations of various

OCPs were detected in shallow soils (<2 feet deep) at the DEH Study Area. Despite known shallow soil sources, only one OCP, dieldrin, was detected once at a concentration of 0.04 micorgrams per liter ( $\mu$ g/L) at one DEH Study Area well in 1992.

In consideration of the above factors, several possible scenarios were developed for the occurrence of OCPs observed in well 1349MW100. The following summarizes some possible sources for the OCPs observed in well 1349MW100:

Possible Source of OCP at Study Area	Discussion of Viability of Source Model
General application of pesticides on ground surface at the Study Area.	OCPs are consistently observed at well 1349MW100. Additionally, one non-repeatable detection of an OCP in each of four wells located generally to the west of well 1349MW100 in Former Fill Site 5 (wells 1349MW101, 1349MW102, 1349MW03R and LF5GW104) have been documented (Treadwell & Rollo, 2004). If general application of OCPs in the Study Area occurred, more wide-spread and persistent detections would be expected. Therefore, this possible source is unlikely.
Undocumented "cutting" or mixing of the pesticides with diesel from the former dispenser area of the Study Area at the eastern edge of Washington Boulevard.	There were two known areas in the DEH Study Area that were used for pesticide mixing, cutting, and storage. Building 269 in the DEH Study Area was constructed for storing and mixing of pesticides used at the Presidio. Although plausible, there has been no documentation or direct evidence that mixing, cutting, or storage of pesticides occurred at the Study Area.
Elevated concentrations of OCPs in fill material used in former Area 2 and Area 3 corrective action excavations.	Fill material used for former Area 2 and Area 3 is described as controlled density fill and clean sand. Soil samples for OCP analysis have never been collected at the Study Area, including no samples of the fill material. OCPs may have been introduced from the fill material to the deeper portions of the well 1349MW100 borehole during drilling. Migration of OCPs from overlying fill material to the underlying aquifer is unlikely given physico-chemical properties.
Drilling Activities: Inadvertent introduction to the monitoring well borehole from improperly decontaminated drilling equipment.	Drilling equipment used during the advancement of the well 1349MW100 borehole may not have been effectively decontaminated prior to use. OCPs may have been introduced into the borehole from another non-Presidio site. Review of field notes from well drilling activities, however, indicate that all drilling

Possible Source of OCP at Study Area	Discussion of Viability of Source Model
	equipment and well materials were properly
	decontaminated. Therefore, potential cross-
	contamination from another site is unlikely.

Because OCPs were not considered as a potential chemical of concern for Site Investigation (SI) purposes, no associated soil samples have historically been analyzed for OCPs at the Study Area. Furthermore, as part of the excavation activities at the telecommunications conduit to remove the petroleum-impacted soil, the soil column above and in the vicinity of well 1349MW100 was removed to a maximum depth of 12 feet below ground surface (bgs) during the 1995 Army Corrective Action (IT, 1996). The excavations resulting from this 1995 Corrective Action have been subsequently been backfilled with controlled density fill and clean sand fill. Therefore, investigation in the vicinity of well 1349MW100 to determine if a current OCP soil source exists is not possible.

Although there are several potential scenarios that could explain the occurrence of OCPs at well 1349MW100, there is no clear evidence for any of them and all are based on speculation. Lacking conclusive evidence for any particular source scenario, the occurrence of OCPs at well 1349MW100 is not clearly related to any previous Building 1349 operational activities. As discussed above, potentially impacted soils in the vicinity of well 1349MW100 were excavated during the 1995 Army Corrective Action. A strategy to further evaluate the occurrence of OCPs and potential corrective actions is discussed in Sections 4 and 5 of this CAP.

### Appendix E

# Occurrence of Dissolved Metals in Groundwater



### Appendix E. Evaluation of Dissolved Metals Occurrence

As discussed in Section 2 of the CAP, arsenic (As), chromium (Cr), and nickel (Ni), have been detected in certain Building 1349 Study Area (Study Area) monitoring wells at concentrations that slightly exceed the respective groundwater cleanup levels for these constituents. Concentrations and distributions of these and other trace elements analyzed in groundwater samples likely reflect variations in overall hydrogeologic and geochemical conditions in the vicinity of the monitoring wells.

Localized geochemical variations and resulting variations in concentrations of metals in groundwater indicate some influence from past Study Area activities, as well as natural variability. In particular, elevated concentrations of iron and slight elevations of As in well 1349MW100 reflect the development of anoxic conditions, due to readily degradable organic compounds associated with releases of diesel or fuel oil.

Concentrations of trace elements, including As, Cr, and Ni, in groundwater result from a variety of geochemical and hydrogeologic processes and conditions. Often of fundamental importance are the concentrations of these constituents in the aquifer solids, since groundwater reactions with aquifer solids influence or ultimately determine what aqueous metal concentrations are observed. Table E-1 presents a comparison of minor and trace elemental compositions of various rock types and sediments from Presidio-wide background metals studies (EKI, 2002), with concentrations detected in soil samples collected at the Study Area. Constituent concentration data presented in Table E-1 are derived from results from soil boring samples 1349SB1 through 1349SB11. It is apparent from this table that concentrations and relative proportions of these constituents detected in soil samples near Building 1349 are comparable to background metals data from the Presidio, and are therefore unlikely to reflect enrichment from anthropogenic activities. This is further substantiated by the discussion of the nature and extent of metals observed in Study Area soils in Section 2.5.1 of the CAP. It should be noted that Presidio background metals data is only available for the four major geologic units that occur at the Presidio. Background metals characterization has not been performed for the secondary geologic units that occur at the Study Area, such as the Sheared Rock Unit and the Jurassic/Cretaceous Sedimentary Rock Unit. As such, Study Area metals data may be representative of these secondary geologic units

It is also important to consider the relative magnitude of soil and aqueous phase concentrations typically occurring in groundwater environments and in particular those detected at the Study Area. For example, average As concentrations reported for soil samples from the Study Area are approximately 5 milligrams per kilogram (mg/kg), compared to average detected aqueous As concentrations of approximately 7 micrograms per liter (µg/L). At these concentrations, assuming a porosity of 0.3 for the aquifer, there are >4,000 times more As atoms associated with solid phases compared to As atoms in solution. At lower porosities typical of unweathered fractured bedrock, there would be even more solid-phase metal atoms than in the aqueous phase. Consequently, transfer of a relatively minor amount (for example less than 0.1%) of As from the solid to aqueous phase, in response to an even a minor change in geochemical conditions (e.g. pH, temperature, Eh, ionic strength), can result in a dramatic increase in dissolved As concentrations. This phenomenon, wherein there are many orders of magnitude more solid-phase than aqueous-phase atoms and whereby slight geochemical variations can cause dramatic changes in aqueous concentrations in space and time, also applies to other metals including Fe, Cr, and Ni, in addition to As.

Concentrations of trace elements in groundwater and other near surface environments are controlled largely by reactions occurring at the surfaces of crystalline minerals and amorphous solid phases. The term "partitioning" is frequently used to describe the process by which constituents become distributed between aqueous and solid phases. Partitioning is more of a general term describing a complicated set of geochemical processes that

involve numerous variables that influence the element distributions between aqueous and solid phases. Some of the important variables include: pH; redox conditions; ionic strength; the nature and abundance of ions and neutral species that compete for different sorption sites on various solid phases; and the surface area of and the amount of sorption sites on the solid phases.

Dissolved concentrations of As detected above the cleanup level of  $10~\mu g/L$  may be a concern because of the toxicity of some chemical forms of As at relatively low concentrations. As occurs primarily in groundwater as an oxyanion, either as the pentavalent (V) arsenate ion  $(H_n AsO_4^{3-n})$  and/or the trivalent (III) arsenite ion  $(H_n AsO_3^{3-n})$ . The predominance of either arsenate or arsenite species is usually a function of the redox conditions of the aqueous environment, with arsenate dominant within aerobic, oxidizing conditions, and arsenite dominant in anaerobic, reducing conditions. Significant arsenate and arsenite concentrations may exist in either oxidizing or reducing conditions, however, possibly due to slow rates of redox transformations.

Arsenate is generally considered to be less mobile in groundwater environments, which is attributed to strong adsorption on aquifer solids, particularly iron and manganese oxyhydroxides. Although arsenite is also adsorbed on aquifer solids, it has been shown to be relatively more mobile than arsenate. The increased mobility of arsenite probably reflects a combination of its predominance over arsenate under reducing conditions, combined with less iron oxhydroxides due to reduction of iron. Arsenite's enhanced mobility is frequently of concern because it is known to be more toxic than other forms of As. However, if reducing conditions are significantly strong and sulfide ion is present, then solid phase As sulfide species may form at the low temperatures characteristic of most groundwater environments, resulting in lower aqueous As.

Figures E-1, E-2, and E-3 illustrate how sensitive the dissolved (aqueous) concentrations of a trace element like As can be to variations in important geochemical variables. Figures E-1 and E-2 describe As partitioning between solid and aqueous phases as a function of pH under oxic and reducing conditions, respectively. Figure E-3 compares how aqueous As concentrations vary with pH depending on whether oxic or reducing conditions exist within groundwater.

Figure E-1 illustrates how As partitions between the aqueous and solid phase (via sorption reactions) in an oxygenated system, while Figure E-2 applies for reducing conditions. Note that the total amount of As in the system does not change as pH varies. The total amount of As in the system is assumed to be about 1 milligrams per liter (mg/L). By comparison, at the average soil As concentration measured at the Study Area of 5 mg/kg and a porosity of about 0.3, there would be about 30 mg/L total As (solids and aqueous). This lower total As value is more appropriate for the partitioning example because all of the solid-phase As would not be available for surface exchange processes.

Identified on the X-axis of Figure E-1 are the average pH values measured for 1349MW100 (about 6.5) and 1349MW105 (about 7.4). Note that the aqueous As concentration is about 10 times higher due to the increased pH under the conditions simulated. This observation suggests that the slightly elevated dissolved As concentration at 1349MW105 may reflect influence from the relatively high pH at this location, although variations in other geochemical concentrations and conditions undoubtedly influence it as well. Factors contributing to the As concentrations reported, in addition to pH, may include: solid-phase As concentrations; sorption characteristics of the solid phases (surface area, type, and concentrations of surface-exchange sites); ionic strength; type and concentrations of other aqueous phases, which may compete with As for sorption sites; redox conditions; temperature; and of course, uncertainties associated with field sampling and laboratory analytical methods.

Figure E-3 presents a comparison of predicted dissolved As concentrations versus pH for oxic and reducing conditions. It is clear from this Figure that reducing conditions result in enhanced concentrations of dissolved

As throughout the entire pH range considered as compared with oxic conditions. Such geochemical behavior is consistent with the slightly elevated As concentrations observed repeatedly at 1349MW100. Reducing conditions near this location are indicated by:

- 1) the high dissolved iron concentrations (from 10 to more than 100 times higher than adjacent wells); and
- 2) low sulfate concentration, indicative of sulfate reduction, which occurs only after complete elimination of dissolved oxygen.

Enhanced aqueous iron concentrations favor desorption of As and higher aqueous As concentrations, due to a combination of: lower solid Fe oxides/hydroxides; preferential sorption of dissolved ferrous iron compared to As; and the observation that reduced As (arsenite) adsorbs less strongly than arsenate. Furthermore, field and laboratory studies have indicated that elevated alkalinity promotes higher aqueous As concentrations, due to preferential sorption of carbonate ions. Elevated alkalinity, which is typically a product of sulfate reduction, is apparent in the data for 1349MW100.

Although Figure E-3 illustrates that aqueous As concentrations may be enhanced in groundwater under reducing compared to oxic conditions, Figure E-2 shows how proportionally more As still adsorbs to solid phases compared to As in solution (except at pH>10). Such behavior has important implications for the fate and transport of As in groundwater because adsorption processes retard As migration in groundwater and serve to reduce aqueous As concentrations at downgradient locations.

As geochemistry is discussed in detail because the highest As concentrations are detected slightly in excess of the groundwater cleanup level at monitoring well 1349MW105, located proximate to petroleum hydrocarbon impacts associated with Building 1349. Most of the processes and types of geochemical reactions that influence As geochemistry and the distribution and concentration of As in groundwater discussed above apply for the other metals of concern at the Study Area, including Ni and Cr. Applicability of As geochemistry to metals like Ni and Cr arises from the fact that the same *types* of geochemical reactions and processes influence their groundwater concentrations, although specifics of the reactions may differ. It is true that groundwater Cr concentrations may differ in response to redox conditions and that Cr behavior may appear to be opposite that of As. However, groundwater Cr (and Ni) concentrations will still result from:

- 1) hydrogeochemical processes occurring between aqueous and solid phases, that are controlled largely by
- 2) surface chemical reactions, which vary greatly depending on specific and general geochemical conditions. Surface partitioning reactions in turn are dependent upon
- 3) the "natural", and if applicable, anthropogenic-influenced composition of solid phases and/or hydraulically upgradient groundwater.

All in all, the variation in aqueous concentrations of these metals from one well to another is to be expected given the range of variability in individual constituent concentrations and overall geochemical conditions. In fact, it is probably more remarkable that the concentrations do not show greater variation, considering the numerous variables that effect the concentrations and distributions of these elements.

Geochemical properties of elements like As and trace metals such as Ni and Cr contribute to the fate and transport of constituents in groundwater. It is important to consider how the geochemical behavior influences the migration and concentrations of constituents from source areas of impacted groundwater.

To evaluate potential migration of As from the Study Area, specifically the area of well 1349MW100, solute transport modeling was performed using WinTran<sup>©</sup>, an analytical elemental groundwater modeling program

(ESI, 1995). For the model simulations, it was assumed that a constant source of As, with a concentration of 20  $\mu$ g/L, exists at 1349MW100. This assumed source concentration is greater than the average value of approximately 13  $\mu$ g/L detected in groundwater samples collected historically from this well. Groundwater was assumed to migrate toward 1349MW03R, which is located approximately 150 feet hydraulically downgradient. A hydraulic gradient of approximately 0.0067 was assumed, which is based on hydraulic head data provided in Figure 2-3.

A horizontal hydraulic conductivity (Kh) value of 4.4 feet per day (ft/d) was assumed in the model. This corresponds to the highest Kh estimated from specific capacity data collected during purging of monitoring wells, despite an estimated Kh of approximately 0.7 ft/d apparent for 1349MW100. The highest Kh value was applied to develop a likely worst-case modeling scenario with respect to groundwater migration. Longitudinal and tranverse dispersivity values of 10 feet and 1 foot, respectively, are assumed.

The model input applicable to the geochemical behavior of As is represented by the retardation factor, which is defined as follows:

$$Rf = 1 + r_b/\theta * Kd$$

Where:

Rf = retardation factor

 $r_b = bulk density$ 

 $\theta = porosity$ 

Kd = partition coefficient.

The partition coefficient (Kd) is defined as the ratio of the solid As concentration to the aqueous As concentration. For this analysis, it was derived from the solid-aqueous partitioning data presented in Figure E-2, which applies to As behavior under reducing conditions. This approach is conservative in that it assumes As exists, and remains in, its relatively more mobile trivalent state. Values of Kd presented in Figure E-2 will vary as a function of pH, which at the Study Area is reported to range between about 5.6 and 8.2.

Two values for porosity were considered, which represent likely end-members considering groundwater conditions in the area. A high porosity of 0.3 would correspond to weathered materials occurring near the water table and a lower porosity of 0.01 would correspond to values typical of fractured bedrock. A grain density of 2.55, applicable to the mineral serpentine, was assumed in order to calculate the respective bulk densities at the assumed porosity values.

Rfs, estimated from the conditions described above and the data presented in Figure E-2, range between a low of 21 for a porosity of 0.01 at pH = 5.5 to a high of 54 for a porosity of 0.3 at pH = 7.5 and 8.0. Consistent with the worst-case scenario approach, the lowest value of 21 was applied in the model.

Figure E-4 and E-5 present results of the solute transport modeling for As under the conditions described. Figure E-4 applies to the high porosity simulation and Figure E-5 applies to the low porosity simulation. The Figures present the model-predicted As concentrations versus time at a location 150 feet hydraulically downgradient of monitoring well 1349MW100. Results indicate that a maximum As concentration of about 3.5 mg/L would occur after about 9 to10 years for the low-porosity simulation and about 3.8 mg/L would occur after about 175 years for the high porosity situation. These results illustrate how even under the worst-case conditions assumed herein, significant attenuation of As concentrations is expected occur, resulting in concentrations below the target cleanup values.

TABLE E-1

SOIL SAMPLE RESULTS - METALS PRESIDIO OF SAN FRANCISCO, BUILDING 1349 STUDY AREA\*

COMPARISON WITH PRESIDIO-WIDE BACKGROUND DATA\*\*

Element	Building 1349 Study Area*			Range of Detected Metals in Presidio Geologic Materials*			
	Average	Maximum	Minimum	Serpentinite	Colma Formation	Beach/Dune Sand	Chert/Shale
Fe	31,800	58,800	14,900	32,300 - 120,000	7,650-3,800	6,030-34,900	420-46,000
Mn	414	2,390	17	12,000-270,000	2,430-6,500	1,520-10,500	4270***
Zn	80	212	28	17-114	15.5-61.6	7.45-74.3	2.6-140
Ni	70	163	28	686-3,950	31.2-123	15-82.9	4-110
Cu	45	146	7	11.1-64.6	3.02-80.8	3.11-57.2	3.1-310
As	5.2	17.3	1.8	0.32-4.09	1.49-5	1.11-5.96	2.46-3.2
Cr	66	120	25	493-1,680	24-149	17.9-142	1.1-48.4

### values in mg/Kg

<sup>\*</sup> Results for soil borings 1349SB1 through 1349SB11

<sup>\*\*</sup>Data reported in Cleanup Levels Document, Tables C-1 through C-4 (EKI, 2002)

<sup>\*\*\*</sup> Only one sample in background data set was analyzed for Mn.

FIGURE E-1

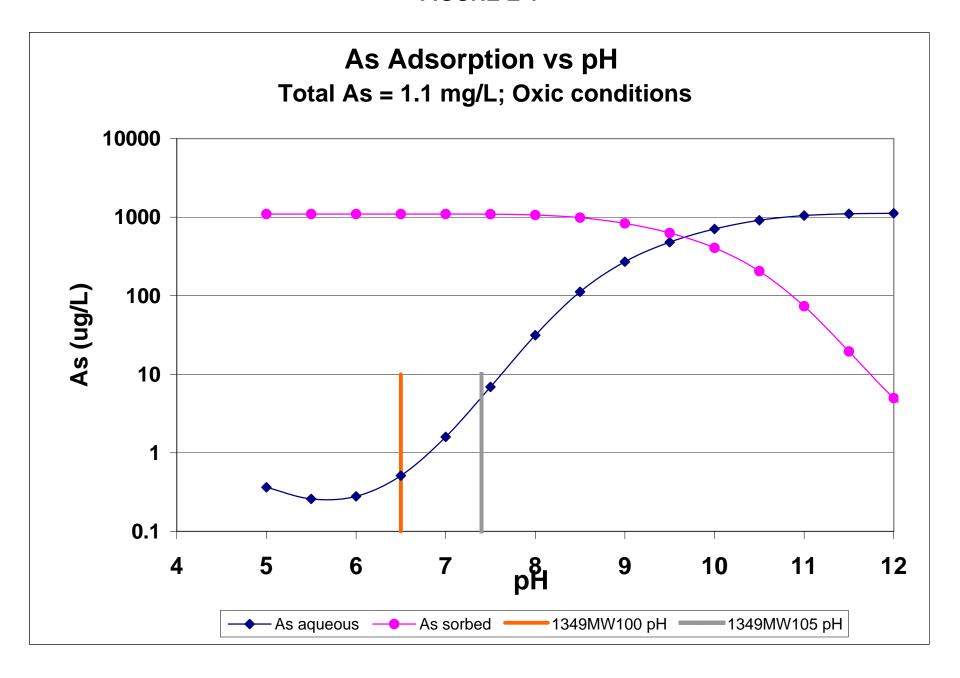


Figure E-2

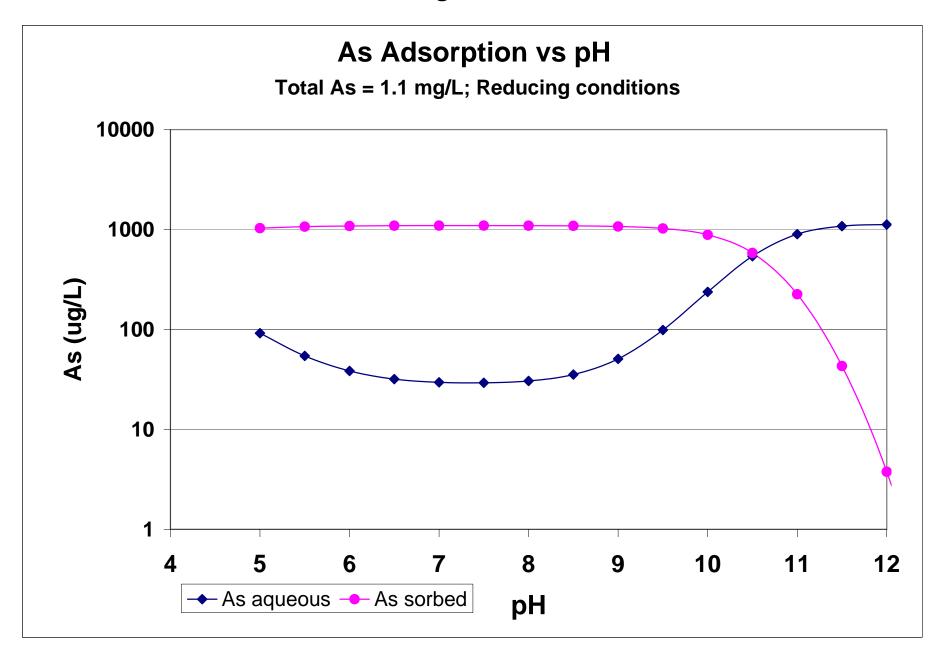


FIGURE E-3

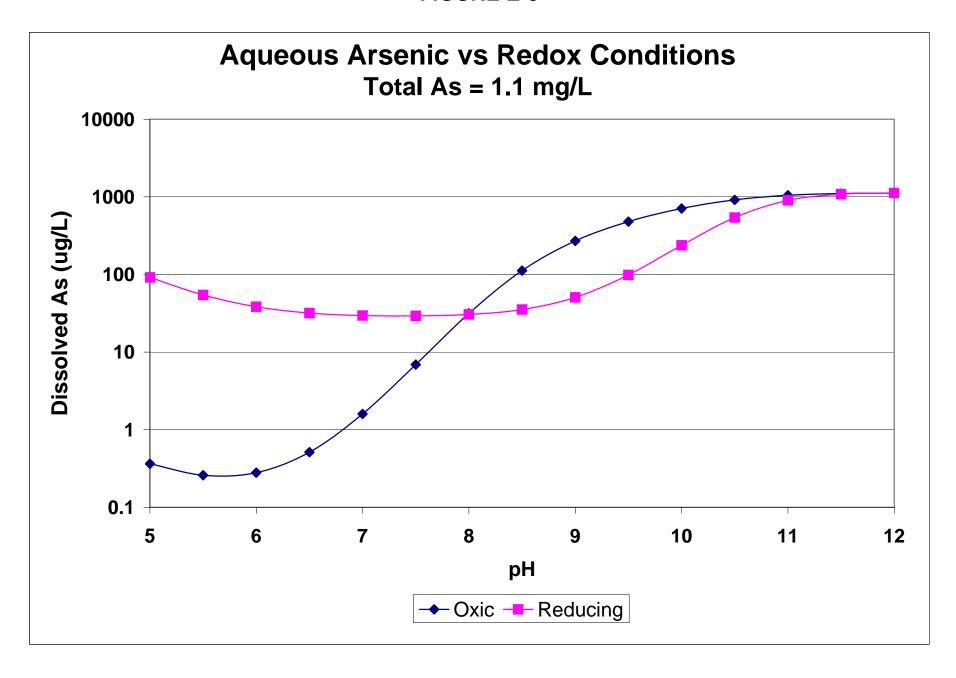


Figure E-4


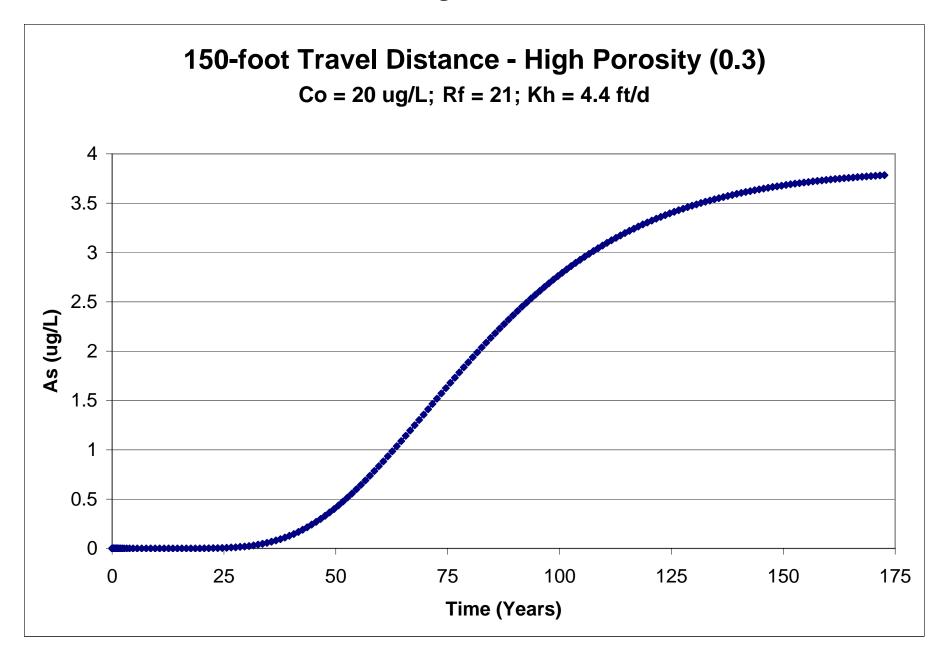


Figure E-5



### Appendix F

## Cost Estimates and Assumptions for Corrective Action Alternatives

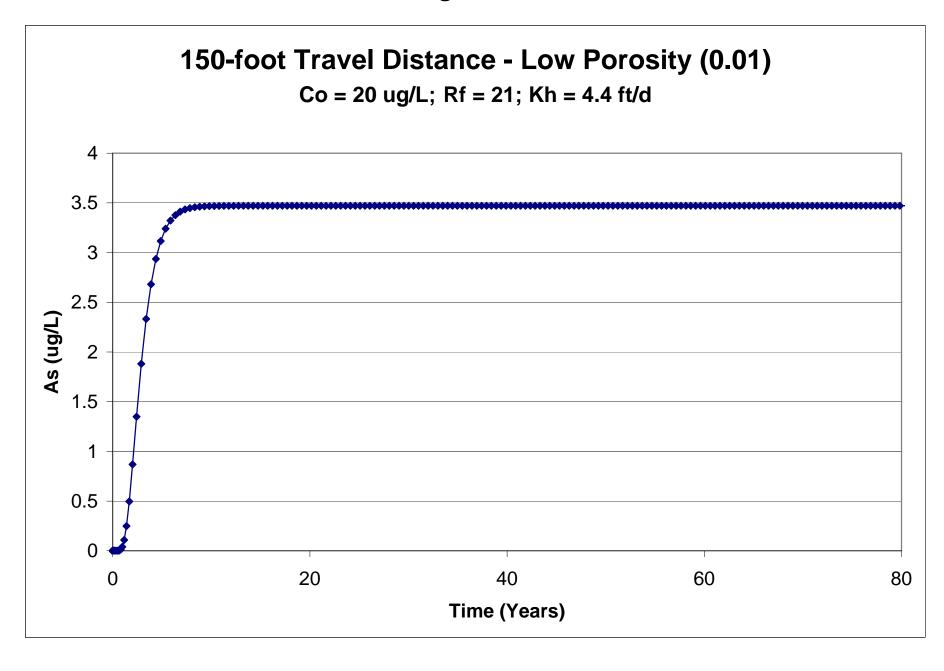

### Table F-1 Summary of Estimated Costs for Corrective Action Building 1349 Study Area Presidio of San Francisco, California

Remedial Unit	Alternative	Estimated Capital Costs (1)	Estimated Annual O&M Costs (1)	O&M Period (years)	Total Estimated Costs (NPV) (2)
Shallow Soil RU	No Action (Table F-2a)	\$6,000	-	-	\$6,000
	Excavation and Offsite Disposal (Table F-2b)	\$428,000	-	-	\$428,000
	Capping (Table F-2c)	\$271,000	\$19,000	30 (3)	\$639,000
	Land-Use Controls (Table F-2d)	\$20,000	\$6,000	30 (3)	\$136,000
Deep Soil RU	No Action (Table F-2a)	\$6,000	_	_	\$6,000
	Excavation and Offsite Disposal (Table F-3a)	\$198,000	-	-	\$198,000
	Subsurface Capping (Table F-3b)	\$200,000	\$14,000	30 (3)	\$471,000
Telecommunications Corridor Soil RU	No Action (Table F-2a)	\$6,000	-	-	\$6,000
	Capping (Table F-4a)	\$328,000	\$19,000	30 (3)	\$696,000
	Excavation and Offsite Disposal (Table F-4b)	\$455,000	_	_	\$455,000
	Land-Use Controls (Table F-2d)	\$20,000	\$6,000	30 (3)	\$136,000
Groundwater RU	No Action (Table F-5a)	\$38,000	-	-	\$38,000
	Groundwater Monitoring (Table F-5b)	\$73,000	\$110,000	2 (4)	
			\$55,000	1 (4)	
			\$6,000	5 (3)	\$363,000
Total and the second of the se	Land-Use Controls (Table F-5c)	\$20,000	\$6,000	30 (3)	\$136,000
Implementation of Preferred Alternatives for All Soil RUs <sup>(5)</sup>	Excavation and Offsite Disposal (Table F-7)	\$737,000	-	-	\$737,000

### Table F-1 Summary of Estimated Costs for Corrective Action Building 1349 Study Area Presidio of San Francisco, California

Remedial Unit	Alternative	Estimated Capital Costs (1)	Estimated Annual O&M Costs (1)	O&M Period (years)	Total Estimated Costs (NPV) (2)
Implementation of Preferred Alternatives for All Soil RUs and Groundwater RU	Excavation and Offsite Disposal (Table F-7) + Groundwater Monitoring (Table F-5b)	\$810,000	\$110,000 \$55,000 \$6,000	2 <sup>(4)</sup> 1 <sup>(4)</sup> 30 <sup>(6)</sup>	\$1,190,000

#### Notes:

Preferred Alternatives are highlighted.

- 1. Detailed estimates for capital and annual operation and maintenance (O&M) costs are presented in Tables F-2 through F-5 and F-7. Individual alternatives may have some redundant costs depending on selected remedy, such as mobilization and Remediation Completion Report.
- 2. Total cost is calculated using a 3.1 percent interest rate. NPV = Net Present Value.
- 3. Land use control (LUC) O&M period. LUCs are included for each RU, where applicable, to compare alternatives separately by RU.
- 4. Groundwater monitoring O&M period.
- 5. Provides cost estimate for implementation of preferred alternatives for all soil RUs. Assumes elimination of redundant costs, such as mobilization and Remediation Completion Report.
- 6. One LUC, over an O&M period of 30 years, is included in the cost estimate for Preferred Alternatives for All Soil RUs and Groundwater RU to account for the potential for soil to be left in-place with constituent concentrations exceeding cleanup levels for unrestricted site use and restrict groundwater use until constituent concentrations are below drinking water cleanup levels.

### Table F-2a Soil Remedial Units Estimated Costs Associates with No Action Building 1349 Study Area Presidio of San Francisco, California

		Esti	mated Costs		
Task Description	Unit	Quantity	Unit Cost	Subtotal	Total
Capital Costs					
General Administrative Costs	ls	1	\$5,000	\$5,000	
					\$5,000
Subtotal Estimated Costs (w/contractor overhead and profit):					\$5,000
Legal and Administrative Costs (assumed to be 5 percent of subt	total estimated co	sts w/contractor over	rhead and profit):		-
Subtotal Estimated Costs (w/legal and administrative costs):					\$5,000
Contingencies (assumed to be 20 percent of subtotal estimated c	osts w/legal and o	dministrative costs)	:		\$1,000
Total Preliminary Estimated Capital Costs of Remedial Alterna	ative:				\$6,000

### Notes

- 1. Totals may not sum exactly because of rounding.
- 2. Derivation of unit rates is presented in Table F-6.

## Table F-2b Shallow Soil Remedial Unit Estimated Costs Associated with Soil Excavation and Offsite Disposal Building 1349 Study Area Presidio of San Francisco, California

				Estimated Co	osts	
	Task Description	Unit	Quantity	Unit Cost	Subtotal	Total
Capital Costs						
General Site Preparent						
	Mobilize Contractor Equipment and Supplies to Site	ls	1	\$23,400	\$23,400	
	Erect and Maintain Perimeter Temporary Fence	ft	1000	\$12.00	\$12,000	
	Decontamination Area for Personnel and Equipmen	ls	1	\$1,500	\$1,500	\$36,900
Abandon Well 13	49MW103					φ50,>00
Abandon 2-inc	h PVC Monitoring Wells	ea	1	\$1,755	\$1,755	
Dispose of We	ll Abandonment Residuals	ea	1	\$500	\$500	
I II D I						\$2,255
-	nt Well 1349MW103R actor equipment and supplies to site	ls	1	\$300	\$300	
	ll groundwater monitoring well	ft	45	\$38	\$1,710	
	stall the groundwater well	day	1	\$1,170	\$1,170	
Engineer to ma	nair the groundwater wen	uay	1	\$1,170	\$1,170	\$3,180
Excavate Waste a	nd Soil					
İ	Excavate Soil, No Segregation	cy	810	\$4.10	\$3,321	
İ	Collect Soil Profile Samples for Disposal (every 500 cy)	ea	2	\$30	\$61	
	Disposal Characterization					
	PAHs by USEPA Method 8270	ea	2	\$250	\$500	
	Total Petroleum Hydrocarbons as Diesel Fuel, Fuel Oil, and					
	Gasoline (USEPA 8015M + USEPA 3630A, silica gel		2	\$140	\$280	
	cleanup)	ea				
	OCPs (USEPA 8081)	ea	2	\$165	\$330	
	Metals (USEPA 6000/7000)	ea	2	\$225	\$450	
	Backfill Exavation	cy	1053	\$23.00	\$24,219	
	Dispose of Nonhazardous Soil at Class II Facility	ton	1685	\$35	\$58,968	
						\$88,129
Restoration Activ						
	Replant in Historic Forest Zone	acre	0.1	\$58,000	\$5,800	
Doolon and Cana	tunction Management Couriess					\$5,800
Engineering	truction Management Services					
Linginicering	Perform General Planning Activities	ls	1	\$23,400	\$23,400	
	Prepare Well Abandonment Letter Report	ls	1	\$5,000	\$5,000	
	Prepare Remedial Design (plans and specifications)	sheet	6	\$7,500	\$45,000	
	Bid, Award, and Negotiate Construction Contract	ls	1	\$29,250	\$29,250	
	.,					\$102,650
Construction Obse						
	Provide Resident Engineer	wk	2	\$5,850	\$11,700	
	Provide Office Support	wk	2	\$2,340	\$4,680	
	Provide Vehicles and Equipment	wk	2	\$1,521	\$3,042	
	Perform Air Monitoring	wk	2	\$1,170	\$2,340	
	Collect Soil Confirmation Samples	ea	41 41	\$30	\$1,230	
	PAHs by USEPA Method 8270	ea	41	\$250	\$10,250	
	Total Petroleum Hydrocarbons as Diesel Fuel, Fuel Oil, and					
	Gasoline (USEPA 8015M + USEPA 3630A, silica gel		41	¢140	¢5.740	
	cleanup)	ea	41	\$140	\$5,740	
	OCPs (USEPA 8081) Metals (USEPA 6000/7000)	ea	41 41	\$165 \$225	\$6,765 \$9,225	
	Perform Independent Data Validation	ea ea	41	\$223 \$41	\$9,223 \$1,681	
	Input Analytical Results into Presidio Database	ea	41	\$18	\$738	
	Prepare Remediation Completion Report	ls	1	\$27,000	\$27,000	
	Topac Remediation Completion Report	1.5	1	Ψ27,000	Ψ21,000	\$84,391
Engineering Proje	ect Management					,-/*
	9% of Design and Excavation Management Services	ls	9%			\$16,834
Subtotal Estimate	d Costs (w/contractor overhead and profit):			· · · · · · · · · · · · · · · · · · ·	· · · · · · · · · · · · · · · · · · ·	\$340,000
Legal and Admini	strative Costs (assumed to be 5 percent of subtotal estimated costs v	v/contractor	overhead and	d profit):		\$17,000
Subtotal Estimate	d Costs (w/legal and administrative costs):					\$357,000
Contingencies (as	sumed to be 20 percent of subtotal estimated costs w/legal and adm	inistrative c	osts):			\$71,000
Total Preliminary	Estimated Capital Costs of Remedial Alternatives:					\$428,000

- 1. Totals may not sum exactly because of rounding.
- 2. Field effort of excavation and well abandonment is estimated to be 2 weeks in duration.
- 3. Table 5-1 presents the soil confirmation sampling program.
- 4. Waste characterization samples will be collected approximately one per 500 cy.
- 5. Assumes that well 1349MW103 will be abandoned prior to excavation and reinstalled after backfilling.
- 6. Volumes are provided in Table 5-1.
- 7. Conversion factor from cy of soil to tons is 1.6.
- Soil volume is in-situ estimation. Backfill is estimated as 1.3 compaction factor.
   Derivation of the unit rates is presented in Table F-6.

#### Table F-2c Shallow Soil Remedial Unit Estimated Costs Associated with Capping Building 1349 Study Area Presidio of San Francisco, California

Task Description			Estimated Cos		
1 ask Description	Unit	Quantity	Unit Cost	Subtotal	Total
Capital Costs					
General Site Preparation					
Mobilize contractor equipment and supplies to site	ls	1	\$23,400	\$23,400	
Erect and maintain perimeter temporary fencing	ft	1,000	\$12	\$12,000	
Set up decontamination area for personnel and equipment	ls	1	\$1,500	\$1,500	\$36,90
Construct Cap					Ψ30,70
Excavate and stockpile top foot of surface soil	cy	93	\$4	\$381	
Collect soil profile samples for disposal or reuse	ea	1	\$30	\$30	
TPHg, TPHd, MO	ea	1	\$140	\$140	
PAHs	ea	1	\$250	\$250	
Furnish and install geosynthentic liner	sf	2500	\$1	\$2,500	
Import and Place Clean Topsoil (12 inches)	cy	121	\$35	\$4,235	
Grade Area	day	1	\$2,000	\$2,000	
Replant in Historic Forest Zone	acre	0.1	\$58,000	\$5,800	
•			· / <u>-</u>		\$15,33
Land Use Controls  Allocated share to prepare LUC Master Reference Report	ls	1	\$5,000	\$5,000	
Allocated share to prepare LUC Master Reference Report	IS	1	\$5,000	\$5,000	
Prepare Site-Specific Addendum to the Land-Use Control	,	1	¢10.000	¢10.000	
Master Reference Report (Area B)	ls	1	\$10,000	\$10,000	
Add Site-Specific Land-Use Controls to Trust GIS System	ls	1	\$500	\$500	\$15,50
Design and Construction Management Services					Ψ10,00
Engineering					
Perform general planning activities	ls	1	\$23,400	\$23,400	
Prepare remedial design (plans and specifications)	sheet	6	\$7,500	\$45,000	
Bid, award, and negotiate construction contract	ls	1	\$29,250	\$29,250	
Construction Observation					
Provide resident engineer	wk	1	\$5,850	\$5,850	
Provide office support	wk	1	\$2,340	\$2,340	
Provide vehicles and equipment	wk	1	\$1,521	\$1,521	
Perform air monitoring	wk	1	\$1,170	\$1,170	
Prepare Remediation Completion Report	ls	1	\$27,000	\$27,000	
Engineering Project Management					\$135,53
9% of Design and Construction Management Services					\$12,19
ubtotal Estimated Costs (w/contractor overhead and profit):	. 1	( <b>.</b>	111		\$215,00
egal and Administrative Costs (assumed to be 5 percent of subtotal estimat	ea costs w/	contractor over	neaa and profit):		\$11,00 \$226,00
					N//D ()(
ubtotal Estimated Costs (w/legal and administrative costs):	1 1 .	tarination of			
abtotal Estimated Costs (w/legal and administrative costs): ontingencies (assumed to be 20 percent of subtotal estimated costs w/legal	and admin	istrative costs):			\$45,00
abtotal Estimated Costs (w/legal and administrative costs): ontingencies (assumed to be 20 percent of subtotal estimated costs w/legal	and admin	istrative costs):			\$45,00
abtotal Estimated Costs (w/legal and administrative costs): contingencies (assumed to be 20 percent of subtotal estimated costs w/legal cotal Preliminary Estimated Capital Costs of Remedial Alternatives: nnual Costs	and admin	istrative costs):			\$45,00
abtotal Estimated Costs (w/legal and administrative costs): ontingencies (assumed to be 20 percent of subtotal estimated costs w/legal otal Preliminary Estimated Capital Costs of Remedial Alternatives:  nnual Costs Inspect and Repair Cap				01/1	\$45,00
abtotal Estimated Costs (w/legal and administrative costs): contingencies (assumed to be 20 percent of subtotal estimated costs w/legal cotal Preliminary Estimated Capital Costs of Remedial Alternatives:  nnual Costs  Inspect and Repair Cap  Perform topographic survey to monitor settling every 5 years	ls	1	\$161	\$161	\$45,00
ibtotal Estimated Costs (w/legal and administrative costs): contingencies (assumed to be 20 percent of subtotal estimated costs w/legal costal Preliminary Estimated Capital Costs of Remedial Alternatives:  Inspect and Repair Cap  Perform topographic survey to monitor settling every 5 years Conduct 5 year review of remedy performance	ls ls	1 1	\$161 \$5,850	\$5,850	\$45,00
and administrative costs): ontingencies (assumed to be 20 percent of subtotal estimated costs w/legal otal Preliminary Estimated Capital Costs of Remedial Alternatives:  nnual Costs Inspect and Repair Cap Perform topographic survey to monitor settling every 5 years	ls	1	\$161		\$45,00 <b>\$271,00</b>
abtotal Estimated Costs (w/legal and administrative costs): contingencies (assumed to be 20 percent of subtotal estimated costs w/legal cotal Preliminary Estimated Capital Costs of Remedial Alternatives:  Innual Costs  Inspect and Repair Cap  Perform topographic survey to monitor settling every 5 years Conduct 5 year review of remedy performance Repair damage to cover  Land Use Controls (Project Management/Administration)	ls ls	1 1	\$161 \$5,850 \$4,212	\$5,850	\$45,00 <b>\$271,00</b>
abtotal Estimated Costs (w/legal and administrative costs): contingencies (assumed to be 20 percent of subtotal estimated costs w/legal cotal Preliminary Estimated Capital Costs of Remedial Alternatives:  nnual Costs  Inspect and Repair Cap  Perform topographic survey to monitor settling every 5 years  Conduct 5 year review of remedy performance  Repair damage to cover	ls ls	1 1	\$161 \$5,850	\$5,850	\$45,00 <b>\$271,00</b>
btotal Estimated Costs (w/legal and administrative costs): ontingencies (assumed to be 20 percent of subtotal estimated costs w/legal atal Preliminary Estimated Capital Costs of Remedial Alternatives:  nnual Costs Inspect and Repair Cap Perform topographic survey to monitor settling every 5 years Conduct 5 year review of remedy performance Repair damage to cover  Land Use Controls (Project Management/Administration)	ls ls ls	1 1 1	\$161 \$5,850 \$4,212	\$5,850 \$4,212	\$45,00 <b>\$271,00</b> \$10,22
intuiting encies (assumed to be 20 percent of subtotal estimated costs w/legal and administrative costs): intuiting encies (assumed to be 20 percent of subtotal estimated costs w/legal atal Preliminary Estimated Capital Costs of Remedial Alternatives:  Innual Costs Inspect and Repair Cap Perform topographic survey to monitor settling every 5 years Conduct 5 year review of remedy performance Repair damage to cover  Land Use Controls (Project Management/Administration) Annual Administrative Cost of Land-Use Controls (Area B) Five-Year Review (annualized \$4,000 over 30 years)	ls ls ls	1 1 1	\$161 \$5,850 \$4,212 \$1,000	\$5,850 \$4,212 \$1,000	\$45,00 <b>\$271,00</b> \$10,22 \$5,00
contingencies (assumed to be 20 percent of subtotal estimated costs w/legal and alministrative costs): contingencies (assumed to be 20 percent of subtotal estimated costs w/legal and Preliminary Estimated Capital Costs of Remedial Alternatives:  Inspect and Repair Cap Perform topographic survey to monitor settling every 5 years Conduct 5 year review of remedy performance Repair damage to cover  Land Use Controls (Project Management/Administration) Annual Administrative Cost of Land-Use Controls (Area B) Five-Year Review (annualized \$4,000 over 30 years)	ls ls ls	1 1 1	\$161 \$5,850 \$4,212 \$1,000 \$4,000	\$5,850 \$4,212 \$1,000	\$45,00 \$271,00 \$10,22 \$5,00 \$15,00
abtotal Estimated Costs (w/legal and administrative costs): contingencies (assumed to be 20 percent of subtotal estimated costs w/legal costal Preliminary Estimated Capital Costs of Remedial Alternatives:  Inspect and Repair Cap Perform topographic survey to monitor settling every 5 years Conduct 5 year review of remedy performance Repair damage to cover  Land Use Controls (Project Management/Administration) Annual Administrative Cost of Land-Use Controls (Area B) Five-Year Review (annualized \$4,000 over 30 years)  abtotal Estimated Costs (w/contractor overhead and profit): legal and Administrative Costs (assumed to be 5 percent of subtotal estimated	ls ls ls	1 1 1	\$161 \$5,850 \$4,212 \$1,000 \$4,000	\$5,850 \$4,212 \$1,000	\$45,00 \$271,00 \$10,22 \$5,00 \$15,00 \$1,00
abtotal Estimated Costs (w/legal and administrative costs): contingencies (assumed to be 20 percent of subtotal estimated costs w/legal cotal Preliminary Estimated Capital Costs of Remedial Alternatives:  Inspect and Repair Cap Perform topographic survey to monitor settling every 5 years Conduct 5 year review of remedy performance Repair damage to cover  Land Use Controls (Project Management/Administration) Annual Administrative Cost of Land-Use Controls (Area B) Five-Year Review (annualized \$4,000 over 30 years)  abtotal Estimated Costs (w/contractor overhead and profit): agal and Administrative Costs (assumed to be 5 percent of subtotal estimated total Estimated Costs (w/legal and administrative costs):	ls ls ls ls ed costs w/	1 1 1 1 1	\$161 \$5,850 \$4,212 \$1,000 \$4,000	\$5,850 \$4,212 \$1,000	\$45,00 \$271,00 \$10,22 \$5,00 \$15,00 \$16,00
untotal Estimated Costs (w/legal and administrative costs): contingencies (assumed to be 20 percent of subtotal estimated costs w/legal cotal Preliminary Estimated Capital Costs of Remedial Alternatives:  Innual Costs Inspect and Repair Cap Perform topographic survey to monitor settling every 5 years Conduct 5 year review of remedy performance Repair damage to cover  Land Use Controls (Project Management/Administration) Annual Administrative Cost of Land-Use Controls (Area B)	ls ls ls ls ed costs w/	1 1 1 1 1	\$161 \$5,850 \$4,212 \$1,000 \$4,000	\$5,850 \$4,212 \$1,000	\$45,00 <b>\$271,00</b> \$10,22 \$5,00

### ${\it Total\ Preliminary\ Estimated\ Costs\ of\ Remedial\ Alternatives:}$

\$639,000

#### Notes

- 1. Totals may not sum exactly because of rounding.
- $2. \ Field \ effort \ for \ cap \ contruction \ assumes \ 1 \ week.$
- 3. Costs for groundwater monitoring are included in the Groundwater RU Costs.

4. Derivation of unit rates is presented in Table F-6.

### Table F-2d

### Shallow Soil and Telecommunication Corridor Soil Remedial Units Estimated Costs Associated with Land-Use Controls Building 1349 Study Area Presidio of San Francisco, California

		Estimated Costs					
Task Description	Unit	Quantity	Unit Cost	Subtotal	Total		
Capital Costs							
Allocated share to prepare LUC Master Reference Report	ls	1	\$5,000	\$5,000			
Prepare Site-Specific Addendum to the Land-Use Control							
Master Reference Report (Area B)	ls	1	\$10,000	\$10,000			
Add Site-Specific Land-Use Controls to Trust GIS System	ls	1	\$500	\$500			
					\$15,500		
Subtotal Estimated Costs (w/contractor overhead and profit):					\$16,000		
Legal and Administrative Costs (assumed to be 5 percent of subtotal estima	ated costs w/contract	or overhead and	profit):		\$1,000		
Subtotal Estimated Costs (w/legal and administrative costs):					\$17,000		
Contingencies (assumed to be 20 percent of subtotal estimated costs w/lego	al and administrative	costs):			\$3,000		
Total Preliminary Estimated Capital Costs of Remedial Alternatives:					\$20,000		
Annual Costs							
Project Management/Administration							
Annual Administrative Cost of Land-Use Controls (Area B)	ls	1	\$1,000	\$1,000			
Five-Year Review (annualized \$4,000 over 30 years)	ls	1	\$4,000	\$4,000			
					\$5,000		
Subtotal Estimated Costs (w/contractor overhead and profit):					\$5,000		
Legal and Administrative Costs (assumed to be 5 percent of subtotal estima	ated costs w/contract	or overhead and	profit):		-		
Subtotal Estimated Costs (w/legal and administrative costs):					\$5,000		
Contingencies (assumed to be 20 percent of subtotal estimated costs w/lego	al and administrative	costs):			\$1,000		
Total Preliminary Estimated Annual Costs of Remedial Alternatives:					\$6,000		
Annual Cost Annualized over 30 years, assumes discount rate of 3.1%					\$116,000		

### Total Preliminary Estimated Costs of Remedial Alternatives:

Notes

1. Totals may not sum exactly because of rounding.

- 2. Costs for groundwater monitoring are included in the Groundwater RU Costs.
- 3. Derivation of unit rates is presented in Table F-6.

\$136,000

### Table F-3a Deep Soil Remedial Unit Estimated Costs Associated with Soil Excavation and Offsite Disposal Building 1349 Study Area Presidio of San Francisco, California

			Estimated Co	osts	
Task Description	Unit	Quantity	Unit Cost	Subtotal	Tota
Capital Costs					
General Site Preparation					
Included in Shallow Soil Remedy					
D W 10.1					\$
Excavate Waste and Soil		20	64.10	6122	
Excavate Soil, No Segregation	cy	30 1	\$4.10 \$30	\$123 \$30	
Collect Soil Profile Samples for Disposal (every 500 cy) Disposal Characterization	ea	1	\$30	\$30	
PAHs by USEPA Method 8270	20	1	\$250	\$250	
FAIIS by USEFA Method 62/0	ea	1	\$230	\$230	
Total Petroleum Hydrocarbons as Diesel Fuel, Fuel Oil, and Gasoline					
(USEPA 8015M + USEPA 3630A, silica gel cleanup)	ea	1	\$140	\$140	
OCPs (USEPA 8081)	ea	1	\$165	\$165	
Metals (USEPA 6000/7000)	ea	1	\$225	\$225	
Backfill Exavation		39	\$23.00	\$897	
Dispose of Nonhazardous Soil at Class II Facility	cy ton	62	\$23.00 \$35	\$2,184	
Dispose of Nonhazardous Son at Class II Facility	ton	02	\$33	\$2,164	\$4.01
					φ+,01-
Design and Construction Management Services					
Engineering					
Perform General Planning Activities	ls	1	\$23,400	\$23,400	
Prepare Remedial Design (plans and specifications)	sheet	6	\$7,500	\$45,000	
Bid, Award, and Negotiate Construction Contract	ls	1	\$29,250	\$29,250	
					\$97,650
Construction Observation					
Provide Resident Engineer	wk	1	\$5,850	\$5,850	
Provide Office Support	wk	1	\$2,340	\$2,340	
Provide Vehicles and Equipment	wk	1	\$1,521	\$1,521	
Perform Air Monitoring	wk	1	\$1,170	\$1,170	
Collect Soil Confirmation Samples	ea	6	\$30	\$180	
PAHs by USEPA Method 8270	ea	6	\$250	\$1,500	
Total Petroleum Hydrocarbons as Diesel Fuel, Fuel Oil, and Gasoline					
(USEPA 8015M + USEPA 3630A, silica gel cleanup)	ea	6	\$140	\$840	
OCPs (USEPA 8081)	ea	6	\$165	\$990	
Metals (USEPA 6000/7000)	ea	6	\$225	\$1,350	
Perform Independent Data Validation	ea	6	\$41	\$246	
Input Analytical Results into Presidio Database	ea	6	\$18	\$108	
Prepare Remediation Completion Report	ls	1	\$27,000	\$27,000	¢42.00
Engineering Project Management					\$43,09
9% of Design and Excavation Management Services	ls	9%			\$12,667.0
7/0 of Design and Excavation Management Scivices	15	270			φ12,007.0
Subtotal Estimated Costs (w/contractor overhead and profit):					\$157,00
Legal and Administrative Costs (assumed to be 5 percent of subtotal estimated costs w/contract	or overhea	d and profit)			\$8,00
Subtotal Estimated Costs (w/legal and administrative costs):	0,0,,,,,,	p. oju).			\$165,00
Contingencies (assumed to be 20 percent of subtotal estimated costs w/legal and administrative	costs):				\$33,00
Total Preliminary Estimated Capital Costs of Remedial Alternatives:	-00.0).				\$198,00

### Notes and Assumptions:

- 1. Totals may not sum exactly because of rounding.
- 2. Field effort of excavation is estimated to be 1 week in duration.
- 3. Table 5-1 presents the soil confirmation sampling program.
- 4. Waste characterization samples will be collected approximately one per  $500\ \mathrm{cy}$ .
- 5. Volumes are provided in Table 5-1.
- 6. Conversion factor from cy of soil to tons is 1.6.
- 7. Soil volume is in-situ estimation. Backfill is estimated as 1.3 compaction factor.
- 8. Cost estimate assumes Shallow Soil RU remedy is excavation and offsite disposal.
- 9. Assumes well 1349MW103 will be abandoned and replaced in shallow RU remedy.
- 10. Derivation of the unit rates is presented in Table F-6.

### Table F-3b

### Deep Soil Remedial Unit Estimated Costs Associated with Subsurface Capping

Building 1349 Study Area
Presidio of San Francisco, California

			Estimated Cos	stimated Costs			
Task Description	Unit	Quantity	Unit Cost	Subtotal	Tota		
Capital Costs							
General Site Preparation							
Included in Shallow Soil Remedy					\$0		
Construct Cap							
Furnish and install geosynthentic liner	sf	100	\$1	\$1,500			
			_		\$1,500		
Land Use Controls							
Allocated share to prepare LUC Master Reference Report	ls	1	\$5,000	\$5,000			
Prepare Site-Specific Addendum to the Land-Use Control							
Master Reference Report (Area B)	ls	1	\$10,000	\$10,000			
Add Site-Specific Land-Use Controls to Trust GIS System	ls	1	\$500	\$500			
			_		\$15,500		
Design and Construction Management Services							
Engineering							
Perform general planning activities	ls	1	\$23,400	\$23,400			
Prepare remedial design (plans and specifications)	sheet	6	\$7,500	\$45,000			
Bid, award, and negotiate construction contract	ls	1	\$29,250	\$29,250			
Construction Observation							
Provide resident engineer	wk	0.5	\$5,850	\$2,925			
Provide office support	wk	0.5	\$2,340	\$1,170			
Provide vehicles and equipment	wk	0.5	\$1,521	\$761			
Perform air monitoring	wk	0.5	\$1,170	\$585			
Prepare Remediation Completion Report	ls	1	\$27,000	\$27,000			
					\$130,091		
Engineering Project Management					611.700		
9% of Design and Construction Management Services					\$11,708		
Subtotal Estimated Costs (w/contractor overhead and profit):		1 1 1 60			\$159,000		
Legal and Administrative Costs (assumed to be 5 percent of subtotal estimated costs w/c	ontractor ove	rneaa ana projit,	:		\$8,000		
Subtotal Estimated Costs (w/legal and administrative costs):					\$167,000		
Contingencies (assumed to be 20 percent of subtotal estimated costs w/legal and admini	strative costs,	):			\$33,000		
Total Preliminary Estimated Capital Costs of Remedial Alternatives:					\$200,000		
Annual Costs							
Inspect and Repair Cap							
Perform topographic survey to monitor settling every 5 years	ls	1	\$161	\$161			
Conduct 5 year review of remedy performance	ls	1	\$5,850	\$5,850			
Conduct 5 year review of remedy performance	13	1	Ψ5,050_	Ψ5,050	\$6,011		
Land Use Controls (Project Management/Administration)					φ0,011		
Annual Administrative Cost of Land-Use Controls (Area B)	ls	1	\$1,000	\$1,000			
Five-Year Review (annualized \$4,000 over 30 years)	ls	1	\$4,000	\$4,000			
11ve-1ear Review (annualized \$4,000 over 50 years)	13	1	φ+,000	φ+,000	\$5,000		
Subtotal Estimated Costs (w/contractor overhead and profit):					\$11,000		
Legal and Administrative Costs (assumed to be 5 percent of subtotal estimated costs w/c	contractor ove	rhead and profit			\$1,000		
Subtotal Estimated Costs (w/legal and administrative costs):		and projet)	-		\$12,000		
Contingencies (assumed to be 20 percent of subtotal estimated costs w/legal and admini	strative costs	).			\$2,000		
Total Preliminary Estimated Annual Costs of Remedial Alternatives:	siranive costs,	,.			\$14,000		
Town Troummany Limited Finnacti Costs of Remedian Fine matters.					Ψ17,000		

### ${\it Total\ Preliminary\ Estimated\ Costs\ of\ Remedial\ Alternatives:}$

\$471,000

Notes

- 1. Totals may not sum exactly because of rounding.
- 2. Field effort for cap construction is estimated to be 1 week in duration.
- 3. Costs for groundwater monitoring are included in the Groundwater RU Costs.
- 4. Assumes shallow soil RU remedy is excavation and offsite disposal.
- 5. Derivation of unit rates is presented in Table F-6.

## Table F-4a Telecommunications Corridor Soil Remedial Unit Estimated Costs Associated with Capping Building 1349 Study Area Presidio of San Francisco, California

	Estimated Costs				
Task Description	Unit	Quantity	Unit Cost	Subtotal	Total
Capital Costs					
General Site Preparation					
Mobilize contractor equipment and supplies to site	ls	1	\$23,400	\$23,400	
Erect and maintain perimeter temporary fencing	ft	1,000	\$12	\$12,000	
Set up decontamination area for personnel and equipment	ls	1	\$1,500_	\$1,500	425.000
Construct Cap					\$36,900
Excavate and stockpile top foot of surface soil	cy	380	\$4.10	\$1.558	
Collect soil profile samples for disposal or reuse	ea	1	\$30	\$30	
TPHg, TPHd, MO	ea	1	\$140	\$140	
PAHs	ea	1	\$250	\$250	
Furnish and install geosynthentic liner	sf	700	\$1	\$1,500	
Import and Place Clean Topsoil (12 inches)	cy	494	\$35	\$17,290	
Replant in Historic Forest Zone	acre	0.03	\$58,000	\$1,740	
Replant in Thistoric Forest Zone	acre	0.03	Ψ30,000_	ψ1,740	\$59,408
Land Use Controls					
Allocated share to prepare LUC Master Reference Report	ls	1	\$5,000	\$5,000	
Prepare Site-Specific Addendum to the Land-Use Control					
Master Reference Report (Area B)	ls	1	\$10,000	\$10,000	
Add Site-Specific Land-Use Controls to Trust GIS System	ls	1	\$500_	\$500	<b>015.50</b>
Design and Construction Management Services					\$15,500
Engineering					
Perform general planning activities	1s	1	\$23,400	\$23,400	
Prepare remedial design (plans and specifications)	sheet	6	\$7,500	\$45,000	
Bid, award, and negotiate construction contract	ls	1	\$29,250	\$29,250	
Construction Observation	15	1	Ψ27,230	Ψ27,230	
Provide resident engineer	wk	1	\$5,850	\$5,850	
Provide office support	wk	1	\$2,340	\$2,340	
Provide vehicles and equipment	wk	1	\$1,521	\$1,521	
Perform air monitoring	wk	1	\$1,170	\$1,170	
Prepare Remediation Completion Report	ls	1	\$27,000	\$27,000	
Frepare Remediation Completion Report	15	1	\$27,000_	\$27,000	\$135,531
Engineering Project Management					012.10
9% of Design and Construction Management Services					\$12,198
Subtotal Estimated Costs (w/contractor overhead and profit):	1		1 (*.)		\$260,000
Legal and Administrative Costs (assumed to be 5 percent of subtotal estimate	ed costs w/contract	or overhead a	na profit):		\$13,000
Subtotal Estimated Costs (w/legal and administrative costs):		,			\$273,000
Contingencies (assumed to be 20 percent of subtotal estimated costs w/legal	and administrative	costs):			\$55,000
Total Preliminary Estimated Capital Costs of Remedial Alternatives:					\$328,00

## Table F-4a Telecommunications Corridor Soil Remedial Unit Estimated Costs Associated with Capping Building 1349 Study Area Presidio of San Francisco, California

			Estimated Co	sts	
Task Description	Unit	Quantity	Unit Cost	Subtotal	Total
Annual Costs					
Inspect and Repair Cap					
Perform topographic survey to monitor settling every 5 years	1s	1	\$161.00	\$161	
Conduct 5 year review of remedy performance	1s	1	\$5,850.00	\$5,850	
Repair damage to cover	1s	1	\$4,212.00	\$4,212	
			_		\$10,223
Land Use Controls (Project Management/Administration)					
Annual Administrative Cost of Land-Use Controls (Area B)	1s	1	\$1,000	\$1,000	
Five-Year Review (annualized \$2,000 over 30 years)	1s	1	\$4,000	\$4,000	
					\$5,000
Subtotal Estimated Costs (w/contractor overhead and profit):					\$15,000
Legal and Administrative Costs (assumed to be 5 percent of subtotal estimated	costs w/contrac	tor overhead an	d profit):		\$1,000
Subtotal Estimated Costs (w/legal and administrative costs):					\$16,000
Contingencies (assumed to be 20 percent of subtotal estimated costs w/legal and	ad administrative	e costs):			\$3,000
Total Preliminary Estimated Annual Costs of Remedial Alternatives:					\$19,000
Annual Cost Annualized over 30 years, assumes discount rate of 3.1%					\$368,000

### Total Preliminary Estimated Costs of Remedial Alternatives:

\$696,000

Note

- 1. Totals may not sum exactly because of rounding.
- 2. Field effort for cap construction is estimated for 1 week in duration.
- 3. Costs for groundwater monitoring are included in the Groundwater RU Costs.
- 4. Derivation of unit rates is presented in Table F-6.

# Table F-4b Telecommunications Corridor Remedial Unit Estimated Costs Associated with Soil Excavation and Offsite Disposal Building 1349 Study Area Presidio of San Francisco, California

			Estimated (	Costs	
Task Description	Unit	Quantity	Unit Cost	Subtotal	Total
Capital Costs					
General Site Preparation					
Mobilize Contractor Equipment and Supplies to Site	ls	1	\$23,400	\$23,400	
Erect and Maintain Perimeter Temporary Fence	ft	1000	\$12.00	\$12,000	
Decontamination Area for Personnel and Equipment	ls	1	\$1,500	\$1,500	¢26.000
Excavate Waste and Soil					\$36,900
Reroute Telecommunications Conduit	ls	1	\$60,000	\$60,000	
Excavate Soil, No Segregation	cy	570	\$4.10	\$2,337	
Collect Soil Profile Samples for Disposal (every 500 cy)	ea	2	\$30	\$61	
Disposal Characterization					
PAHs by USEPA Method 8270	ea	2	\$250	\$500	
Total Petroleum Hydrocarbons as Diesel Fuel, Fuel Oil,					
and Gasoline (USEPA 8015M + USEPA 3630A, silica gel					
cleanup)	ea	2	\$140	\$280	
OCPs (USEPA 8081)	ea	2	\$165	\$330	
Metals (USEPA 6000/7000)	ea	2	\$225	\$450	
Backfill Exavation	cy	741	\$23	\$17,043	
Dispose of Nonhazardous Soil at Class II Facility	ton	1,186	\$35	\$41,496	
Replant in Historic Forest Zone	acre	0.03	\$58,000	\$1,740	
Abandon Well 1349MW100					\$124,237
Abandon 2-inch PVC Monitoring Wells	ea	1	\$1,755	\$1,755	
Dispose of Well Abandonment Residuals	ea	1	\$500	\$500	
Dispose of Well Adalidolinient Residuals	ea	1	\$300	φουσ	\$2,255
Install Replacement Well 1349MW100R					,
Mobilize contractor equipment and supplies to site	ls	1	\$300	\$300	
Drill and install groundwater monitoring well	ft	45	\$38	\$1,710	
Engineer to install the groundwater well	day	1	\$1,170	\$1,170	
					\$3,180
Design and Construction Management Services					
Engineering					
Perform General Planning Activities	ls	1	\$23,400	\$23,400	
Prepare Remedial Design (plans and specifications)	sheet	6	\$7,500	\$45,000	
Bid, Award, and Negotiate Construction Contract	ls	1	\$29,250	\$29,250	¢07.650
Design and Construction Management Services for Well abandonment					\$97,650
Engineering/Project Management/Office Support	day	1	\$500	\$500	
Construction Observation and Coordination	day	1	\$1,000	\$1,000	
Prepare Well Abandonment Letter Report	ls	1	\$5,000	\$5,000	
-			_		\$6,500

## Table F-4b Telecommunications Corridor Remedial Unit Estimated Costs Associated with Soil Excavation and Offsite Disposal Building 1349 Study Area Presidio of San Francisco, California

	Estimated Costs						
Task Description	Unit	Quantity	Unit Cost	Subtotal	Total		
Construction Observation							
Provide Resident Engineer	wk	2	\$5,850	\$11,700			
Provide Office Support	wk	2	\$2,340	\$4,680			
Provide Vehicles and Equipment	wk	2	\$1,521	\$3,042			
Perform Air Monitoring	wk	2	\$1,170	\$2,340			
Collect Soil Confirmation Samples	ea	29	\$30	\$870			
PAHs by USEPA Method 8270	ea	29	\$250	\$7,250			
Total Petroleum Hydrocarbons as Diesel Fuel, Fuel Oil,							
and Gasoline (USEPA 8015M + USEPA 3630A, silica gel							
cleanup)	ea	29	\$140	\$4,060			
OCPs (USEPA 8081)	ea	29	\$165	\$4,785			
Metals (USEPA 6000/7000)	ea	29	\$225	\$6,525			
Perform Independent Data Validation	ea	29	\$41	\$1,189			
Input Analytical Results into Presidio Database	ea	29	\$18	\$522			
Prepare Remediation Completion Report	ls	1	\$27,000	\$27,000			
					\$73,963		
Engineering Project Management							
9% of Design and Excavation Management Services	ls	9%			\$16,030.17		
Subtotal Estimated Costs (w/contractor overhead and profit):					\$361,000		
Legal and Administrative Costs (assumed to be 5 percent of subtotal estimated cos	sts w/cont	ractor overhe	ad and profit):		\$18,000		
Subtotal Estimated Costs (w/legal and administrative costs):					\$379,000		
Contingencies (assumed to be 20 percent of subtotal estimated costs w/legal and a	dministra	tive costs):			\$76,000		
Total Preliminary Estimated Capital Costs of Remedial Alternatives:					\$455,000		

### Notes and Assumptions:

- 1. Totals may not sum exactly because of rounding.
- 2. Field effort of excavation and well abandonment is estimated to be 2 weeks in duration.
- 3. Table 5-1 presents the soil confirmation sampling program.
- 4. Waste characterization samples will be collected approximately one per 500 cy.
- 5. Costs based on assumption that soils will be excavated to a minimum of 16 feet bgs. Attempts will be made to excavate deeper to address soil impacts at greater depths and above groundwater. Costs for additional excavation and disposal are expected to be minimal and within the order of magnitude of costs presented.
- 6. Volumes are provided in Table 5-1.
- 7. Conversion factor from cy of soil to tons is 1.6.
- 8. Soil volume is in-situ estimation. Backfill is estiated as 1.3 compaction factor.
- 9. Derivation of the unit rates is presented in Table F-6.

### Table F-5a Groundwater Remedial Unit Estimated Costs Associated with No Action Building 1349 Study Area Presidio of San Francisco, California

			Estimated Costs		
Task Description	Unit	Quantity	Unit Cost	Subtotal	Total
Capital Costs					
Abandon Wells					
Abandon Groundwater Monitoring well (9 wells)					
Abandon 2-inch PVC Monitoring Wells	ea	9	\$1,755	\$15,795	
Dispose of Well Abandonment Residuals	ea	9	\$500	\$4,500	
			_		\$20,295
Design and Construction Management Services					
Engineering/Project Management/Office Support	day	3	\$500	\$1,500	
Construction Observation and Coordination	day	3	\$1,000	\$3,000	
Prepare Well Abandonment Letter Report	ls	1	\$5,000	\$5,000	
			_		\$9,500
Subtotal Estimated Costs (w/contractor overhead and profit).	<u> </u>				\$30,000
Legal and Administrative Costs (assumed to be 5 percent of s	subtotal estimated c	osts w/contractor ov	verhead and profit):		\$2,000
Subtotal Estimated Costs (w/legal and administrative costs):					\$32,000
Contingencies (assumed to be 20 percent of subtotal estimate	ed costs w/legal and	administrative cost.	s):		\$6,000
Total Preliminary Estimated Capital Costs of Remedial Alte	ernative:				\$38,000

#### Notes

- 1. Totals may not sum exactly because of rounding.
- 2. Derivation of unit rates is presented in Table F-6.

### Table F-5b Groundwater Remedial Unit Estimated Costs Associated with Groundwater Monitoring Building 1349 Study Area Presidio of San Francisco, California

Tools Decemention	Unit	Quantity	Estimated Costs Unit Cost	Subtotal	Tota
Task Description Capital Costs	Ullit	Quantity	Cint Cost	Subtotal	1012
Install Wells 1349MW106 and 1349MW107					
Mobilize contractor equipment and supplies to site	day	2	\$300	\$600	
Drill and install groundwater monitoring well	ft	90	\$38	\$3,420	
Engineer to install the groundwater well	day	2	\$1,170	\$2,340	
	•				\$6,36
Abandon Wells at the Completion of Groundwater Monitoring					
Abandon Groundwater Monitoring well (11 wells)					
Abandon 2-inch PVC Monitoring Wells	ea	11	\$1,755	\$19,305	
Dispose of Well Abandonment Residuals	ea	11	\$500	\$5,500	
					\$24,80
Design and Construction Management Services					
Engineering/Project Management/Office Support	day	4	\$500	\$2,000	
Construction Observation and Coordination	day	4	\$1,000	\$4,000	
Prepare Well Abandonment Letter Report	ls	1	\$5,000	\$5,000	
					\$11,00
Land Use Controls					
Allocated share to prepare LUC Master Reference Report	ls	1	\$5,000	\$5,000	
Prepare Site-Specific Addendum to the Land-Use Control					
Master Reference Report (Area B)	ls	1	\$10,000	\$10,000	
Add Site-Specific Land-Use Controls to Trust GIS System	ls	1	\$500	\$500	
					\$15,50
					\$58,0
Legal and Administrative Costs (assumed to be 5 percent of subtotal estimated	costs w/contra	ctor overhead and p	profit):		\$3,00
Subtotal Estimated Costs (w/contractor overhead and profit): Legal and Administrative Costs (assumed to be 5 percent of subtotal estimated Subtotal Estimated Costs (w/legal and administrative costs):		•	profit):		\$3,00 \$61,00
Legal and Administrative Costs (assumed to be 5 percent of subtotal estimated Subtotal Estimated Costs (w/legal and administrative costs): Contingencies (assumed to be 20 percent of subtotal estimated costs w/legal an		•	profit):		\$3,00 \$61,00 \$12,00
Legal and Administrative Costs (assumed to be 5 percent of subtotal estimated Subtotal Estimated Costs (w/legal and administrative costs):		•	orofit):		\$3,00 \$61,00 \$12,00
Legal and Administrative Costs (assumed to be 5 percent of subtotal estimated Subtotal Estimated Costs (w/legal and administrative costs): Contingencies (assumed to be 20 percent of subtotal estimated costs w/legal and Costal Preliminary Estimated Capital Costs of Remedial Alternative:		•	orofit):		\$3,00 \$61,00 \$12,00
Legal and Administrative Costs (assumed to be 5 percent of subtotal estimated Subtotal Estimated Costs (w/legal and administrative costs):  Contingencies (assumed to be 20 percent of subtotal estimated costs w/legal an Total Preliminary Estimated Capital Costs of Remedial Alternative:  Annual Costs (Years 1-2)		•	orofit):		\$3,00 \$61,00 \$12,00
Legal and Administrative Costs (assumed to be 5 percent of subtotal estimated Subtotal Estimated Costs (w/legal and administrative costs):  Contingencies (assumed to be 20 percent of subtotal estimated costs w/legal an Total Preliminary Estimated Capital Costs of Remedial Alternative:  Annual Costs (Years 1-2)  Groundwater Remedial Unit	ad administrativ	ve costs):	orofit):		\$3,00 \$61,00 \$12,00
Legal and Administrative Costs (assumed to be 5 percent of subtotal estimated Subtotal Estimated Costs (w/legal and administrative costs):  Contingencies (assumed to be 20 percent of subtotal estimated costs w/legal and Internative:  Annual Costs (Years 1-2)  Groundwater Remedial Unit  Conduct Groundwater Monitoring (Quarterly; 7 existing wells, 2 new wells, and	ad administrativ	ere costs):		\$12.624	\$3,00 \$61,00 \$12,00
Legal and Administrative Costs (assumed to be 5 percent of subtotal estimated Subtotal Estimated Costs (w/legal and administrative costs):  Contingencies (assumed to be 20 percent of subtotal estimated costs w/legal and Internative:  Annual Costs (Years 1-2)  Groundwater Remedial Unit  Conduct Groundwater Monitoring (Quarterly; 7 existing wells, 2 new wells, an Sample Wells (11 wells and 1 duplicate sample per event)	nd administrativ nd 2 new replace ea	ement wells)	\$263	\$12,624	\$3,00 \$61,00 \$12,00
Legal and Administrative Costs (assumed to be 5 percent of subtotal estimated Subtotal Estimated Costs (w/legal and administrative costs):  Contingencies (assumed to be 20 percent of subtotal estimated costs w/legal and Preliminary Estimated Capital Costs of Remedial Alternative:  Annual Costs (Years 1-2)  Groundwater Remedial Unit  Conduct Groundwater Monitoring (Quarterly; 7 existing wells, 2 new wells, and Sample Wells (11 wells and 1 duplicate sample per event)  Dispose of Groundwater Sampling Residuals	ad administrativ	ere costs):		\$12,624 \$2,000	\$3,00 \$61,00 \$12,00
Legal and Administrative Costs (assumed to be 5 percent of subtotal estimated Subtotal Estimated Costs (w/legal and administrative costs):  Contingencies (assumed to be 20 percent of subtotal estimated costs w/legal and Total Preliminary Estimated Capital Costs of Remedial Alternative:  Annual Costs (Years 1-2)  Groundwater Remedial Unit  Conduct Groundwater Monitoring (Quarterly; 7 existing wells, 2 new wells, and Sample Wells (11 wells and 1 duplicate sample per event)  Dispose of Groundwater Sampling Residuals  Analyze Groundwater Samples from Wells	nd administrativ	ement wells) 48 4	\$263 \$500	\$2,000	\$3,00 \$61,00 \$12,00
Legal and Administrative Costs (assumed to be 5 percent of subtotal estimated Subtotal Estimated Costs (w/legal and administrative costs):  Contingencies (assumed to be 20 percent of subtotal estimated costs w/legal and Preliminary Estimated Capital Costs of Remedial Alternative:  Annual Costs (Years 1-2)  Groundwater Remedial Unit  Conduct Groundwater Monitoring (Quarterly; 7 existing wells, 2 new wells, and Sample Wells (11 wells and 1 duplicate sample per event)  Dispose of Groundwater Sampling Residuals  Analyze Groundwater Samples from Wells  General Water Quality Parameters	nd administrativ ad 2 new replace ea event ea	ement wells) 48 4 48	\$263 \$500 \$205	\$2,000 \$9,840	\$3,00 \$61,00 \$12,00
Legal and Administrative Costs (assumed to be 5 percent of subtotal estimated Subtotal Estimated Costs (w/legal and administrative costs):  Contingencies (assumed to be 20 percent of subtotal estimated costs w/legal and Preliminary Estimated Capital Costs of Remedial Alternative:  Annual Costs (Years 1-2)  Groundwater Remedial Unit  Conduct Groundwater Monitoring (Quarterly; 7 existing wells, 2 new wells, and Sample Wells (11 wells and 1 duplicate sample per event)  Dispose of Groundwater Sampling Residuals  Analyze Groundwater Samples from Wells  General Water Quality Parameters  Volatile Organic Compounds (USEPA Method 8260B)	nd administrativ ad 2 new replace ea event ea ea	ement wells) 48 4 48 48	\$263 \$500 \$205 \$250	\$2,000 \$9,840 \$12,000	\$3,00 \$61,00 \$12,00
Legal and Administrative Costs (assumed to be 5 percent of subtotal estimated Subtotal Estimated Costs (w/legal and administrative costs):  Contingencies (assumed to be 20 percent of subtotal estimated costs w/legal and Protal Preliminary Estimated Capital Costs of Remedial Alternative:  Annual Costs (Years 1-2)  Groundwater Remedial Unit  Conduct Groundwater Monitoring (Quarterly; 7 existing wells, 2 new wells, and Sample Wells (11 wells and 1 duplicate sample per event)  Dispose of Groundwater Sampling Residuals  Analyze Groundwater Samples from Wells  General Water Quality Parameters  Volatile Organic Compounds (USEPA Method 8260B)  Polycyclic Aromatic Hydrocarbons (USEPA Method 8270C)	nd administrativ ad 2 new replace ea event ea	ement wells) 48 4 48 48 48	\$263 \$500 \$205 \$250 \$250	\$2,000 \$9,840 \$12,000 \$12,000	\$3,00 \$61,00 \$12,00
Legal and Administrative Costs (assumed to be 5 percent of subtotal estimated Subtotal Estimated Costs (w/legal and administrative costs):  Contingencies (assumed to be 20 percent of subtotal estimated costs w/legal and Total Preliminary Estimated Capital Costs of Remedial Alternative:  Annual Costs (Years 1-2)  Groundwater Remedial Unit  Conduct Groundwater Monitoring (Quarterly; 7 existing wells, 2 new wells, and Sample Wells (11 wells and 1 duplicate sample per event)  Dispose of Groundwater Sampling Residuals  Analyze Groundwater Samples from Wells  General Water Quality Parameters  Volatile Organic Compounds (USEPA Method 8260B)  Polycyclic Aromatic Hydrocarbons (USEPA Method 8270C)  Organochlorine Pesticides (USEPA Method 8081)	nd administrativ ad 2 new replace ea event ea ea	ement wells) 48 4 48 48	\$263 \$500 \$205 \$250	\$2,000 \$9,840 \$12,000	\$3,00 \$61,00 \$12,00
Legal and Administrative Costs (assumed to be 5 percent of subtotal estimated Subtotal Estimated Costs (w/legal and administrative costs):  Contingencies (assumed to be 20 percent of subtotal estimated costs w/legal and Total Preliminary Estimated Capital Costs of Remedial Alternative:  Annual Costs (Years 1-2)  Groundwater Remedial Unit  Conduct Groundwater Monitoring (Quarterly; 7 existing wells, 2 new wells, and Sample Wells (11 wells and 1 duplicate sample per event)  Dispose of Groundwater Sampling Residuals  Analyze Groundwater Samples from Wells  General Water Quality Parameters  Volatile Organic Compounds (USEPA Method 8260B)  Polycyclic Aromatic Hydrocarbons (USEPA Method 8870C)  Organochlorine Pesticides (USEPA Method 8081)  Total Petroleum Hydrocarbons as Gasoline, as Diesel Fuel, and as	nd 2 new replace ea event ea ea ea ea	ement wells) 48 4 48 48 48 48	\$263 \$500 \$205 \$250 \$250 \$165	\$2,000 \$9,840 \$12,000 \$12,000 \$7,920	\$3,00 \$61,00 \$12,00
Legal and Administrative Costs (assumed to be 5 percent of subtotal estimated Subtotal Estimated Costs (w/legal and administrative costs):  Contingencies (assumed to be 20 percent of subtotal estimated costs w/legal and Total Preliminary Estimated Capital Costs of Remedial Alternative:  Annual Costs (Years 1-2)  Groundwater Remedial Unit  Conduct Groundwater Monitoring (Quarterly; 7 existing wells, 2 new wells, and Sample Wells (11 wells and 1 duplicate sample per event)  Dispose of Groundwater Sampling Residuals  Analyze Groundwater Samples from Wells  General Water Quality Parameters  Volatile Organic Compounds (USEPA Method 8260B)  Polycyclic Aromatic Hydrocarbons (USEPA Method 8270C)  Organochlorine Pesticides (USEPA Method 8081)  Total Petroleum Hydrocarbons as Gasoline, as Diesel Fuel, and as Motor Oil (USEPA 8015 + USEPA 3630A, silica gel cleanup)	nd 2 new replace ea event ea ea ea ea ea	ement wells) 48 4 48 48 48 48	\$263 \$500 \$205 \$250 \$250 \$165	\$2,000 \$9,840 \$12,000 \$12,000 \$7,920 \$6,720	\$3,00 \$61,00 \$12,00
Legal and Administrative Costs (assumed to be 5 percent of subtotal estimated Subtotal Estimated Costs (w/legal and administrative costs):  Contingencies (assumed to be 20 percent of subtotal estimated costs w/legal and Total Preliminary Estimated Capital Costs of Remedial Alternative:  Annual Costs (Years 1-2)  Groundwater Remedial Unit  Conduct Groundwater Monitoring (Quarterly; 7 existing wells, 2 new wells, and Sample Wells (11 wells and 1 duplicate sample per event)  Dispose of Groundwater Sampling Residuals  Analyze Groundwater Samples from Wells  General Water Quality Parameters  Volatile Organic Compounds (USEPA Method 8260B)  Polycyclic Aromatic Hydrocarbons (USEPA Method 8270C)  Organochlorine Pesticides (USEPA Method 8081)  Total Petroleum Hydrocarbons as Gasoline, as Diesel Fuel, and as Motor Oil (USEPA 8015 + USEPA 3630A, silica gel cleanup)  Metals (USEPA Method 6010/7000)	nd 2 new replace ea event ea ea ea ea	ement wells) 48 4 48 48 48 48 48	\$263 \$500 \$205 \$250 \$250 \$165 \$140 \$225	\$2,000 \$9,840 \$12,000 \$12,000 \$7,920 \$6,720 \$10,800	\$3,00 \$61,00 \$12,00
Legal and Administrative Costs (assumed to be 5 percent of subtotal estimated Subtotal Estimated Costs (w/legal and administrative costs):  Contingencies (assumed to be 20 percent of subtotal estimated costs w/legal and Total Preliminary Estimated Capital Costs of Remedial Alternative:  Annual Costs (Years 1-2)  Groundwater Remedial Unit  Conduct Groundwater Monitoring (Quarterly; 7 existing wells, 2 new wells, and Sample Wells (11 wells and 1 duplicate sample per event)  Dispose of Groundwater Sampling Residuals  Analyze Groundwater Samples from Wells  General Water Quality Parameters  Volatile Organic Compounds (USEPA Method 8260B)  Polycyclic Aromatic Hydrocarbons (USEPA Method 8870C)  Organochlorine Pesticides (USEPA Method 8081)  Total Petroleum Hydrocarbons as Gasoline, as Diesel Fuel, and as Motor Oil (USEPA 8015 + USEPA 3630A, silica gel cleanup)  Metals (USEPA Method 6010/7000)  Perform Independent Data Validation	nd 2 new replace ea event ea ea ea ea ea	ement wells) 48 4 48 48 48 48 48 48	\$263 \$500 \$205 \$250 \$250 \$165 \$140 \$225 \$41	\$2,000 \$9,840 \$12,000 \$12,000 \$7,920 \$6,720 \$10,800 \$1,968	\$3,0 \$61,0 \$12,0
Legal and Administrative Costs (assumed to be 5 percent of subtotal estimated Subtotal Estimated Costs (w/legal and administrative costs):  Contingencies (assumed to be 20 percent of subtotal estimated costs w/legal and Total Preliminary Estimated Capital Costs of Remedial Alternative:  Annual Costs (Years 1-2)  Groundwater Remedial Unit  Conduct Groundwater Monitoring (Quarterly; 7 existing wells, 2 new wells, and Sample Wells (11 wells and 1 duplicate sample per event)  Dispose of Groundwater Sampling Residuals  Analyze Groundwater Samples from Wells  General Water Quality Parameters  Volatile Organic Compounds (USEPA Method 8260B)  Polycyclic Aromatic Hydrocarbons (USEPA Method 8270C)  Organochlorine Pesticides (USEPA Method 8081)  Total Petroleum Hydrocarbons as Gasoline, as Diesel Fuel, and as Motor Oil (USEPA 8015 + USEPA 3630A, silica gel cleanup)  Metals (USEPA Method 6010/7000)	nd 2 new replace ea event ea ea ea ea ea	ement wells) 48 4 48 48 48 48 48 48 48 48	\$263 \$500 \$205 \$250 \$250 \$165 \$140 \$225 \$41 \$18	\$2,000 \$9,840 \$12,000 \$12,000 \$7,920 \$6,720 \$10,800 \$1,968 \$864	\$3,00 \$61,00 \$12,00
Legal and Administrative Costs (assumed to be 5 percent of subtotal estimated ubtotal Estimated Costs (w/legal and administrative costs):  Contingencies (assumed to be 20 percent of subtotal estimated costs w/legal and Total Preliminary Estimated Capital Costs of Remedial Alternative:  Conduct Groundwater Monitoring (Quarterly; 7 existing wells, 2 new wells, and Sample Wells (11 wells and 1 duplicate sample per event)  Dispose of Groundwater Sampling Residuals  Analyze Groundwater Samples from Wells  General Water Quality Parameters  Volatile Organic Compounds (USEPA Method 8260B)  Polycyclic Aromatic Hydrocarbons (USEPA Method 8270C)  Organochlorine Pesticides (USEPA Method 8081)  Total Petroleum Hydrocarbons as Gasoline, as Diesel Fuel, and as Motor Oil (USEPA 8015 + USEPA 3630A, silica gel cleanup)  Metals (USEPA Method 6010/7000)  Perform Independent Data Validation	nd 2 new replace ea event ea ea ea ea ea ea	ement wells) 48 4 48 48 48 48 48 48	\$263 \$500 \$205 \$250 \$250 \$165 \$140 \$225 \$41	\$2,000 \$9,840 \$12,000 \$12,000 \$7,920 \$6,720 \$10,800 \$1,968	\$3,0 \$61,0 \$12,0 <b>\$73,0</b>
Regal and Administrative Costs (assumed to be 5 percent of subtotal estimated subtotal Estimated Costs (w/legal and administrative costs):  Contingencies (assumed to be 20 percent of subtotal estimated costs w/legal and Total Preliminary Estimated Capital Costs of Remedial Alternative:  Annual Costs (Years 1-2)  Groundwater Remedial Unit  Conduct Groundwater Monitoring (Quarterly; 7 existing wells, 2 new wells, and Sample Wells (11 wells and 1 duplicate sample per event)  Dispose of Groundwater Sampling Residuals  Analyze Groundwater Samples from Wells  General Water Quality Parameters  Volatile Organic Compounds (USEPA Method 8260B)  Polycyclic Aromatic Hydrocarbons (USEPA Method 8270C)  Organochlorine Pesticides (USEPA Method 8081)  Total Petroleum Hydrocarbons as Gasoline, as Diesel Fuel, and as Motor Oil (USEPA 8015 + USEPA 3630A, silica gel cleanup)  Metals (USEPA Method 6010/7000)  Perform Independent Data Validation  Input Analytical Results into Presidio Database  Prepare Semi-Annual Monitoring Reports	nd 2 new replace ea event ea ea ea ea ea ea ea	ement wells) 48 4 48 48 48 48 48 48 48 48	\$263 \$500 \$205 \$250 \$250 \$165 \$140 \$225 \$41 \$18	\$2,000 \$9,840 \$12,000 \$12,000 \$7,920 \$6,720 \$10,800 \$1,968 \$864	\$3,00 \$61,00 \$12,00 <b>\$73,0</b> 0
Legal and Administrative Costs (assumed to be 5 percent of subtotal estimated Subtotal Estimated Costs (w/legal and administrative costs):  Contingencies (assumed to be 20 percent of subtotal estimated costs w/legal and Total Preliminary Estimated Capital Costs of Remedial Alternative:  Annual Costs (Years 1-2)  Groundwater Remedial Unit  Conduct Groundwater Monitoring (Quarterly; 7 existing wells, 2 new wells, and Sample Wells (11 wells and 1 duplicate sample per event)  Dispose of Groundwater Sampling Residuals  Analyze Groundwater Samples from Wells  General Water Quality Parameters  Volatile Organic Compounds (USEPA Method 8260B)  Polycyclic Aromatic Hydrocarbons (USEPA Method 8270C)  Organochlorine Pesticides (USEPA Method 8081)  Total Petroleum Hydrocarbons as Gasoline, as Diesel Fuel, and as  Motor Oil (USEPA 8015 + USEPA 3630A, silica gel cleanup)  Metals (USEPA Method 6010/7000)  Perform Independent Data Validation  Input Analytical Results into Presidio Database  Prepare Semi-Annual Monitoring Reports	nd 2 new replace ea event ea ea ea ea ea ea ls	ement wells) 48 4 48 48 48 48 48 48 48 48 48 48 48 4	\$263 \$500 \$205 \$250 \$250 \$165 \$140 \$225 \$41 \$18	\$2,000 \$9,840 \$12,000 \$12,000 \$7,920 \$6,720 \$10,800 \$1,968 \$864	\$3,00 \$61,00 \$12,00 <b>\$73,00</b>
Legal and Administrative Costs (assumed to be 5 percent of subtotal estimated Subtotal Estimated Costs (w/legal and administrative costs):  Contingencies (assumed to be 20 percent of subtotal estimated costs w/legal and Total Preliminary Estimated Capital Costs of Remedial Alternative:  Annual Costs (Years 1-2)  Groundwater Remedial Unit  Conduct Groundwater Monitoring (Quarterly; 7 existing wells, 2 new wells, and Sample Wells (11 wells and 1 duplicate sample per event)  Dispose of Groundwater Sampling Residuals  Analyze Groundwater Samples from Wells  General Water Quality Parameters  Volatile Organic Compounds (USEPA Method 8260B)  Polycyclic Aromatic Hydrocarbons (USEPA Method 8270C)  Organochlorine Pesticides (USEPA Method 8081)  Total Petroleum Hydrocarbons as Gasoline, as Diesel Fuel, and as Motor Oil (USEPA 8015 + USEPA 3630A, silica gel cleanup)  Metals (USEPA Method 6010/7000)  Perform Independent Data Validation  Input Analytical Results into Presidio Database  Prepare Semi-Annual Monitoring Reports  Subtotal Estimated Costs (w/contractor overhead and profit):  Legal and Administrative Costs (assumed to be 5 percent of subtotal estimated)	nd 2 new replace ea event ea ea ea ea ea ea ls	ement wells) 48 4 48 48 48 48 48 48 48 48 48 48 48 4	\$263 \$500 \$205 \$250 \$250 \$165 \$140 \$225 \$41 \$18	\$2,000 \$9,840 \$12,000 \$12,000 \$7,920 \$6,720 \$10,800 \$1,968 \$864	\$3,00 \$61,00 \$73,00 \$73,00 \$88,4 \$88,00 \$4,00
Legal and Administrative Costs (assumed to be 5 percent of subtotal estimated Subtotal Estimated Costs (w/legal and administrative costs):  Contingencies (assumed to be 20 percent of subtotal estimated costs w/legal and Total Preliminary Estimated Capital Costs of Remedial Alternative:  Annual Costs (Years 1-2)  Groundwater Remedial Unit  Conduct Groundwater Monitoring (Quarterly; 7 existing wells, 2 new wells, and Sample Wells (11 wells and 1 duplicate sample per event)  Dispose of Groundwater Sampling Residuals  Analyze Groundwater Samples from Wells  General Water Quality Parameters  Volatile Organic Compounds (USEPA Method 8260B)  Polycyclic Aromatic Hydrocarbons (USEPA Method 8270C)  Organochlorine Pesticides (USEPA Method 8081)  Total Petroleum Hydrocarbons as Gasoline, as Diesel Fuel, and as Motor Oil (USEPA 8015 + USEPA 3630A, silica gel cleanup)  Metals (USEPA Method 6010/7000)  Perform Independent Data Validation  Input Analytical Results into Presidio Database  Prepare Semi-Annual Monitoring Reports  Subtotal Estimated Costs (w/contractor overhead and profit):  Legal and Administrative Costs (assumed to be 5 percent of subtotal estimated Subtotal Estimated Costs (w/legal and administrative costs):	nd 2 new replace ea event ea ea ea ea ea ea ls	ement wells) 48 4 48 48 48 48 48 48 48 48 2   ctor overhead and p	\$263 \$500 \$205 \$250 \$250 \$165 \$140 \$225 \$41 \$18	\$2,000 \$9,840 \$12,000 \$12,000 \$7,920 \$6,720 \$10,800 \$1,968 \$864	\$3,00 \$61,00 \$12,00 <b>\$73,00</b> \$73,00 \$88,42 \$88,00 \$4,00 \$92,00
Legal and Administrative Costs (assumed to be 5 percent of subtotal estimated Subtotal Estimated Costs (w/legal and administrative costs):  Contingencies (assumed to be 20 percent of subtotal estimated costs w/legal and Total Preliminary Estimated Capital Costs of Remedial Alternative:  Annual Costs (Years 1-2)  Groundwater Remedial Unit  Conduct Groundwater Monitoring (Quarterly; 7 existing wells, 2 new wells, and Sample Wells (11 wells and 1 duplicate sample per event)  Dispose of Groundwater Sampling Residuals  Analyze Groundwater Samples from Wells  General Water Quality Parameters  Volatile Organic Compounds (USEPA Method 8260B)  Polycyclic Aromatic Hydrocarbons (USEPA Method 8270C)  Organochlorine Pesticides (USEPA Method 8081)  Total Petroleum Hydrocarbons as Gasoline, as Diesel Fuel, and as Motor Oil (USEPA 8015 + USEPA 3630A, silica gel cleanup)  Metals (USEPA Method 6010/7000)  Perform Independent Data Validation  Input Analytical Results into Presidio Database  Prepare Semi-Annual Monitoring Reports  Subtotal Estimated Costs (w/contractor overhead and profit):  Legal and Administrative Costs (assumed to be 5 percent of subtotal estimated Subtotal Estimated Costs (w/legal and administrative costs):  Contingencies (assumed to be 20 percent of subtotal estimated costs w/legal and	nd 2 new replace ea event ea ea ea ea ea ea ls	ement wells) 48 4 48 48 48 48 48 48 48 48 2   ctor overhead and p	\$263 \$500 \$205 \$250 \$250 \$165 \$140 \$225 \$41 \$18	\$2,000 \$9,840 \$12,000 \$12,000 \$7,920 \$6,720 \$10,800 \$1,968 \$864	\$3,00 \$61,00 \$12,00 <b>\$73,00</b> \$73,00 \$88,42 \$88,00 \$4,00 \$92,00 \$18,00
Legal and Administrative Costs (assumed to be 5 percent of subtotal estimated Subtotal Estimated Costs (w/legal and administrative costs):  Contingencies (assumed to be 20 percent of subtotal estimated costs w/legal and Total Preliminary Estimated Capital Costs of Remedial Alternative:  Annual Costs (Years 1-2)  Groundwater Remedial Unit  Conduct Groundwater Monitoring (Quarterly; 7 existing wells, 2 new wells, and Sample Wells (11 wells and 1 duplicate sample per event)  Dispose of Groundwater Sampling Residuals  Analyze Groundwater Samples from Wells  General Water Quality Parameters  Volatile Organic Compounds (USEPA Method 8260B)  Polycyclic Aromatic Hydrocarbons (USEPA Method 8270C)  Organochlorine Pesticides (USEPA Method 8081)  Total Petroleum Hydrocarbons as Gasoline, as Diesel Fuel, and as Motor Oil (USEPA 8015 + USEPA 3630A, silica gel cleanup)  Metals (USEPA Method 6010/7000)  Perform Independent Data Validation  Input Analytical Results into Presidio Database	nd 2 new replace ea event ea ea ea ea ea ea ls	ement wells) 48 4 48 48 48 48 48 48 48 48 2   ctor overhead and p	\$263 \$500 \$205 \$250 \$250 \$165 \$140 \$225 \$41 \$18	\$2,000 \$9,840 \$12,000 \$12,000 \$7,920 \$6,720 \$10,800 \$1,968 \$864	\$3,00 \$61,00 \$12,00 \$73,00 \$73,00 \$10,00 \$10,00

### Table F-5b Groundwater Remedial Unit Estimated Costs Associated with Groundwater Monitoring Building 1349 Study Area Presidio of San Francisco, California

		Estimated Costs						
Task Description	Unit	Quantity	Unit Cost	Subtotal	Total			
Annual Costs (Year 3)								
Groundwater Remedial Unit								
Conduct Groundwater Monitoring (Semi-Annual; 7 existing wells, 2 new well	s, and 2 new rep	lacement wells)						
Sample Wells (11 wells and 1 duplicate sample per event)	ea	24	\$263	\$6,312				
Dispose of Groundwater Sampling Residuals	event	2	\$500	\$1,000				
Analyze Groundwater Samples from Wells								
General Water Quality Parameters	ea	24	\$205	\$4,920				
Volatile Organic Compounds (USEPA Method 8260B)	ea	24	\$250	\$6,000				
Polycyclic Aromatic Hydrocarbons (USEPA Method 8270C)	ea	24	\$250	\$6,000				
Organochlorine Pesticides (USEPA Method 8081)	ea	24	\$165	\$3,960				
Total Petroleum Hydrocarbons as Gasoline, as Diesel Fuel, and as								
Motor Oil (USEPA 8015 + USEPA 3630A, silica gel cleanup)	ea	24	\$140	\$3,360				
Metals (USEPA Method 6010/7000)	ea	24	\$225	\$5,400				
Perform Independent Data Validation	ea	24	\$41	\$984				
Input Analytical Results into Presidio Database	ea	24	\$18	\$432				
Prepare Semi-Annual Monitoring Reports	ls	1	\$5,850	\$5,850				
					\$44,218			
Subtotal Estimated Costs (w/contractor overhead and profit):					\$44,000			
Legal and Administrative Costs (assumed to be 5 percent of subtotal estimated	costs w/contrac	ctor overhead and pro	ofit):		\$2,000			
Subtotal Estimated Costs (w/legal and administrative costs):					\$46,000			
Contingencies (assumed to be 20 percent of subtotal estimated costs w/legal a	nd administrativ	e costs):			\$9,000			
Total Preliminary Estimated Annual Costs of Remedial Alternative:					\$55,000			
Annual Cost Annualized over 1 year, assumes discount rate of 3.1%					\$53,000			
Annual Costs (Years 1-5)								
Land Use Controls (Project Management/Administration)								
Annual Administrative Cost of Land-Use Controls (Area B)	ls	1	\$1,000	\$1,000				
Five-Year Review (annualized \$4,000 over 5 years)	ls	1	\$4,000	\$4,000				
·					\$5,000			
Subtotal Estimated Costs (w/contractor overhead and profit):					\$5,000			
Legal and Administrative Costs (assumed to be 5 percent of subtotal estimated	costs w/contrac	ctor overhead and pr	ofit):		-			
Subtotal Estimated Costs (w/legal and administrative costs):					\$5,000			
Contingencies (assumed to be 20 percent of subtotal estimated costs w/legal as	nd administrativ	e costs):			\$1,000			
Total Preliminary Estimated Annual Costs of Remedial Alternative:					\$6,000			
Annual Cost Annualized over 5 years, assumes discount rate of 3.1%					\$27,000			

### Total Preliminary Estimated Costs of Remedial Alternative:

\$363,000

This includes the groundwater monitoring necessary for Shallow Soil RU, Deep Soil RU, and Telecommunications RU.

### Notes

- 1. Totals may not sum exactly because of rounding.
- 2. A total of 11 wells are included in the groundwater monitoring program: 7 existing wells, 2 new wells, and 2 new replacement wells. Costs for installation of the 2 new replacement wells are included under the Shallow Soil and Telecommunications Corridor Remedial Unit costs (Tables F-2b and F-4b).
- 3. Assumes 2 year costs based on quarterly sampling and an additional 1 year cost based on semi-annual sampling, as a minimum estimate
- 4. Assumes two days to install new wells and four days to abandon wells.
- 5. Derivation of unit rates is presented in Table F-6.

<sup>&</sup>lt;sup>1</sup> - Groundwater RU will sample all existing monitoring wells and the two newly-installed monitoring wells.

### Table F-5c Groundwater Remedial Unit Estimated Costs Associated with Land-Use Control Building 1349 Study Area Presidio of San Francisco, California

Task Description					
	Unit	Quantity	Unit Cost	Subtotal	Total
Capital Costs					
Allocated share to prepare LUC Master Reference Report	ls	1	\$5,000	\$5,000	
Prepare Site-Specific Addendum to the Land-Use Control					
Master Reference Report (Area B)	ls	1	\$10,000	\$10,000	
Add Site-Specific Land-Use Controls to Trust GIS System	ls	1	\$500	\$500	
			_		\$15,500
Subtotal Estimated Costs (w/contractor overhead and profit):					\$16,000
Legal and Administrative Costs (assumed to be 5 percent of subtotal estimat	ed costs w/contracto	r overhead and p	profit):		\$1,000
Subtotal Estimated Costs (w/legal and administrative costs):					\$16,000
Contingencies (assumed to be 20 percent of subtotal estimated costs w/legal	and administrative of	costs):			\$3,000
Total Preliminary Estimated Capital Costs of Remedial Alternatives:					\$20,000
Annual Costs					
Project Management/Administration					
Annual Administrative Cost of Land-Use Controls (Area B)	ls	1	\$1,000	\$1,000	
Five-Year Review (annualized \$4,000 over 30 years)	ls	1	\$4,000	\$4,000	
					\$5,000
Subtotal Estimated Costs (w/contractor overhead and profit):					\$5,000
Legal and Administrative Costs (assumed to be 5 percent of subtotal estimat	ed costs w/contracto	r overhead and p	profit):		-
Subtotal Estimated Costs (w/legal and administrative costs):					\$5,000
Contingencies (assumed to be 20 percent of subtotal estimated costs w/legal	and administrative of	costs):			\$1,000
TO THE THE THE TAX OF THE TAX OF					¢< 000
Total Preliminary Estimated Annual Costs of Remedial Alternatives:					\$6,000

### Total Preliminary Estimated Costs of Remedial Alternatives:

\$136,000

### Notes

- 1. Totals may not sum exactly because of rounding.
- 2. Derivation of unit rates is presented in Table F-6.

### Table F-6 Derivation of Unit Rates Building 1349 Study Area Presidio of San Francisco, California

Task Description	Unit	Unit Cost 2000 dollars	Unit Cost 2005 dollars	Source
CAPITAL COSTS				
General Site Preparation				
•	,	Φ20,000	<b>#22.400</b>	THE PARK I AND THE PARK I
Mobilize contractor equipment and supplies to site	ls	\$20,000	\$23,400	Table E-3, Main Installation Sites FS, Erler & Kalinowski, Inc, March 2003 (EKI).
Mobilize contractor equipment and supplies to misc. site	ls	\$1,000	\$1,170	EKI, assumes backhoe for excavation < 1,000 cy.
Erect and maintain perimeter temporary fence	ft	\$10.00	\$12	EKI
Provide Personnel Protective Equipment (PPE)	ls		\$2,000	Blasland, Bouck and Lee (BBL)
Decontamination area for personnel and equipment	ls		\$1,500	BBL
Excavate Waste and Soil				
Excavate soil no segregation	cu	\$3.50	\$4.10	EKI, assumes 3 yard bucket, cost may increase with smaller volumes
Collect soil profile samples for disposal	ea	\$26	\$30.42	EKI
Disposal characterization	Ca	\$20	\$30.42	LKI
Total Petroleum Hydrocarbons as Gasoline, as Diesel Fuel, and as	ea		\$140	Curtis & Tompkins (C&T)
Motor Oil (EPA 8015M + EPA 3630A, silica gel cleanup)				
Polycyclic Aromatic Hydrocarbons (EPA Method 8270)	ea	£20	\$250	C&T
Backfill Excavation Dispose of non-hazardous soil at Class II facility	cy ton	\$20 \$35	\$23 \$41	EKI, import, place and compact Presidio Trust (Trust)
Import and place 1 foot topsoil layer	cy	\$30	\$35	EKI
Restoration Activities	-			
Replant in Historic Forest Zone	acre		\$58,000	Trust
Hydroseed	acre	\$1,200	\$1,404	EKI
Abandon Existing Groundwater Monitoring Wells				
Abandon 2-inch PVC monitoring wells	ea	\$1,500	\$1,755	EKI
Dispose of well abandonment residuals	ea		\$500	BBL Subcontractor
Capping				
General Site Preparation				
Erect and maintain perimeter temporary fencing	ft	\$10.00	\$12	EKI
Decontamination area for personnel and equipment	ls		\$1,500	BBL
Construct Cap  Mobilize contractor equipment and supplies to site	ls	\$5,000	\$5,850	EKI
Furnish and install geosynthentic liner	sf	\$0.65	\$1	EKI, \$1500 minimum (BBL)
Import and Place Clean Topsoil (12 inches)	cy	\$30	\$35	EKI
Installation of one groundwater monitoring well				
Mobilize contractor equipment and supplies to site	day		\$300	BBL subcontractor
Drill and install groundwater monitoring well	ft		\$38	BBL subcontractor
Engineer to install the groundwater well	day	\$1,000	\$1,170	EKI
Implement Land Use Controls				
Allocated share to prepare Presidio LUC Master Reference Report	ls		\$5,000	Trust
Prepare Site-Specific Addendum to LUCMRR	ls		\$10,000	Trust
Add Site-Specific Land Use Controls to Trust GIS System	ls		\$500	Trust
Design and Construction Management Services				
Engineering Engineering/Project Management/Office Support	do		\$500.00	DDI accumes anaireas 1/2 day in -fc
Engineering/Project Management/Office Support Construction Observation and Coordination	day day		\$1,000.00	BBL, assumes engineer 1/2 day in office BBL
Prepare Well Abandonment Letter Report	ls		\$5,000.00	BBL
Perform general planning activities	ls	\$20,000	\$23,400	EKI
Prepare Remedial Design (plans and specifications)	ls	\$75,000	\$87,750	EKI
Prepare Remedial Design (plans and specifications)	sheet	\$7,500	\$8,775	EKI
Bid, award, and negotiate construction contract	ls	\$25,000	\$29,250	EKI
General Administrative Costs	ls	720,000	\$5,000	BBL
Construction Observation			•	
Provide resident engineer	wk	\$5,000	\$5,850	EKI assumes \$100/hour, 10 hr/day, 5 days/wk
Provide office support	wk	\$2,000	\$2,340	EKI, assumes \$100/hour, 4 hr/day, 5 days/wk
Provide vehicles and equipment (including PPE)	wk	\$1,300	\$1,521	EKI, assumes vehicle, field supplies, photographs, OVM, Health and Safety Equipment
Perform air monitoring	wk	\$1,000	\$1,170	EKI

#### Table F-6 Derivation of Unit Rates Building 1349 Study Area Presidio of San Francisco, California

Task Description	Unit	Unit Cost 2000 dollars	Unit Cost 2005 dollars	Source
Confirmation Soil Sampling				
Collect soil confirmation samples, surface	ea	\$26	\$30	EKI
Total Petroleum Hydrocarbons as Gasoline, as Diesel Fuel, and as Motor Oil (EPA 8015M + EPA 3630A, silica gel cleanup)	ea		\$140	C&T
Organochlorine Pesticides (EPA 8081)	ea		\$165	C&T
Metals (EPA 6000/7000 series)	ea		\$225	C&T
Polycyclic aromatic hydrocarbons (EPA Method 8270)	ea		\$250	C&T
Prepare Remediation Completion report	ls		\$27,000	BBL
Engineering Project Management				
9% of Design and Excavation	ls	9%		EKI
ANNUAL COSTS				
Conduct Groundwater Monitoring				
Sample wells	ea	\$225	\$263	EKI
Dispose of groundwater sampling residuals	ls		\$500	BBL Subcontractor
Analyze groundwater samples from wells				
General Water Quality Parameters	ea	\$175	\$205	C&T
Metals (EPA Method 6010/7000 Series)	ea		\$225	C&T
Volatile Organic Compounds (EPA Method 8260B)	ea		\$250	C&T
Polycyclic Aromatic Hydrocarbons (EPA Method 8270)	ea		\$250	C&T
Organochlorine Pesticides (EPA Method 8081)	ea		\$165	C&T
Total Petroleum Hydrocarbons as Gasoline, as Diesel Fuel, and as Motor Oil (EPA 8015M + EPA 3630A, silica gel cleanup)	ea		\$140	C&T
Perform independent data validation	ea	\$35	\$41	EKI
Input analytical results into Presidio database	ea	\$15	\$18	EKI
Prepare Semi-Annual Monitoring Reports	ea	\$5,000	\$5,850	EKI (assume letter-report)
Land-Use Controls (30 years)				
Annual Administrative Cost of Land-Use Controls (Area B)	ls		\$1,000	Trust
Five-Year Review (annualized \$4,000 over 30 years)	ls		\$4,000	Trust
Capping				
Perform topographic survey to monitor settling every 5 years	ls		\$161.00	BBL, assumes \$800/day, annual cost at \$161
Conduct 5 year review of remedy performance	ls	\$5,000.00	\$5,850.00	EKI, assumes \$25,000 to prepare report, annual cost of \$5,000
Repair damage to cover	ls	\$3,600.00	\$4,212.00	

### Notes:

Costs were originally developed in July 2000 primarily from estimates and quotations provided by contractors and vendors and EKI's project team's experience on similar projects in the Bay Area.

These costs were provided in the 2003 Feasibility Study (FS) for the Main Installation Sites.

Unit rates from the FS are show in 2000 dollars and have been updated to current dollars using cost index

factors calculated in the Engineer News Record (ENR). The ENR update factor (117% for July 2000 to February 2005)

was applied to the unit rates in order to use them with other 2005 unit rates to prepare cost estimates.

Additional Costs provided in 2005 dollars by BBL and BBL subcontractors.

## Table F-7 All Soil Remedial Units Estimated Costs Associated with Implementation of Preferred Alternatives Building 1349 Study Area Presidio of San Francisco, California

			Estimated	Costs	
Task Description	Unit	Quantity	Unit Cost	Subtotal	Total
Capital Costs					
Shallow Soil RU, Deep Soil RU, Telecommunications RU-Excavation and Offsi	te Disposa	l			
General Site Preparation					
Mobilize Contractor Equipment and Supplies to Site	ls	1	\$23,400	\$23,400	
Erect and Maintain Perimeter Temporary Fence	ft	1000	\$12.00	\$12,000	
Decontamination area for personel and equipment	ls	1	\$1,500	\$1,500	¢26.000
Abandon Well 1349MW103 and 1349MW100					\$36,900
Abandon 2-inch PVC Monitoring Wells	ea	2	\$1,755	\$3,510	
Dispose of Well Abandonment Residuals	ea	2	\$500	\$1,000	
2 is pose of Well Florida Control Control	- Cu	-	φυσσ	Ψ1,000	\$4,510
Install Replacement Well 1349MW103R and 1349MW100R					
Mobilize contractor equipment and supplies to site	ls	1	\$300	\$300	
Drill and install groundwater monitoring well	ft	90	\$38	\$3,420	
Engineer to install the groundwater well	day	2	\$1,170	\$2,340	
					\$6,060
Excavate Waste and Soil					
Reroute Telecommunications Condiut	ls	1	\$60,000	\$60,000	
Excavate Soil, No Segregation	cy	1500	\$4.10	\$6,150	
Collect Soil Profile Samples for Disposal (every 500 cy)	ea	5	\$30	\$152	
Disposal Characterization					
PAHs by USEPA Method 8081/8082	ea	5	\$250	\$1,250	
and Gasoline (USEPA 8015M + USEPA 3630A, silica gel	ea	5	\$140	\$700	
OCPs (USEPA 8081)	ea	5	\$165	\$825	
Metals (USEPA 6000/7000)	ea	5	\$225	\$1,125	
Backfill Exavation	cy	1950	\$23	\$44,850	
Dispose of Nonhazardous Soil at Class II Facility	ton	3120	\$35_	\$109,200	¢224.252
Restoration Activities					\$224,252
Replant in Historic Forest Zone	acre	0.13	\$58,000	\$7,540	
1					\$7,540
Design and Construction Management Services					
Engineering					
Perform General Planning Activities	ls	1	\$23,400	\$23,400	
Prepare Well Abandonment Letter Report	ls	1	\$5,000	\$5,000	
Prepare Remedial Design (plans and specifications)	ls	1	\$75,000	\$75,000	
Bid, Award, and Negotiate Construction Contract	ls	1	\$29,250	\$29,250	
					\$132,650
Construction Observation		_	<b>\$5.050</b>	020.250	
Provide Resident Engineer	wk	5	\$5,850	\$29,250	
Provide Office Support	wk	5	\$2,340	\$11,700	
Provide Vehicles and Equipment	wk	5	\$1,521	\$7,605	
Perform Air Monitoring	wk	5	\$1,170	\$5,850 \$2,280	
Collect Soil Confirmation Samples	ea	76 76	\$30		
PAHs by USEPA Method 8081/8082 and Gasoline (USEPA 8015M + USEPA 3630A, silica gel	ea	76 76	\$250 \$140	\$19,000	
OCPs (USEPA 8081)	ea ea	76 76	\$140 \$165	\$10,640 \$12,540	
Metals (USEPA 6000/7000)	ea	76	\$225	\$12,540 \$17,100	
Perform Independent Data Validation	ea	76	\$223 \$41		
Input Analytical Results into Presidio Database	ea	76	\$18	\$3,116 \$1,368	
Prepare Remediation Completion Report	ls	1	\$27,000	\$27,000	
110paie remediation completion report	1.5		Ψ27,000_	Ψ=1,000	\$147,449
Engineering Project Management					,
9% of Design and Excavation Management Services	ls	9%			\$25,209
Subtotal Estimated Costs (w/contractor overhead and profit):					\$585,000
Legal and Administrative Costs (assumed to be 5 percent of subtotal estimated costs	w/contrac	tor overhead	and profit):		\$29,000
Subtotal Estimated Costs (w/legal and administrative costs):					\$614,000
Contingencies (assumed to be 20 percent of subtotal estimated costs w/legal and ad	ministrativ	e costs):			\$123,000
Total Preliminary Estimated Capital Costs of Remedial Alternatives:		,			\$737,000


### Notes:


- 1. Totals may not sum exactly because of rounding.
- 2. Derivation of unit rates is presented in Table F-6.
- 3. Assumptions for excavation and offsite disposal in each RU are detailed on Tables F-2b, F-3a, and F-4b

### Appendix G

### **Hydrogeochemistry Data**



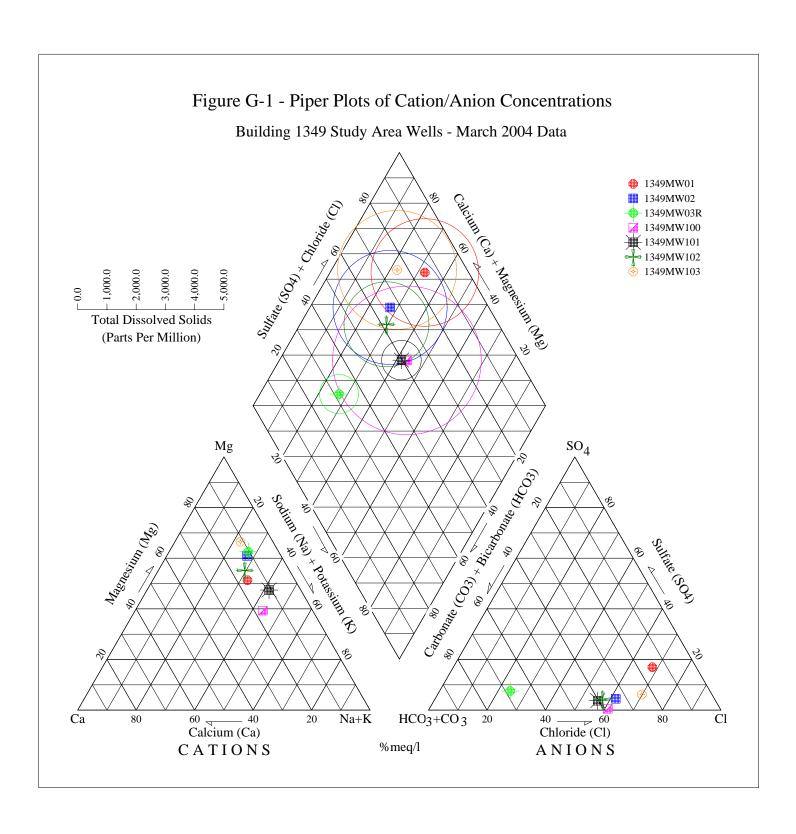


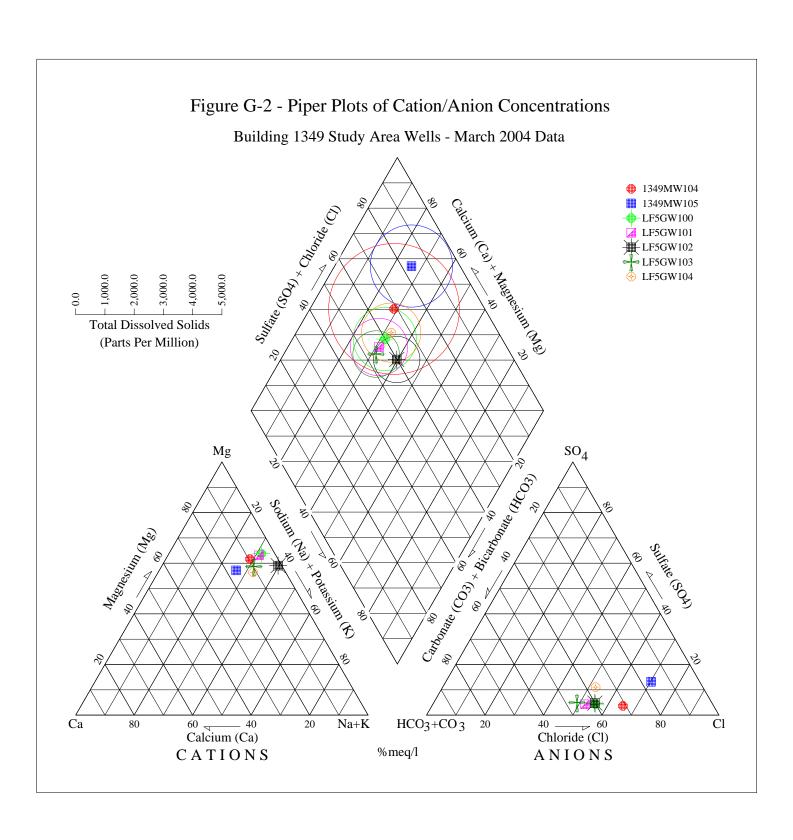

### Appendix H

Groundwater Elevation Maps from Semiannual Groundwater Monitoring Report, Third and Fourth Quarters 2004 (Treadwell & Rollo, 2005)




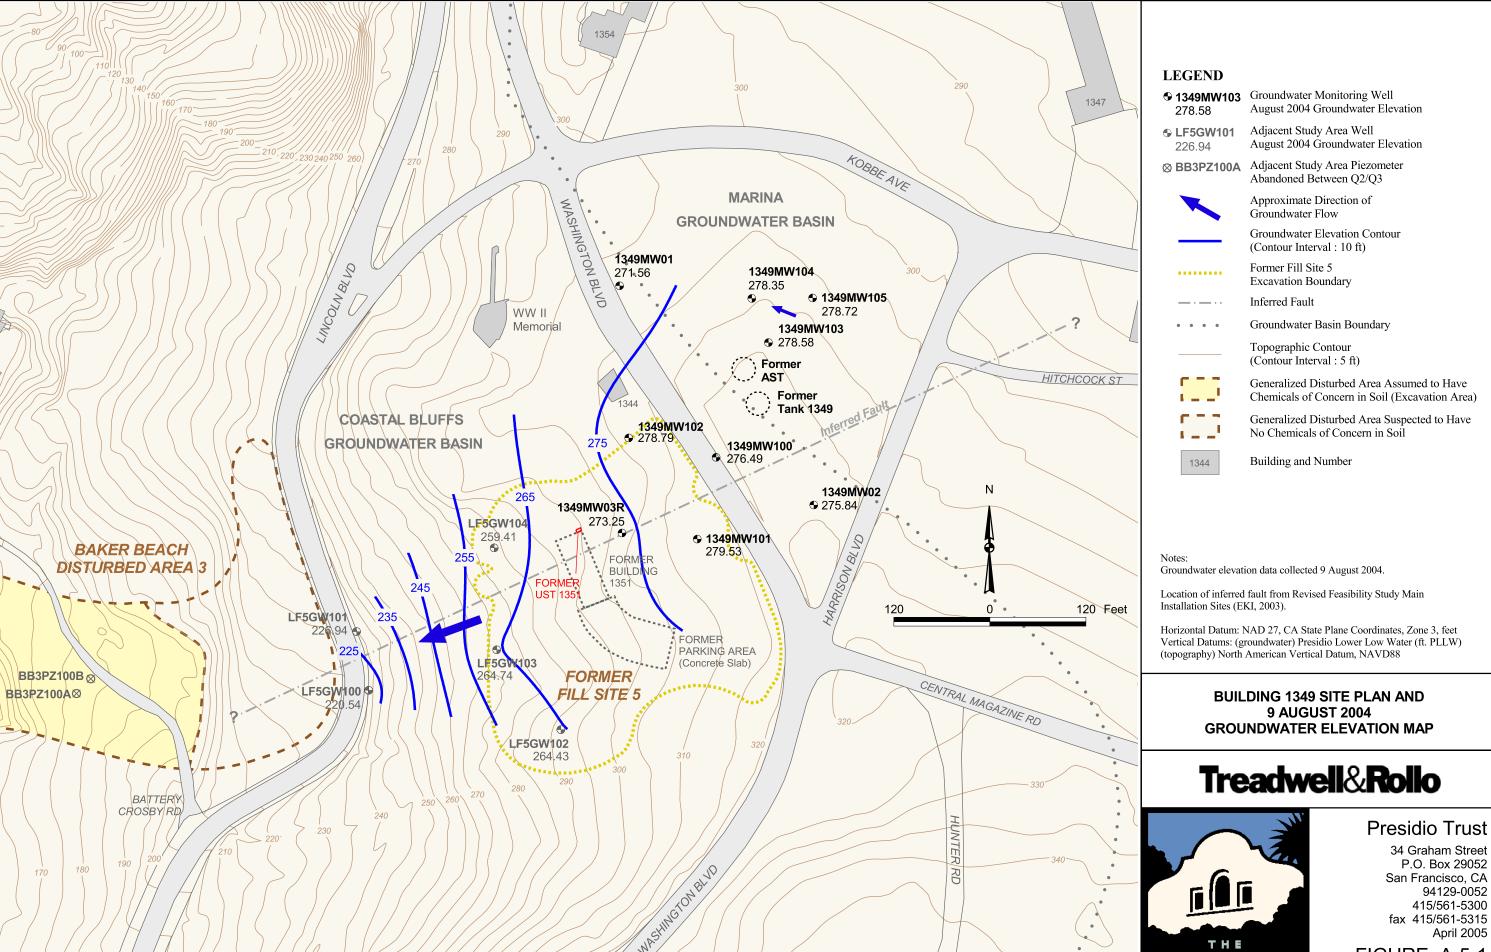

April 2005 FIGURE A-5-1

PRESIDIO TRUST

94129-0052 415/561-5300

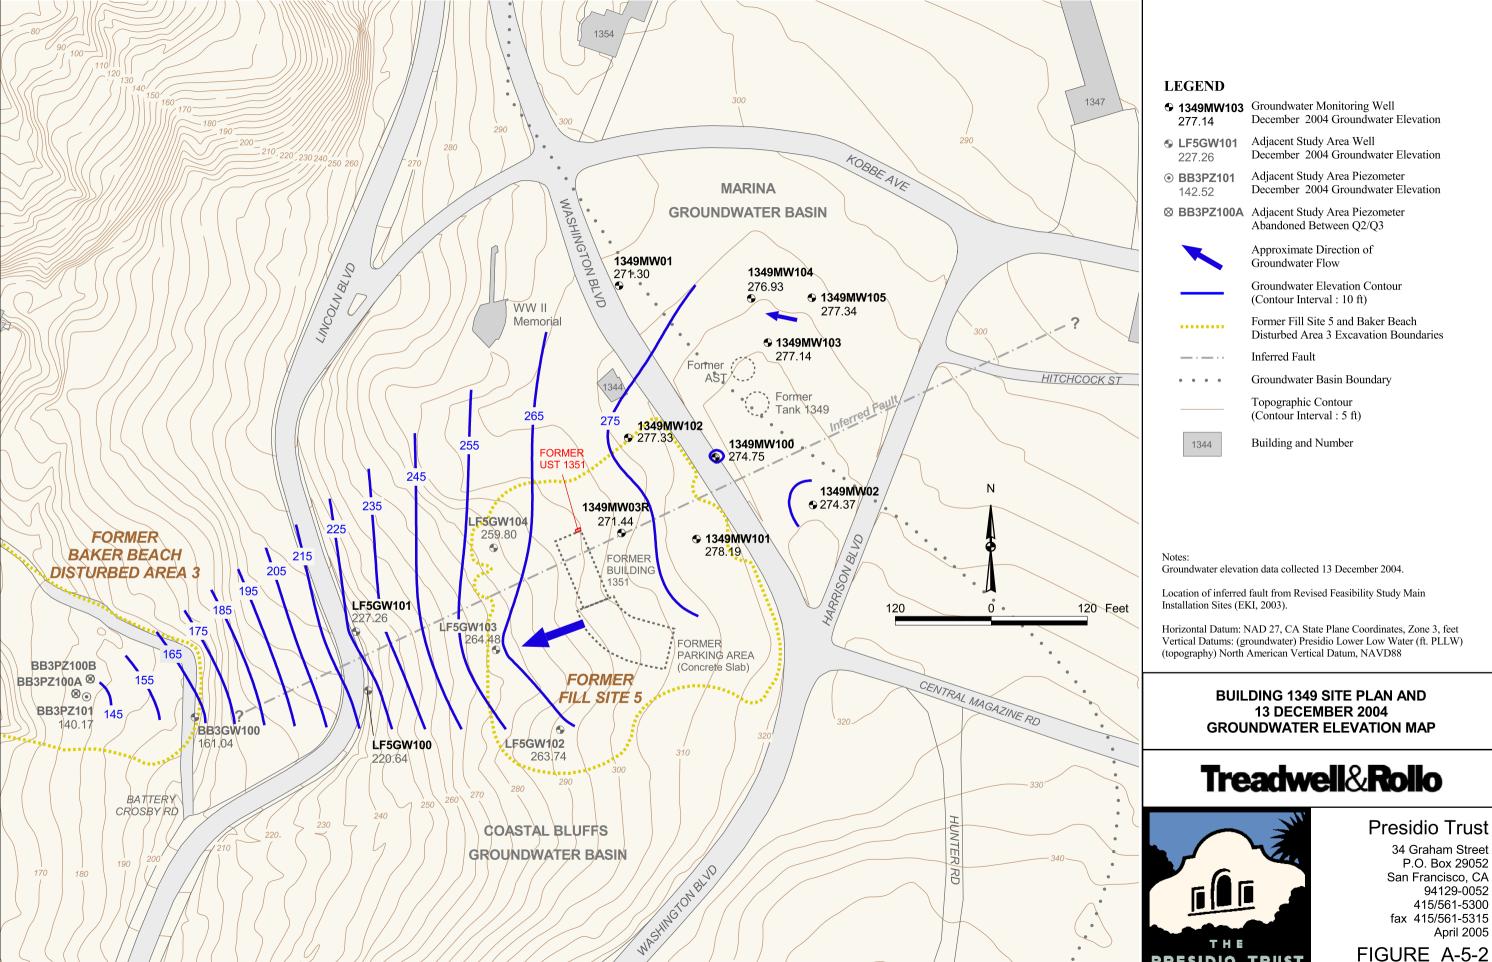

December 2004 Groundwater Elevation

December 2004 Groundwater Elevation


Groundwater Elevation Contour

Former Fill Site 5 and Baker Beach

Vertical Datums: (groundwater) Presidio Lower Low Water (ft. PLLW)

**GROUNDWATER ELEVATION MAP** 

### Treadwell&Rollo

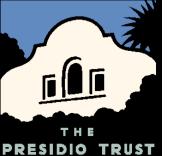

### Presidio Trust

34 Graham Street P.O. Box 29052 San Francisco, CA 94129-0052 415/561-5300 fax 415/561-5315 April 2005